



THE ARBORICULTURAL
CONSULTANCY LTD

Arboricultural Impact Assessment

Scarp House, Steyning

Report Reference Number: AIA.SH.1005.V2

Version: Two

Date: 06 May 2026

Site address:
Scarp House
Horsham Road
Steyning
BN44 3AA

The Arboricultural Consultancy LTD
3 Old Barn Way
Southwick
West Sussex
BN42 4NS

01273 252162
office@thearbconsultant.co.uk
www.thearboriculturalconsultancy.co.uk

Director- Benjamin Tidey. Company Registered in England and Wales.
Company Reg- 9562286

Contents

	Page
1.0 Introduction	4
2.0 Executive Summary	4
3.0 Scope of Tree Survey, Plans, and Report	5
4.0 Terms of Reference	5
5.0 Description of the Site and Proposed Works	6
6.0 Tree Information	7
7.0 Arboricultural Impact	8
8.0 Recommendations	11
9.0 Conclusion	12
<u>Appendix</u>	13

Surveyors Details			
Author(s) Name	Company	Position	Contact information
Ben Tidey FdSc arb, MArborA.	The Arboricultural Consultancy Ltd	Arboricultural Consultant	3 Old Barn Way Southwick West Sussex BN42 4NS Tel: 07736 385585 Email: ben@thearbconsultant.co.uk
Qualifications			
Foundation degree in Arboriculture (level 5), Lantra Professional Tree Inspection.			

Details:

Purpose of the report:

The report is designed to fulfil the recommended criteria for the provision of arboricultural information in validating planning applications (ref: Department for Communities and Local Government Circular 02/2008 and the associated guidance document entitled 'Validation of Planning Applications').

Included within the contents of this report is:

- Tree Impact Assessment detailing the Arboricultural Implications and potential impact from the proposed development on the local tree population.
- Outlined of trees to be retained, trees to be removed and where appropriate tree protection measures that may mitigate tree loss or damage.

Client: SJD Projects Ltd on behalf of James Reader

Date: 06 May 2026

Report prepared by: Mr B Tidey FdSc (arb) of The Arboricultural Consultancy Ltd

Email: ben@thearbconsultant.co.uk

Address: 3 Old Barn Way, Southwick, West Sussex, BN42 4NS

Tel: 01273 252162/ 07736835585

Site Details:

Site Address:

Scarp House
Horsham Road
Steyning
BN44 3AA

Proposal:

The proposed development is for a new dwelling with associated new driveway, carparking, outbuildings and landscaping.

Key Terms and Abbreviations:

A comprehensive list of the key terms and abbreviations has been included to help explain some of the terminology, found in the [appendix](#).

Use of Report:

This report is to be used at the development stage and not all the information is applicable to every reader. The summary highlights which areas are more applicable to specific users of the report to help target the relevant information to those implementing the necessary instruction.

This report shall be used in accordance with document: Arboricultural Impact Plan ref – AIP.SH.1005.V2, this will provide tree location and give context to this report.

This report must not be processed using any editing software that may affect the integrity of this document, such as for redaction purposes.


Should this document be shared with a local authority then the client or planning consultant should check the original unedited document appears within the application.

Survey Method & Caveats

All tree inspections, unless specified, have been undertaken from ground level and using non-invasive techniques. Comments contained within the report on the condition and risk associated with any tree relate to the condition of the tree at the date and time of survey. Please note that the condition of trees is subject to change. This change may occur but is not limited to biological and non-biological factors as well as mechanical/ physical changes to conditions in the proximity of the tree. Trees should be inspected at intervals relative to identified site risks and in accordance with relevant HSE and Central Government guidance. The Arboricultural Consultancy can provide further information on this matter if required. Where tree surgery works have been identified these should only be undertaken after checks with the relevant authority have been made, it is necessary to ensure that works may lawfully be undertaken. Up to date checks should be made as to the possible protection status of trees/ vegetation or land they are located within, these checks should cover, but are not limited to; Tree Preservation Orders (TPOs), Conservation Area, planning conditions, Areas of Outstanding Natural Beauty (AONBs), Ramsar, Special Protection Areas (SPA), Special Areas of Conservation (SAC), Sites of Special Scientific Interest (SSSI). Locations of designation can be found at <http://magic.defra.gov.uk/MagicMap.aspx> and further advice on designations can be found at <http://incc.defra.gov.uk>. Further advice on TPOs, Conservation Areas or planning condition can be found with the local governing organisation. All works should be undertaken in accordance with the appropriate Duty of Care. This should include, for example, site specific risk assessments and due diligence inspections for the presence of protected species. Any comment relating to 3rd party trees has been made without full access to the tree(s). Should these trees have any impact on the site we would advise you to instruct us to contact the third party and undertake further inspection work.

The trees have been surveyed in accordance with the criteria set in the BS: 5837: Trees in Relation to Design, Demolition and Construction - 2012. A full hazard assessment of the trees (including assessment of decay or their defects and their implications) has not been undertaken as this is considered beyond the scope of this report. Any obvious hazards and defects have been identified where relevant in the Tree Survey Schedule and appropriate relating works have been recommended. Where relevant, trees not located within the legal property of the owner have been included and any works would be subject (where relevant by law, Statue and Common) to the owner's permission. Where appropriate further investigative works to be undertaken have been detailed and recommended. This may include climbing inspections, below ground exploratory investigations and the use of specialist decay detection equipment. Detailed ecological considerations are also beyond the scope of this report. UK and European Wildlife Legislation may affect the timing and even prohibit the enhancement of works and operations described in this report. Most of the information regarding wildlife can be found in the Wildlife and Countryside Act 1981 & updated 1994. This includes information of wild birds, bats, badgers and some insects. Bats in particular are afforded particular protection, and a specialist is required to determine if bats are present or may be affected when carrying out tree works. Further information is available from Natural England.

This survey and reports have been undertaken and produced by The Arboricultural Consultancy Ltd. All information within this report was correct at time of assessment.



Ben Tidey FdSc

Consultant Arboriculturist

Wednesday, 06 May 2026

1.0 Introduction

- 1.1. The Arboricultural Consultancy have been appointed by Atelier de Linde, to provide information regarding the impact to trees from the proposed property development.
- 1.2. The site was inspected by Ben Tidey FdSc arb on 20th August 2025 and 1st November 2025, this tree survey included all trees that are within influencing distance of the area to be developed.
- 1.3. The trees were assessed to standards set out in BS 5837:2012: Trees in relation to design, demolition and construction – Recommendations. This standard will be used to guide future reports and working methodologies where appropriate.
- 1.4. The tree numbers used in this report refer to the tree numbers used in our Tree Constraints Plan and Tree Schedule. Following completion of this document this impact assessment was compiled using the proposed plans that were supplied by the client.
- 1.5. This arboricultural impact assessment will discuss the value of the tree resources in proximity to the proposal, outline the impact to this resource and comment where there will be a requirement for tree protection, damage mitigation and strategic planning of site logistics.

2.0 Executive Summary

- 2.1. The proposed development is for a new dwelling with associated new driveway, carparking, outbuildings and landscaping.
- 2.2. The proposed development will require the removal of part of TG7 and all of TG6.
- 2.3. There will be the need for facilitation pruning to roadside hedging and a single Ash tree, T1.
- 2.4. There will be an incursion to the RPA of retained trees T5 and T7.
- 2.5. A summary of the affected trees for the proposed development is detailed in the table below:

Impact	Reason	A	B	C	U
Trees to be removed	To facilitate the development or due to their condition (U cat)	None	None	TG6, TG7 (part)	None
Retained trees to be pruned	To address identified defects/ facilitate construction	T1	None	TG7 (part)	None
Conflicts with tree RPAs	Incursion of the RPA of trees to be retained	None	T5, T7	None	None

- 2.6. Trees to be removed are part of the hedging tree group TG7, this will require the removal of an estimated 29 individual multi-stemmed trees. This will be for the new driveway and associated visibility splays. The loss shall be compensated for with the establishment of new hedging inwards to the site following the required clearance lines.
- 2.7. The remove of tree group TG6 will be to allow for replacement quality tree planting in this area.

- 2.8. The pruning to trees will be required for T67, this will be for the visibility splays of the new driveway, the extent of the pruning is varied and will depend on growth, however given the tree species being of hedging species, they will react well to pruning. This with new tree/ hedging establishment within this area will mean there is very little long-term impact from this aspect of the project.
- 2.9. There will be a requirement for the facilitation pruning of T1, a large high quality Ash tree, this pruning is required to stop inadvertent tree damage. The pruning will require a reduction of lower branching by about 25% (c.2.5m) of its length on the northeastern corner.
- 2.10. There will be an incursion to the Root Protection Area (RPA) of T5 and T7, this will be from the removal of the lightweight structure shed on the northeast corner of the site.
- 2.11. There will be a requirement for the implementation of tree protection to reduce the impact to further trees across the site, this shall be prescribed within an Arboricultural Method Statement, the protection will stop inadvertent tree damage during the construction phase.
- 2.12. The loss of trees is regrettable however with a strong planting and tree establishment plan, this loss will be mitigated and offer an opportunity to further enhance the area.

3.0 Scope of Tree Survey, Plans and Report

- 3.1. To carry out a tree condition appraisal on the trees at the above site, providing information as to the impact from the development on the local tree population.
- 3.2. To undertake the tree appraisal in accordance with the principles of BS5837: 2012 'Trees in relation to design, demolition and construction - Recommendations'.
- 3.3. To produce a Tree Constraints Plan (TCP), showing the location of surveyed trees, their BS5837: 2012 categorisation and the theoretical Root Protection Areas (RPA).
- 3.4. To carry out this Arboricultural Impact Assessment on the effect to the local tree population from the development, commenting on whether tree removal is necessary or if action can be taken to reduce tree loss.
- 3.5. The purpose of this report is to comment on the arboricultural implication of the proposed development and to aid with decision-making. This report will aid in the planning of tree protection methods, construction techniques and working practices that are to be adopted on this site.
- 3.6. If the guidelines and principles outlined in this report are not adhered to, as with all development sites there is a risk that the construction activities will result in damage to and potentially the death of the retained trees. Damage to the trees will significantly increase the risk of their health declining and may increase the risk of their complete or partial failure.

4.0 Terms of Reference

- 4.1. Reference documents:
 - BS5837:2012 'Trees in relation to design, demolition and construction – Recommendations'
 - BS3998:2010 'Tree work – Recommendations'

- BGS Open Source Soil Data <http://www.bgs.ac.uk/home.html>
- Tree Constraints Plan Information and Tree Schedule - Land South of Sunningdale, Steyning - Ref TS.LSS.1005.V1
- Tree Constraints Plan – TCP.LSS.1005.V1
- Preliminary Impact Plan - Land South of Sunningdale - ref PIP.LSS.1005.V1

4.2. Documents supplied by client

- 2591_SCARP_HOUSE_Planting_Schedule_JPD_2026 - _PLANT_SCHEDULE
- 2591-REA001-L401-TREE_ HEDGE & SEED PLAN
- 2591-REA001-L104A-GA LANDSCAPE PLAN REV A
- 2591-REA001-L104A-GA LANDSCAPE PLAN REV B
- 2591-REA001-L401 B-TREE_ HEDGE & SEED PLAN REV B
- 2591-REA001-L104 C-GA LANDSCAPE PLAN REV C

5.0 Description of the Site and Proposed Works

- 5.1. The proposed development is for a new dwelling with associated new driveway, carparking, outbuildings and landscaping.
- 5.2. The immediate and distant landscape character is within a rural setting close to Steyning.
- 5.3. The general topography of the site is flat with localised undulations.
- 5.4. The primary access to the site is from Horsham Road where a new driveway is to be installed.
- 5.5. The underlying geology of the land as described from *British Geological Survey* - <http://www.bgs.ac.uk/>.

Site Location (BGS Soil)



Bedrock geology description:

Folkestone Formation-Sandstone. These sedimentary rocks are shallow-marine in origin. They are detrital, ranging from coarse- to fine-grained (locally with some carbonate content) forming interbedded sequences.

6.0 Tree Information

6.1. Tree locations

- 6.1.1. There were 29 individual trees, and 7 tree groups recorded that may be affected by the proposed development.
- 6.1.2. The full information regarding the trees included within this report can be found in the tree schedule and tree constraints plan – *ref TCP.LSS.1005.V1*.
- 6.1.3. By BS5837:2012 categorisation ([appendix](#)) individually there are; 4 individual trees of A category (high quality), 12 individual trees and 2 groups of B category (moderate quality), 9 individual trees and 5 groups of C category (low quality), and 4 individual trees of U category (unsuitable for retention) trees and groups across the site.
- 6.1.4. These trees' locations and a summary of their visual contributions can be summarised as follows:

BS 5837 Cat	A	B	C	U
Visual amenity from public areas	T1, T14,	T5, T6, T7, T11, T12, T27, T28, TG7	T2, T3, T4, T8, T9, T10, T16,	None
Internal contribution only	T20, T26	T17, T19, T22, T23, , T29 TG4	T18, T24, TG7 TG1, TG2, TG3, TG5, TG6	T13, T15, T21, T25

6.2. Statutory protection

- 6.3. A check for any statutory protection for trees included within this report was undertaken with Horsham District Council on the 26.08.2025 and confirmed that the site is not within a Conservation Area nor has any tree protected under a Tree Preservation Order.

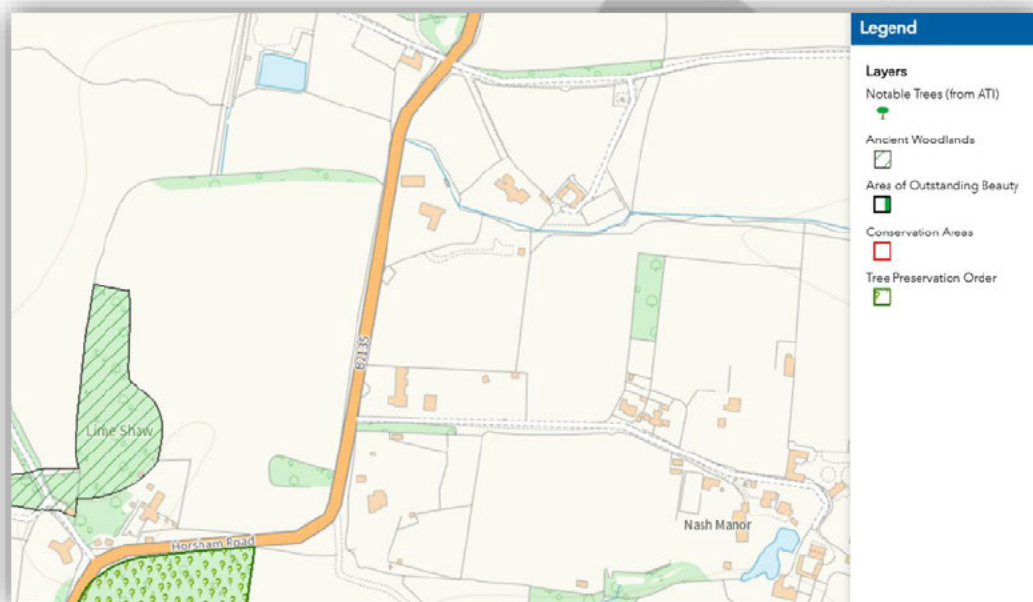


Figure 1 - Screen grab of Horsham District Council's Tree Preservation Order Mapping

6.4. Tree conditions

6.4.1. The development site's significant treescape is of B and C category, with select individuals gaining high quality and select individuals of U quality.

6.4.2. Overall the trees across the site are in keeping with those in similar locations within the rural environment.

7.0 Arboricultural Impact

7.1. Tree removal

7.1.1. The following trees will need to be removed to facilitate the proposed development:

BS 5837 Cat	A	B	C	U
Trees to be removed	None	None	TG6, TG7 (part)	None
Total	None	None	1	None

7.1.2. There is a requirement to remove part of TG7, the removal is to facilitate the installation of the new driveway and site access adjoining Horsham Road, the driveway installation will require trees that are within the driveway footprint to be removed as well as those that impede the visibility spay lines where pruning is not possible.

7.1.3. It is estimated that 29 individual trees are to be removed as part of TG7, however given the trees' multi-stemmed nature, exact calculation is not possible until works are undertaken, as some trees will need only a few stems being removed.

7.1.4. The loss of the trees of TG7 will be compensated for with new tree planting and establishment to reestablish the hedgerow in the desired location to maintain the visibility splays of the highway.

7.1.5. The tree removal for this project will likely require hedgerow license and ecological surveys.

7.1.6. There is a requirement to remove all of the tree group of TG6, this group is of low quality (C category). This group has multiple dead parts as well as poor quality trees.

7.1.7. The loss of TG6 will be compensated for within the same area and further across the site with a strong planting plan that incorporates trees of high quality.

7.2. Root protection area (RPA) incursions

7.2.1. Retained trees that will have incursion into their RPA, by BS5837:2012 category are:

BS 5837 Cat	A	B	C	U
Tree RPA incursion	None	None	None	None
Total	None	T5, T7	None	None

7.2.2. The site has been designed to have no RPA incursions of retained trees, however there is a requirement to access the RPA of T5 and T7 to remove an existing lightweight shed, this can be undertaken by hand having little impact on trees.

7.2.3. There is a potential for further trees to be damaged during the construction phase of the project inadvertently, to mitigate this a strong programme of tree protection, such as protective barrier fencing, ground/soil protection and construction exclusion zones (CEZ) as well as a well-considered site logistics plan, further information on this shall be sought within an Arboricultural Method Statement (AMS) and tree protection plan (TPP).

7.2.4. With the implementation of tree protection there shall be minimal impact on the retained trees across the site.

7.3. Tree pruning

7.3.1. Trees that will need to be pruned or crown lifted to facilitate the development, by BS5837:2012 category are:

BS 5837 Cat	A	B	C	U
Trees to be pruned	T1	None	TG7 (part)	None
Total	1	None	1	None

7.3.2. There is a potential for inadvertent tree damage from the development phase of the project, therefore all operations shall be assessed for the potential to make contact with tree branching and operations planned to mitigate this. If mitigation is not possible it may be required to prune branching back, this pruning shall be to BS 3998:2010 'Tree work – Recommendations' All pruning shall be agreed with the Local Planning Authority Tree Officer before works are undertaken.

7.3.3. The pruning of TG7 will be for the trees that remain after removal has taken place, these trees will require their western faces pruned back by varying amounts to allow for the required visibility splay lines. If pruning to trees is extensive and over 50% of the tree's crown then a replacement tree shall be planted, given the tree species they will react well to pruning and there is unlikely to be any ongoing decline of trees.

7.3.4. The pruning of T1 is facilitation pruning on the lower crown aspect at the southeastern side, the pruning will require the shortening of lower lateral branches by c.2.5m, about 25%, of the branch length. This pruning if undertaken correctly will be of minimal impact to the tree or its longevity.

7.3.5. All tree work shall be undertaken to the specification of the BS3998:2010 'Tree work – Recommendations' and undertaken by a suitably competent and qualified arboriculturist.

7.4. Foundations

7.4.1. In instances where soil conditions are known to be of sand/sandstone, there is lower risk of tree related subsidence or heave. The trees will tend to explore greater root depths reducing (not removing) the risk of compaction related issues. Further advice may be required relating to structures and soil types but is beyond the scope of this report, suitable persons shall be engaged where necessary.

7.5. Services

7.5.1. The required services will likely be connected to those along Horsham Road, these will be installed under the proposed driveway. This will stop impact to trees, if service runs are required within RPAs these will need to be excavated by hand in order to stop tree root damage.

7.6. Ground level

7.6.1. There may be a requirement for ground level alterations for this development it is not anticipated that these shall negatively affect any retained trees.

7.7. Shading & tree characteristics

7.7.1. There will not be any shading from retained trees to the proposed dwelling.

7.7.2. The trees are typically deciduous type losing their leaves in autumn, this leaf drop may cause an irritation to the management of the site but is an unavoidable consequence of trees. There are no trees that overhang the building.

7.8. Tree protection

7.8.1. There is a potential for tree and RPA damage during construction, with the installation of protective barrier fencing and, where required, suitable ground protection and the implementation of construction exclusion zones the trees shall be suitably protected from damage during the construction phase.

7.8.2. For construction there is the requirement to demolish an existing shed, this is located within the RPAs of T5 and T7, this will require a modified working method as will likely require temporary access within RPAs.

7.8.3. Basic checks will ensure that any protective fencing remains intact; ground protection is installed and suitable. Any unforeseen issues can also be identified and discussed before damage to the tree(s) occurs.

7.8.4. The Local Planning Authority is invited to secure the following schedule by way of Planning Condition. To be effective the Local Planning Authority must provide us with a copy of the formal Decision Notice to ensure we can then contact and follow up the proposed monitoring. A copy of the Decision Notice should be emailed to ben@thearbconsultant.co.uk. The number of proposed visits is driven by the scale of the proposal.

7.8.5. A more detailed explanation of what will be assessed during the proposed monitoring will be provided within the Arboricultural Method Statement (AMS).

Visit	Date	Status
Pre-commencement Inspections Attend site to inspect type and location of tree protection and any temporary ground protection prior to development commencing and discuss any issues associated with demolition/ enabling works	TBC	Incomplete
Site Inspection Attend site to confirm all tree work operations have been undertaken to BS 5837:2012	TBC	Incomplete
Site Inspection Inspection every 4-6 weeks for duration of project to ensure tree protection is correctly implemented	TBC	Incomplete
Final Site Inspection Final site visit to confirm that no damage has been done to retained trees/ identify any remedial actions in the event damage has occurred. Assess any required tree surgery following construction	TBC	Incomplete
Watching brief / Arboricultural supervision Where any operations within RPA are undertaken	TBC	Incomplete

7.8.6. Any excavations within RPAs shall be under an arboricultural watching brief.

8.0 Recommendations

- 8.1. Although every effort has been made at the planning stage to reduce tree damage there is still a potential for this to occur, because of this there is a requirement for the implementation of tree protection.
- 8.2. The specifications for tree protection required for this project will ensure that during the construction phase, following consultation with the Arboriculturist, adequate provision is made for the protection of retained trees.
- 8.3. That by liaison with the council tree officer, formal agreement should be sought regarding the tree protection methods employed to protect trees. These will be via the production of a arboricultural method statement (AMS) and will include:
 - Tree protective fencing as shown on the Tree Protective Plan
 - Location of trees to be removed
 - Any ground excavations within tree RPAs, approved by the tree officer
 - Any anti-compaction measures taken
 - The specific location of services trenches where possible to avoid excavations within RPAs, or if necessary to be undertaken by hand dig only.
- 8.4. Specific methods for construction of site access routes and hard landscaping close to or within retained trees RPAs.

- 8.5. Pre-commencement site meetings should be arranged to discuss the recommendations in this and subsequent reports and method statements. Copies of all relevant arboricultural reports should be available on site.
- 8.6. The AMS should be developed further with the contractor through the development process to include comments made by them and the client and design team as well as council officers. A copy of the tree report, including the Arboricultural Method Statements and Tree Protection Plan is kept on site at all times.
- 8.7. Details of site inspection / supervision visits by the consultant Arboriculturist are recorded and sent to the council tree officer with copies retained by the site manager.
- 8.8. An ecological appraisal should be undertaken to assess the trees before any tree work is undertaken.

9.0 Conclusion

- 9.1. The site layout and plans have considered the impact to the local tree population and have been designed to incorporate trees of higher value across the site to ensure their longevity.
- 9.2. The proposed development at the site calls for the removal of part of the hedging TG7, this is for the new driveway and associated visibility splays, as well as the removal of TG6, this loss will require new tree establishment in compensation.
- 9.3. There is no proposed incursion of the Root Protection Areas (RPA) of any retained trees from the development however there is a requirement to remove a lightweight shed structure within the RPA of T5 and T7.
- 9.4. There will be the need to prune the western faces of the retained parts of TG7, this will be to allow clearance of the visibility splay for the driveway, this pruning will have little long-term effect on the retained hedging trees.
- 9.5. There will be a low (but still present) potential for damage to retained trees from operations therefore tree protection measures will need to be implemented for the trees in proximity the site.
- 9.6. Tree protection measures for the retained trees should be sought in the form of an **Arboricultural Method Statements and Tree Protection Plan**. This will ensure sufficient development room shall be available after protection measures are instigated as described within this report. Excavations within retained tree RPAs for construction operations such as; service trenches; changes in levels, foundations excavations and removal of existing hard surfacing are not anticipated and will be avoided where possible.
- 9.7. Tree loss shall be compensated for with a strong tree planting and establishment aspect to the landscape designs ensuring suitable compensation for tree loss.
- 9.8. The development of the site will bring an opportunity for best practice tree management of the tree stock and an opportunity for further tree planting. All tree works, landscape tree planting should be communicated with the local planning authority.

Appendix

	Page
Appendix 1 Tree Schedule & Impact Schedule	14
Appendix 2 Key Terms and Abbreviations	26
Appendix 3 Tree Protection	27
Appendix 4 Working in Root Protection Areas	29
Appendix 5 BS5837:2012 'Trees in relation to design, demolition and construction – Recommendations' Tree Quality assessment criteria	32
Appendix 6 Arboricultural Impact Plan	33

Appendix 1: Tree Schedule & Impact Schedule

Tree Schedule

Tree ID	Common Name/ Latin Name	Category/ Subcategory		Maturity		Stem(s) diameter (DBH)	Root Protection Area (m²)/ Circle Radius (m)	Spread (m) N:E;S;W	Height and Direction of first significant branch (m)	Crown Height (m) N:E;S;W			General Observations	Management Recommendations
T 1	Common ash/ <i>Fraxinus excelsior</i>	A / 2 Mainly landscape qualities	40+	Mature	14	650	191.2/7.8	10;10;10;8	S 3	3;10;10;8	Fair	Fair	Major deadwood in crown, located over hedging and shrubs	Remove deadwood if area usage changes
T 2#	Common ash/ <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	<10	Mature	9	650	191.2/7.8	11;8;5;5	N 3	5;8;5;5	Declining	Declining	Likely Ash dieback, tree located roadside within fence vegetation, large amount of crown dieback 40-50% and epicormic growths	Third party notification of poor tree health, tree to have full inspection and defective parts removed-works to be undertaken within 3 months
T 3#	Common hawthorn / <i>Crataegus monogyna</i>	C / 2 Mainly landscape qualities	10-20	Mature	5	130	7.6/1.6	1;3;2;2	S 2	3;3;2;2	Fair	Fair	Damage to branching and stems	No works required
T 4	Wych Elm / <i>Ulmus glabra</i>	C / 2 Mainly landscape qualities 1 Mainly arboricultural qualities	10-20	Mature	10	280;290	73.5/4.8	3;1;3;2	W 3	4;1;3;2	Fair	Fair	Ivy clad trunk inhibiting full inspection, tree over hanging road	No works required
T 5	Common ash/ <i>Fraxinus excelsior</i>	B / 3 Mainly cultural values including conservation	10-20	Over-Mature	12	400;300;360;320	218.1/8.3	5;5;5;5	E 7	7;5;5;5	Declining	Declining	Lapsed coppice with large stems forming crown, tree with ecological/ conservation value	No works required

Tree ID	Common Name/ Latin Name	Category/ Subcategory		Maturity		Stem(s) diameter (DBH)	Root Protection Area (m²)/ Circle Radius (m)	Spread (m) N;E;S;W	Height and Direction of first significant branch (m)	Crown Height (m) N;E;S;W			General Observations	Management Recommendations
T 6	Field maple / <i>Acer campestre</i>	B / 2 Mainly landscape qualities	20-40	Mature	15	300	40.7/3.6	5;1;5;5	W 3	2;1;5;5	Fair	Fair	Stem in contact with adjacent tree, minor cavities on trunk	No works required
T 7#	Common ash/ <i>Fraxinus excelsior</i>	B / 3 Mainly cultural values including conservation	10-20	Over-Mature	5	550;450;120;370;1350	1121.5/18.9	1;3;2;3	N 1	2;3;2;3	Declining	Declining	Large tree that has been topped in past with early regrowth, main larger stem with Ivy, heavy decay and hollowing, major included union at 3m tree with ecological/ conservation value	No works required
T 8	Common ash/ <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	10-20	Mature	7	150	10.2/1.8	4;2;0;1	N 4	4;2;0;1	Declining	Declining	Declining health with deadwood and epicormic growth in crown, likely Ash dieback, excessive Ivy inhibiting full inspection,	Remove ivy and inspect parts
T 9	Common ash/ <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	10-20	Mature	10	310	43.5/3.7	4;2;4;2	N 4	4;2;4;2	Fair	Fair	Excessive Ivy inhibiting full inspection,	No works required
T 10#	Common ash/ <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	<10	Early-Mature	5	160;120	18.1/2.4	0;1;5;2	S 3	6;1;5;2	Declining	Declining	Likely Ash dieback, excessive Ivy inhibiting full inspection, dead parts in crown	Remove dead parts and remove tree as required-works to be undertaken within 3 months

Tree ID	Common Name/ Latin Name	Category/ Subcategory		Maturity		Stem(s) diameter (DBH)	Root Protection Area (m²)/ Circle Radius (m)	Spread (m) N;E;S;W	Height and Direction of first significant branch (m)	Crown Height (m) N;E;S;W			General Observations	Management Recommendations
T 11	Common ash/ <i>Fraxinus excelsior</i>	B / 2 Mainly landscape qualities 3 Mainly cultural values including conservation	10-20	Mature	12	340;280; 220;350	165.1/7.2	7;5;5;6	S 4	4;5;5;6	Fair	Declining	Likely Ash dieback, over dense crown and branch tip dieback, tree coppiced at 1m with large base, stump 2m wide at 1m height	Remove deadwood as it develops
T 12	Common ash/ <i>Fraxinus excelsior</i>	B / 2 Mainly landscape qualities	20-40	Mature	12	450	91.6/5.4	5;4;5;5	N 2.5	3;4;5;5	Fair	Fair	Pruning to branches with epicormic growth forming	No works required
T 13	Common ash/ <i>Fraxinus excelsior</i>	U	<10	Mature	12	550	136.9/6.6	7;6;7;7	W 4	5;6;7;7	Declining	Declining	Likely Ash dieback, major deadwood in crown, epicormic growths from branching, major cavity at lower west of trunk with modest occlusion	Remove dead parts and fell tree as required - works to be undertaken as critical - ASAP
T 14	English oak / <i>Quercus robur</i>	A / 2 Mainly landscape qualities	40+	Mature	14	780	275.3/9.4	8;7;6;7	E 2.5	1;7;6;7	Fair	Fair	Major deadwood in crown, excessive lvy inhibiting full inspection,	Sever lvy, inspect parts covered by lvy, stabilise deadwood - works to be undertaken within 3 months
T 15	Common ash/ <i>Fraxinus excelsior</i>	U	<10	Dead	7	140	8.9/1.7	2;2;2;2	S 3	4;2;2;2	Dead	Dead	Dead standing	Fell - works to be undertaken within 3 months
T 16	Common hawthorn / <i>Crataegus monogyna</i>	C / 2 Mainly landscape qualities	10-20	Mature	7	120;100; 140	19.9/2.5	1;1;5;3	N 0	0;1;5;3	Declining	Declining	Major deadwood in crown,	Remove deadwood- works to be undertaken within 3 months

Tree ID	Common Name/ Latin Name	Category/ Subcategory		Maturity		Stem(s) diameter (DBH)	Root Protection Area (m²)/ Circle Radius (m)	Spread (m) N;E;S;W	Height and Direction of first significant branch (m)	Crown Height (m) N;E;S;W			General Observations	Management Recommendations
T 17	Willow / <i>Salix .sp</i>	B / 3 Mainly cultural values including conservation		Young	5	90	3.7/1.1	2;2;2;2	E 2	1;2;2;2	Fair	Fair	No gross defects,	No works required
T 18	Common ash/ <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	10-20	Mature	8	50av	18.1/2.4	3;3;3;2	N 0	1;3;3;2	Declining	Declining	Tree topped with high stump, regrowth forming crown, stump with cavities and Ivy	No works required
T 19	English oak / <i>Quercus robur</i>	B / 2 Mainly landscape qualities	40+	Early-Mature	11	250	28.3/3	3;3;4;4	W 2	4;3;4;4	Fair	Fair	No gross defects,	No works required
T 20	English oak / <i>Quercus robur</i>	A / 2 Mainly landscape qualities 1 Mainly arboricultural qualities 3 Mainly cultural values including conservation	40+	Mature	19	1050	498.8/12.6	11;8;10;10	W 3.5	5;8;10;10	Fair	Fair	Major deadwood in crown,	Stabilise deadwood over accessible areas - works to be undertaken within 3 months

Tree ID	Common Name/ Latin Name	Category/ Subcategory		Maturity		Stem(s) diameter (DBH)	Root Protection Area (m²)/ Circle Radius (m)	Spread (m) N;E;S;W	Height and Direction of first significant branch (m)	Crown Height (m) N;E;S;W			General Observations	Management Recommendations
T 21	Common ash/ <i>Fraxinus excelsior</i>	U	<10	Over-Mature	17	300;450; 240;350	213.9/8.3	10;8;8;8	E 5	6;8;8;8	Declining	Declining	Major crown die back with epicormic growth, major dead parts in crown, major cavities at base, ownership unknown	Establish ownership. Third party identification to address dangerous tree, or reduce stems down to 5m height to leave as monolith, - works to be undertaken as critical - ASAP
T 22	English oak / <i>Quercus robur</i>	B / 2 Mainly landscape qualities	40+	Mature	20	1030	480/12.4	11;11;11; 10	W 2.5	4;11;11; 10	Fair	Fair	Cavity into base at root buttress, lvy on trunk and into crown, included bark union between stems at East, dead wood in crown, ownership unclear, tree suitable in context of current land usage, works required should this change	Stabilise deadwood over accessible areas- works to be undertaken within 3 months
T 23	English oak / <i>Quercus robur</i>	B / 2 Mainly landscape qualities	40+	Mature	17	1010	461.5/12.1	11;11;10; 10	S 4	2;11;10; 10	Fair	Fair	Tree located behind fence ownership unclear, major deadwood in crown, included bark union between stems at lower trunk	No works required given current land usage. Tree will require work if area usage is to change
T 24	English oak / <i>Quercus robur</i>	C / 2 Mainly landscape qualities	20-40	Mature	11	280	35.5/3.4	0;1;5;7	W 4	10;1;5;7	Declining	Declining	Large volume of deadwood in crown, asymmetric crown, tree behind fence, ownership unclear	Stabilise deadwood over accessible areas- works to be undertaken within 3 months

Tree ID	Common Name/ Latin Name	Category/ Subcategory		Maturity		Stem(s) diameter (DBH)	Root Protection Area (m²)/ Circle Radius (m)	Spread (m) N;E;S;W	Height and Direction of first significant branch (m)	Crown Height (m) N;E;S;W			General Observations	Management Recommendations
T 25	English oak / <i>Quercus robur</i>	U /	<10	Over-Mature	15	1080	527.7/13	8;8;8;8	N 3	3;8;8;8	Declining	Declining	Tree located behind fence, ownership unclear, major deadwood in crown, excessive decay at tree base with decay into trunk and roots, tree like to fail, presence of Chicken of the woods fungus, tree of low impact with minimal targets in current area usage,	Establish ownership - third party notification (if required) tree to be significantly reduced back by 6-7m from lateral branching and 10m from height leaving monolith for ecological value, tree to be reinspected every 24 months, area around tree to be maintained with undesirable access allowing vegetation to develop - works to be undertaken as critical - ASAP
T 26#	English oak / <i>Quercus robur</i>	A / 2 Mainly landscape qualities	40+	Mature	13	500	113.1/6	7;7;7;8	0	0;7;7;8	Fair	Fair	No gross defects, tree located in neighbouring garden, located behind hedge, poor visibility and no access	No works required
T 27#	Walnut / <i>Juglans regia</i>	B / 2 Mainly landscape qualities	20-40	Mature	11	350	55.4/4.2	6;6;6;6	0	0;6;6;6	Fair	Fair	Tree in neighbouring garden minimal visibility and no access	No works required
T 28#	English oak / <i>Quercus robur</i>	B / 2 Mainly landscape qualities	40+	Mature	11	500	113.1/6	6;6;6;6	N 1.5	1.5;6;6;6	Fair	Fair	No gross defects, located on boundary	No works required

Tree ID	Common Name/ Latin Name	Category/ Subcategory		Maturity		Stem(s) diameter (DBH)	Root Protection Area (m²)/ Circle Radius (m)	Spread (m) N;E;S;W	Height and Direction of first significant branch (m)	Crown Height (m) N;E;S;W			General Observations	Management Recommendations
T 29	Apple / <i>Malus .spp</i>	B / 2 Mainly landscape qualities	10-20	Mature	5	370	61.9/4.4	3;5;5;1	W 0.5	0;5;5;1	Fair	Fair	No gross defects,	No works required
TG 1	Common hazel / <i>Corylus avellana</i>	C / 2 Mainly landscape qualities	20-40	Mature	2-4	60Max	0.7 from edge	Group area	Group area	Group area	Fair	Fair	No gross defects,	No works required
TG 2	Blackthorn/ <i>Prunus spinosa</i> , Beech/ <i>Fagus sylvatica</i> , Laurel/ <i>Laurus nobilis</i> , Ash / <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	10-20	Mature	3-6	150Max	1.8 from edge	Group area	Group area	Group area	Fair	Fair	Group of shrubbery with younger Beech tree, dead parts in group	No works required
TG 3	Leyland cypress / <i>Cupressus × leylandii</i>	C / 2 Mainly landscape qualities	20-40	Early-Mature	5-6	100-150	1.8 from edge	Group area	Group area	Group area	Fair	Fair	Located behind green house	No works required
TG 4	Common hawthorn / <i>Crataegus monogyna</i> , Hazel, Elder / <i>Sambucus nigra</i>	B / 2 Mainly landscape qualities 3 Mainly cultural values including conservation	20-40	Mature	2-8	120	1.4 from edge	Group area	Group area	Group area	Fair	Fair	Hedgerow, predominantly coppiced Hazel, with interspersed shrubbery	No works required
TG 5	European beech / <i>Fagus sylvatica</i>	C / 2 Mainly landscape qualities	20-40	Early-Mature	2-4	120	1.4 from edge	Group area	Group area	Group area	Fair	Fair	Hedgerow along boundary, managed as formal hedge	No works required

Tree ID	Common Name/ Latin Name	Category/ Subcategory		Maturity		Stem(s) diameter (DBH)	Root Protection Area (m²)/ Circle Radius (m)	Spread (m) N;E;S;W	Height and Direction of first significant branch (m)	Crown Height (m) N;E;S;W			General Observations	Management Recommendations
TG 6	Common hazel / <i>Corylus avellana</i> , Elder / <i>Sambucus nigra</i> , Blackthorn / <i>Prunus spinosa</i>	C / 2 Mainly landscape qualities	<10	Mature	2-5	100	1.2 from edge	Group area	Group area	Group area	Fair	Fair	Group of mixed shrubbery in corner of field, multiple dead smaller shrubs	No works required
TG 7#	Common hazel / <i>Corylus avellana</i> , Field maple / <i>Acer campestre</i>	B / 2 Mainly landscape qualities	20-40	Mature	3-6	100	1.2 from edge	Group area	Group area	Group area	Fair	Fair	Hedgerow group along boundary, good vigour, will require management over the next 5 years to stop parts collapsing into road	Keep under management

= Measurements estimated due to inaccessible tree or tree part

T = Tree

TG = Group /Tree Group

Impact Schedule

Tree ID	Common Name/ Latin Name	Category/ Subcategory	Impact from the development	Mitigation required
T 1	Common ash/ <i>Fraxinus excelsior</i>	A / 2 Mainly landscape qualities	- In proximity to development area. - Conflict with northeastern aspect of crown branching	- Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater - Pruning to northeastern aspect of lower crown by 2.5m
T 2#	Common ash/ <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 3#	Common hawthorn / <i>Crataegus monogyna</i>	C / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 4	Wych Elm / <i>Ulmus glabra</i>	C / 2 Mainly landscape qualities 1 Mainly arboricultural qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 5	Common ash/ <i>Fraxinus excelsior</i>	B / 3 Mainly cultural values including conservation	- In proximity to development area - Removal of lightweight structure from within RPA	- Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater - Modified work method for structure removal
T 6	Field maple / <i>Acer campestre</i>	B / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 7#	Common ash/ <i>Fraxinus excelsior</i>	B / 3 Mainly cultural values including conservation	- In proximity to development area. - Removal of lightweight structure from within RPA	- Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater - Modified work method for structure removal
T 8	Common ash/ <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 9	Common ash/ <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 10#	Common ash/ <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 11	Common ash/ <i>Fraxinus excelsior</i>	B / 2 Mainly landscape qualities 3 Mainly cultural values including conservation	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 12	Common ash/ <i>Fraxinus excelsior</i>	B / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 13	Common ash/ <i>Fraxinus excelsior</i>	U	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 14	English oak / <i>Quercus robur</i>	A / 2 Mainly landscape qualities	Outside of development area compound, no impact	No mitigation required
T 15	Common ash/ <i>Fraxinus excelsior</i>	U	Outside of development area compound, no impact	No mitigation required
T 16	Common hawthorn / <i>Crataegus monogyna</i>	C / 2 Mainly landscape qualities	Outside of development area compound, no impact	No mitigation required

Tree ID	Common Name/ Latin Name	Category/ Subcategory	Impact from the development	Mitigation required
T 17	Willow / <i>Salix .sp</i>	B / 3 Mainly cultural values including conservation	Outside of development area compound, no impact	No mitigation required
T 18	Common ash/ <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	Outside of development area compound, no impact	No mitigation required
T 19	English oak / <i>Quercus robur</i>	B / 2 Mainly landscape qualities	Outside of development area compound, no impact	No mitigation required
T 20	English oak / <i>Quercus robur</i>	A / 2 Mainly landscape qualities 1 Mainly arboricultural qualities 3 Mainly cultural values including conservation	Outside of development area compound, no impact	No mitigation required
T 21	Common ash/ <i>Fraxinus excelsior</i>	U	Outside of development area compound, no impact	No mitigation required
T 22	English oak / <i>Quercus robur</i>	B / 2 Mainly landscape qualities	Outside of development area compound, no impact	No mitigation required
T 23	English oak / <i>Quercus robur</i>	B / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 24	English oak / <i>Quercus robur</i>	C / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 25	English oak / <i>Quercus robur</i>	U /	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 26#	English oak / <i>Quercus robur</i>	A / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 27#	Walnut / <i>Juglans regia</i>	B / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 28#	English oak / <i>Quercus robur</i>	B / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
T 29	Apple / <i>Malus .spp</i>	B / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
TG 1	Common hazel / <i>Corylus avellana</i>	C / 2 Mainly landscape qualities	Outside of development area compound, no impact	No mitigation required
TG 2	Blackthorn/ <i>Prunus spinosa</i> , Beech/ <i>Fagus sylvatica</i> , Laurel/ <i>Laurus nobilis</i> , Ash / <i>Fraxinus excelsior</i>	C / 2 Mainly landscape qualities	Outside of development area compound, no impact	No mitigation required
TG 3	Leyland cypress / <i>Cupressus × leylandii</i>	C / 2 Mainly landscape qualities	Outside of development area compound, no impact	No mitigation required
TG 4	Common hawthorn / <i>Crataegus monogyna</i> , Hazel, Elder / <i>Sambucus nigra</i>	B / 2 Mainly landscape qualities 3 Mainly cultural values including conservation	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater
TG 5	European beech / <i>Fagus sylvatica</i>	C / 2 Mainly landscape qualities	In proximity to development area.	Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater

Tree ID	Common Name/ Latin Name	Category/ Subcategory	Impact from the development	Mitigation required
TG 6	Common hazel / <i>Corylus avellana</i> , Elder / <i>Sambucus nigra</i> , Blackthorn / <i>Prunus spinosa</i>	C / 2 Mainly landscape qualities	- In proximity to development area. - Tree group to be removed	- Tree group to be removed - Replacement tree planting within the same area
TG 7#	Common hazel / <i>Corylus avellana</i> , Field maple / <i>Acer campestre</i>	B / 2 Mainly landscape qualities	- In proximity to development area. - Parts to be removed for access driveway - Parts to be pruned for access driveway	- Protective Barrier Fencing at RPA extent or maximum branch extent whatever greater of retained parts - Crown pruning to BS3998 where possible - Compensatory tree planting and establishment

= Measurements estimated due to inaccessible tree or tree part

T = Tree

TG = Group /Tree Group

*= Owned by third party

Tree Schedule Key Terms Terminology Used

Tree Reference Number: Identification number allocated to each tree or group of trees, which is illustrated on the plan or physically tagged to trees.

Species: Botanical and/or Common name of the tree done from visual identification.

Height: Estimated height of the tree in meters.

DBH: Diameter of the stem(s) measured using a diameter tape at 1.5m from the ground in accordance with the BS 5837 2012.

Branch Spread: Branch spread was estimated at the four points of reference from the base of the stem (North, East, South, and West).

Age Class: Consideration of species.

Y= Young

EM= Early Mature

SM= Semi Mature

M= Mature

OM= Over Mature

Physiological Condition: The trees physiological state and general vitality is rated as Good, Reasonable, Poor or Dead.

Structural Condition: Structural condition rated as either Good, Reasonable, Poor and any notable structural defects or characteristics.

Preliminary Management Recommendations: A recommendation for tree works based on the visual inspection of the tree and recommendations based on the development.

Category Grading Definition:

Category A: Trees of a high quality with an estimated remaining life expectancy of at least 40 + years.

Category B: Trees of a moderate quality with an estimated remaining life expectancy of at least 20-39 years.

Category C: Trees of a low quality with an estimated remaining life expectancy of at least 10 -19 years, or young trees with a stem diameter below 150 mm.

Category U: Trees in such a condition that they cannot realistically be retained as living trees in the context of current land use for longer than 10 years.



Appendix 2: Key Terms and Abbreviations

Arboricultural Implication Assessment (AIA):

An assessment of the arboricultural impact of a development.

Arboricultural Method Statement (AMS):

Contains references to tree protection information.

Arboriculturalist:

Person who has relevant education and training, gained expertise in the field of trees.

British Standard 5837: 2012 Trees in Relation to Design, Demolition, and Construction - Recommendations (BS 5837):

British Standard document outlining best practice and guidelines for the impact of arboriculture on the construction industry.

British Standard 3998 2012 Tree Work Recommendations (BS 3998):

British Standard document outlining best practice for Tree Works.

Competent Person:

Person who has training and experience relevant to the matter being addressed and an understanding of the requirements of the particular task being approached.

Construction:

Site Based operations with the potential to affect existing trees.

Construction Exclusion Zone:

Area based on the root protection area from which access is prohibited for the extent of the project.

Root Protection Area (RPA):

Layout design tool indicating the minimum area around a tree deemed sufficient to protect roots in order to maintain the trees health and viability.

Service(s):

Any above or belowground structure or apparatus required for utility provision e.g. drainage, gas supply, water, ground source heat pumps, soak-a-ways, CCTV, telecommunications.

Stem:

Principle above ground structural component(s) of a tree that supports the branches/crown.

Tree Protection Plan:

Scale drawing, informed by descriptive text where necessary, based upon the finalised proposals, showing the trees for retention and illustrating the tree and landscape protection measures.

Appendix 3: Tree Protection

BARRIERS/FENCING

All barriers/fencing agreed for the development must be installed prior to any works starting on site and ideally in conjunction with the erection of the site security measures. All barriers/fencing must stay in place until the all works on site are finished or as agreed by the consultant arboriculturalist and/or planning authority.

Default Specification:

The default specification consists of a vertical and horizontal scaffold framework that is well braced to resist impacts from vehicles and construction site operations. The specification recommended in the current BS 5837 states the vertical tube should be spaced at maximum intervals of 3m and should be driven securely into the ground. Once in place weld mesh or similar (Heras panels) will need to be securely fixed to the scaffold framework.

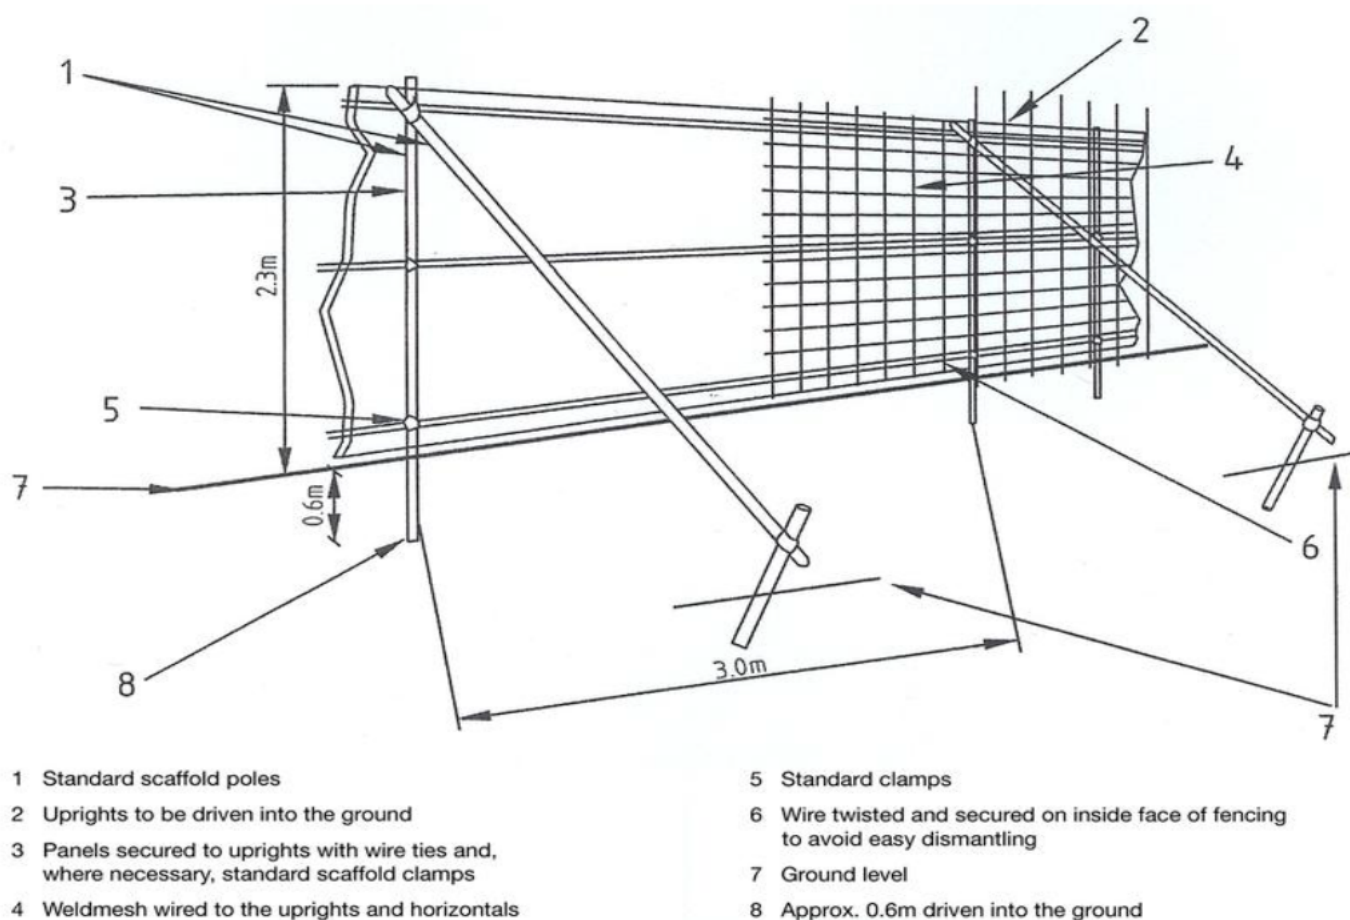


Figure 2. – Protective fencing for RPA

Signage:

All tree protection fencing is required to have signs attached at 4-6m intervals. Below are examples of the required signage to be attached to the tree protection barrier.



Above: Three examples of tree protection fencing signage ranging from a simple sign (*left*) attached with zip ties to more in-depth signs (*middle & right*) explaining the limitations and legal protection status of the trees being protected. *A copy of these are available upon request*

Ground Protection

Ground protection is required during the development process to protect the retained trees, Root Protection Areas from construction operations. This can be where permanent working space is needed or temporary access is justified within the RPA, which would involve setting back the tree protection barrier. Where possible existing hard surfaces within RPAs need to be utilised or retained for ground protection rather than being removed during demolition operations. Where tree protection barriers are set back from the perimeter of the RPA exclusion zone exposing unmade ground to construction damage, new temporary ground protection will be installed prior to construction starting. Below are some general specifications for ground protection based on the type and weight of traffic.

Pedestrian Access

For pedestrian traffic **ONLY** a single thickness of scaffold board (40mm) or wooden boarding is to be laid on a minimum of 100mm deep woodchip, which is laid upon a geotextile membrane.

Small Plant Up To 2 Tonne (2000kg)

For small plant machinery with a gross weight of up to 2 tonne (2000kg), interlinking polyethylene or aluminium track way needs to be laid on a minimum of 150mm deep woodchip which is laid upon a geotextile membrane.

Regular Traffic and Plant Up To 3.5 Tonne (3500kg)

Where heavy traffic is expected from pedestrian to vehicular with a gross weight of up to 3.5tonne, interlinking aluminium or metal track way must be used over a minimum layer of 200mm deep woodchip, which is laid upon a geotextile membrane.



Appendix 4: Working in Root Protection Areas

Prevention of detrimental impact to RPAs: In most instances the RPA will need to be completely isolated from construction and development operations using tree protection barriers and ground protection. This is the most reliable way to ensure the preservation of the RPA and retain it completely undisturbed. The RPAs of the trees to be retained have been shown diagrammatically on the Tree Protection Plan along with accurate location of any tree protection measures.

However some operations will require specific works to be carried out in the RPA and anyone entering the RPA must follow the guidelines below to ensure the minimal amount of disturbance is afforded at all times. Any operations in the RPA needs to accord to the principle that the tree and soil structure takes priority. This will help retain and preserve healthy, valuable trees in the landscape and development but also prevent costly and potentially dangerous situations from occurring during and after the works has been completed.

The two main instances where these guidelines for entering and working must be followed are:

1. Removal of existing surfaces/structures and replacing those with new surfaces, structures, landscaping.
2. Preparation and installation of new surfacing, structures, landscapes.

Most of the other operations can utilise some form of ground protection to prevent or reduce the impact on the RPA.

Excavations within the RPA and root retention: Any excavations carried out within the RPA must be done so by hand using spades, forks and trowels, taking care to limit the amount of damage caused to the outer bark and woody structure of the roots. The fork should be used to loosen the soil in the excavation area and help locate any substantial roots (25mm- 100mm diameter). A trowel can then be used to remove the soil from around the roots taking care as to not damage the bark.

Once the roots have been exposed, those that are to be removed (any roots up to 25mm in diameter) can be done using sharp secateurs or a handsaw. Any roots above 25mm in diameter, where possible, need to be retained and protected from drying out and temperature extremes by wrapping or covering them in a suitable material e.g. hessian, spare membrane material, plastic. This wrapping needs to be removed before any back filling takes place. Some roots over larger areas of excavation can be displaced where possible to bend round any new structures or pipework whilst remaining intact. Roots with a diameter of 25-100mm should only be cut in exceptional circumstances and after consultation. Roots above 100mm should only be cut after consultation with the appointed arboriculturalist. Alternatively using compressed to displace the soil is always preferable and more affective especially over larger areas or to remove soil quicker while keeping roots intact. This may be part of the specification and would be included within the Arboricultural Method Statement.

Arboricultural Supervision: All works being carried out within the RPA must be carried out with great care and be supervised by a qualified arboriculturalist to ensure that the contractors understand the need to minimize any detrimental impact on the retained root system. This is done through properly briefing before the work commences along with regular site inspections and signing the work off when completed.

Removal and Demolition of Structures and Surfaces: As with all operations carried out within the RPA exceptional care must be taken to ensure any detrimental impact on the roots and soil structure is kept to an absolute minimum. Where any structure is being demolished (above or below ground) within the RPA additional barriers is recommended to protect the remaining RPA, above ground stem and branch structures. Where there are no hard surfaces or they are due to be removed from within the RPA, plant machinery should operate from outside the RPA providing there is a long enough reach. Where this is unfeasible ground protection must be used to prevent soil compaction from plant machinery conducting the demolition operations. Where possible any suitable load bearing hard surface already existing within the RPA should be retained during demolition. This prevents any additional damage to the underlying soil structure by allowing the surface to support the plant machinery and falling material. Where the hard surface in the RPA is due to be removed, where possible it should remain in-situ for as long as possible. Before any demolition process takes place it should be determined whether any access facilitation pruning is required to provide clearance and prevent physical damage between the plant machinery and tree structures. In some situations working space can be provided by temporarily tying back tree branches. Both tying and pruning need to be specified by a qualified arboriculturalist and ideally follow the guidelines set out in BS 3998 2012 Tree Work Recommendations.

Debris to be removed from within the RPA must be done so across existing hard surface or temporary ground protection so as to prevent compaction of the soil structure. If possible the material can also be lifted out of the RPA using suitable machinery preferable with a long reach.

Where trees are standing adjacent to structures that need to be removed, the demolition should be undertaken inwards within the footprint of the existing building, often referred to as '*top down, pull back*'. Where underground structures are present within RPAs and will become redundant it is preferable to leave the structures in situ rather than remove them, which could cause considerable root damage. Where hard surface is schedule for

removal within RPAs care must be taken to not disturb the root structure that could be present underneath. Hand held tools or carefully supervised machine work could be utilised to remove the surface. This should be working backwards away from the retained trees and not moving over the newly exposed ground.

New Structure Guidelines: All new structures being proposed in the RPA have the potential to cause damage to root structures and alter the ground conditions. The age and maturity of the trees will affect the viability and type of incursion into the RPA available. Younger trees are more robust and adaptable to changes in their environment where as mature and Veteran trees tolerate very little disturbance to their soil and root structures. When constructing inside RPAs the goal is to minimise the amount of soil disturbance/compaction and retain a good level of gaseous and water exchange.

Constructing above ground using pile and beam construction limits the amount of disturbance to the soil and root structure which reduces the adverse effect on physiological processes. Most solutions need to be well thought out and are a combined effort and communication of ideas between the engineer, architect and arboriculturalist.

Light Weight Structures e.g. Sheds, Small Storage: Small structures with relatively small foundations that spread load bearing can be constructed straight onto the surface without the need for any excavations. A certain amount of ground levelling is permitted but only to the top 50mm of the soil to fill in any undulations and provide a level surface. Anything above the 50mm will need to be raised up above the existing ground level to achieve the desired surface. Any ground works required must be carried out with great care so as not to damage retained tree roots. Small roots below 25mm can be severed with a sharp saw or secateurs. A membrane will be required between the ground and the bottom of the foundation to prevent leeching of potentially harmful chemicals materials e.g. cement into the soil. Frames can be constructed and fixed onto the ground using stakes from which the foundation can be produced. But there are recommendations for the amount of RPA that can be covered.

New permanent hard surfacing should not exceed 20% of any existing unsurfaced ground within the RPA.

Fencing, Posts, and Small Piers: Generally the construction of fencing that doesn't require a strip or wall foundation can be installed with having very little impact on the soil and root structure. It is acceptable to dig small holes up to 300mm x 300mm for the installations of posts or piers so long as the digging is carried out carefully and by hand. Or preferably by compressed air. Any roots up to 25mm in diameter may be severed using a sharp saw or secateurs, if possible the hole being dug could be widened or moved to enable retaining the root(s) whole. Any roots 25mm+ should be retained where possible but may be severed after consulting the appointed arborist; further guidelines have been explained above. Ideally holes should be dug as far away from the main stem as possible where larger diameter roots are less likely to be encountered and less damage will occur. When installing posts or piers in the RPA the smallest feasible hole possible must be used when excavating for the foundations of the posts to reduce the impact to the RPA.

Buildings, Walls, Bridges on New Foundations: Most conventional foundations are done by producing a strip of concrete dug into a trench in the ground. This is not acceptable practice in RPA's with the potential to cause large amounts of damage to root systems causing decline in the trees health, making the tree structurally unsound. Small diameter piles supporting beams or cast flooring are permitted within the RPA's as they will reduce the potential damage to root structure. But before any piling is carried out suitable ground protection must be put down to prevent soil compaction from the piling rig leaving gaps in the ground protection for the pile locations. Hand excavations need to be carried out in the location for each pile down to a depth of 700mm to establish whether there are any substantial roots in the pile location. If substantial roots are discovered (25mm+) the appointed arborist will make a decision whether the root can be severed or if the pile location has to be moved. The supporting beams connecting to the piles cannot be lower than the existing ground level resulting in the need for further excavations. The beams should be constructed off site allowing them to be lowered in to position without the need to be casted in the RPA.

Services: New services and service runs should where possible be sited outside the RPA of retained trees to prevent unnecessary damage to root structures. Sometimes there is the need to upgrade existing services, which requires excavation, this can cause extensive damage and render the trees structurally unsound. This should be a last resort and all decisions need to be in conjunction with the consulting arborist.

New Surfaces Guidelines: The installation of new surfaces within the RPA can be very damaging to the root structure and soil conditions. Excavations required for the laying of new sub bases and level grading could both cause extensive root damage to retained trees.

Excessive soil level alterations and new surfaces can change the condition of the soil and the environment the roots survive in, altering moisture content and the ability for gaseous exchange. Ideally any new surface needs to be permeable to allow moisture transfer and allow the continuation of gaseous exchange, be constructed above existing ground levels and load bearing where the load is spread evenly over the surface to help prevent compaction of the soil. Having these qualities helps enable structures and surfaces to be constructed in RPA while having continued successful retention of valuable trees. Younger trees are more adaptable to changes and construction of new surfaces within the RPA. They are able to cope with

the pressures whereas mature, and veteran trees often severely decline. Mature and veteran trees should not have any new surfaces installed in their RPAs, as their ability to cope with the change is poor.

Providing Sufficient Grading for New Surfaces: Determining the depth of roots within any soil and RPA is difficult and can only be achieved by careful excavation of the topsoil. All surfaces proposed inside the RPA need to ideally be of a no dig construction which prohibits excavation, but this is often unfeasible as the ground is usually undulating. Limited ground movement and excavations are permitted if they are carried out with care to prevent any damage to the retained root systems. Ideally the ground should be raised up to provide a suitable level surface using a granular aggregate like angular stone or sharp sand. If done under supervision it is acceptable to allow the removal of the topsoil and turf to a depth of no more than 50mm, which normally doesn't, damage the roots. However if there are a large number of surface roots already showing prior to any soil removal there can be no excavation and the ground level must alternatively be raised. If during the grading of the soil roots at a diameter greater than 25mm are encountered the consultant arborist will need to make an evaluation as to whether the damage is preventable and or acceptable before proceeding. At no point can the graded surface be compacted to provide a finish as this will disrupt the soil structure and cause a damaging effect of the roots within it. The final level of the proposed surface must also be considered and discussed prior to starting any works to establish whether the proposal is practical and useable once completed.

Installing Base and Top Layers: Once a suitably level base has been created without damaging the retained roots, a load spreading construction is required to prevent the compaction of the soil structure beneath. Normally this can be achieved by installing a cellular confinement system that is filled with an angular no fines aggregate to help support and distribute the calculated load over a wider area and limiting soil compaction. This enables a finishing layer of permeable tarmac, block pavers, grasscrete, or gravel to be laid on top depending on the desired usage of the surface. Alternative options are to use preformed concrete slabs that can be laid directly onto the surface but they cannot be laid on top of any form of strip foundation which has a high potential for root damage.

Retention of Existing Surfaces: Where possible it is preferable to install new surfaces over those already existing, limiting the potential damage to any underlying root system. This can provide a suitable sub base without the need for excavation and without the need for special supervision and precautions. Care will only be needed if roots are lifting or protruding through the existing surface.



BS 5837:2012. Trees in relation to design, demolition and construction – Recommendations.				
Cascade chart for tree quality assessment.				
Trees to be considered for retention				Identification on Plan
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years	- Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) - Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline - Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality NOTE Category U trees can have existing or potential conservation value which it might be desirable to preserve; see 4.5.7.			Dark red RGB Code: 127-000-000
Trees to be considered for retention				
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years	1 Mainly arboricultural qualities	2 Mainly landscape qualities	3 Mainly cultural values, including conservation	Identification on Plan
	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)	Light green RGB Code: 000-255-000
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation or other cultural value	Mid blue RGB Code: 000-000-255
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150 mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits	Trees with no material conservation or other cultural value	Grey RGB Code: 091-091-091

Appendix 6: Arboricultural Impact Plan

See document: reference - AIP.SH.1005.V2



End of Report



The Arboricultural Consultancy is based in Sussex, covering the South East of England. We specialise in comprehensive tree management surveys, reports, and advice. Our expertise is invaluable in ensuring compliance with health and safety regulations, meeting development requirements, and fulfilling Tree Preservation Order (TPO) and Conservation Area obligations.

We take pride in offering professional and reliable services that prioritise the health and longevity of trees. Our team is dedicated to providing expert guidance and recommendations that align with your objectives and environmental stewardship.

With our extensive knowledge in arboricultural science, we deliver accurate and detailed assessments that inform sound decision-making. Trust us to be your trusted partner in responsible tree management.

Visit our website at www.thearboriculturalconsultancy.co.uk