

Monitoring Details:

Crack and Level Monitoring

Provider Name: CET

Monitoring Interval: Every 8 weeks

Instruction Date: 09/04/2024

Number of Visits: MUFN

Reading Date: 21/05/2026

Visits Completed: 13

Date of Issue: 07/07/2026

Visits Outstanding: MUFN

Client Details:

Client: None

Engineer / Handler: Sharon Carr


Job Reference: 10060204

Monitored Address:

Address: 30 Brushwood Road, Horsham, West Sussex, RH12 4PE

Front Elevation



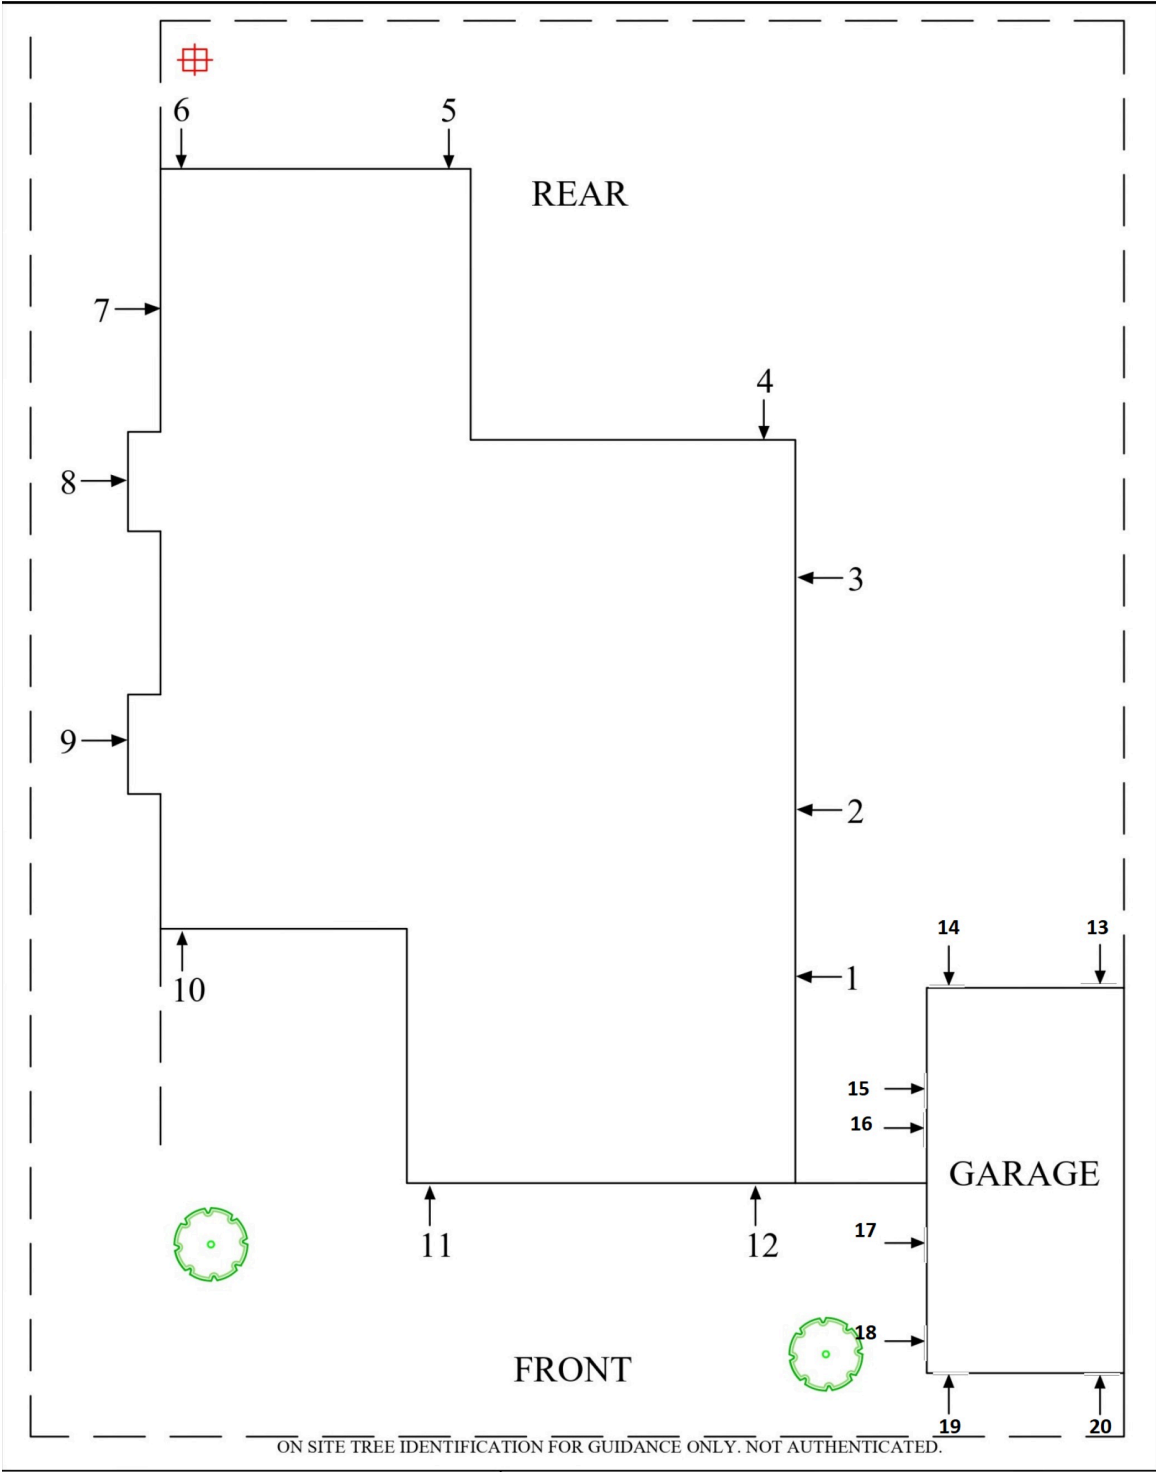

Visit Notes

Visit	Surveyors Note
Visit 8	No Access to point 2 due to work bench being put up

Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
1	10.5706	10.5658	10.5639	10.5702	10.5714	10.5707	10.5669	10.5590
2	10.6374	10.6349	10.6331	10.6378	10.6393	10.6386	10.6351	
3	10.6383	10.6380	10.6382	10.6399	10.6399	10.6389	10.6382	10.6366
4	10.1804	10.1801	10.1808	10.1807	10.1810	10.1802	10.1804	10.1790
5	10.2396	10.2392	10.2401	10.2403	10.2405	10.2397	10.2397	10.2398
6	10.6388	10.6384	10.6394	10.6403	10.6405	10.6396	10.6389	10.6392
7	10.8815	10.8799	10.8805	10.8820	10.8838	10.8832	10.8803	10.8807
8	10.8878	10.8858	10.8853	10.8886	10.8905	10.8901	10.8862	10.8845
Taken by	AP	NA	AP	EC	AP	AP	TF	AP
Serial No.	522903	523936	522903	1212106	522903	522903	1211937	522903

Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
1	0	-4.8	-6.7	-0.4	+0.8	+0.1	-3.7	-11.6
2	0	-2.5	-4.3	+0.4	+1.9	+1.2	-2.3	
3	0	-0.3	-0.1	+1.6	+1.6	+0.6	-0.1	-1.7
4	0	-0.3	+0.4	+0.3	+0.6	-0.2	0	-1.4
5	0	-0.4	+0.5	+0.7	+0.9	+0.1	+0.1	+0.2
6	0	-0.4	+0.6	+1.5	+1.7	+0.8	+0.1	+0.4
7	0	-1.6	-1	+0.5	+2.3	+1.7	-1.2	-0.8
8	0	-2	-2.5	+0.8	+2.7	+2.3	-1.6	-3.3

Level Readings - Continuation of levels

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
9	10.2201	10.2165	10.2130	10.2188	10.2222	10.2213	10.2181	10.2120
10	10.6845	10.6806	10.6762	10.6837	10.6859	10.6848	10.6822	10.6735
11	10.2053	10.2005	10.1988	10.2042	10.2068	10.2058	10.2018	10.1941
12	10.4959	10.4900	10.4875	10.4939	10.4971	10.4961	10.4914	10.4823
13		9.5235	9.5218	9.5235	9.5250	9.5246	9.5234	9.5138
14		9.5611	9.5602	9.5614	9.5613	9.5606	9.5600	9.5542
15		9.5728	9.5708	9.5738	9.5754	9.5749	9.5718	9.5666
16		9.5748	9.5725	9.5764	9.5782	9.5778	9.5755	9.5686
Taken by	AP	NA	AP	EC	AP	AP	TF	AP
Serial No.	522903	523936	522903	1212106	522903	522903	1211937	522903

Level Movement (Displayed in Millimeters) - Continuation of readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
9	0	-3.6	-7.1	-1.3	+2.1	+1.2	-2	-8.1
10	0	-3.9	-8.3	-0.8	+1.4	+0.3	-2.3	-11
11	0	-4.8	-6.5	-1.1	+1.5	+0.5	-3.5	-11.2
12	0	-5.9	-8.4	-2	+1.2	+0.2	-4.5	-13.6
13		0	-1.7	0	+1.5	+1.1	-0.1	-9.7
14		0	-0.9	+0.3	+0.2	-0.5	-1.1	-6.9
15		0	-2	+1	+2.6	+2.1	-1	-6.2
16		0	-2.3	+1.6	+3.4	+3	+0.7	-6.2

Level Readings - Continuation of levels

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
17		9.5650	9.5626	9.5663	9.5703	9.5697	9.5672	9.5610
18		9.4794	9.4787	9.4808	9.4825	9.4845	9.4829	9.4781
19		9.5509	9.5504	9.5517	9.5536	9.5562	9.5535	9.5498
20		9.4643	9.4636	9.4651	9.4661	9.4705	9.4679	9.4632
Taken by	AP	NA	AP	EC	AP	AP	TF	AP
Serial No.	522903	523936	522903	1212106	522903	522903	1211937	522903

Level Movement (Displayed in Millimeters) - Continuation of readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
17		0	-2.4	+1.3	+5.3	+4.7	+2.2	-4
18		0	-0.7	+1.4	+3.1	+5.1	+3.5	-1.3
19		0	-0.5	+0.8	+2.7	+5.3	+2.6	-1.1
20		0	-0.7	+0.8	+1.8	+6.2	+3.6	-1.1

Visit Notes

Visit	Surveyors Note
Visit 11	Unable to read point 2 as blocked by gardening equipment. Crack 3 & 4 at this visit due to equipment failure.

Level Readings

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
1	10.5568	10.5586	10.5601	10.5607	10.5604			
2	10.6277							
3	10.6332	10.6338	10.6352	10.6357	10.6309			
4	10.1774	10.1785	10.1802	10.1808	10.1806			
5	10.2389	10.2406	10.2419	10.2416	10.2400			
6	10.6385	10.6402	10.6413	10.6410	10.6389			
7	10.8788	10.8779	10.8792	10.8786	10.8735			
8	10.8805	10.8805	10.8810	10.8803	10.8795			
Taken by	DH	JH	JH	JH	NM			
Serial No.	TS16	524015		521856	6128			

Level Movement (Displayed in Millimeters) - Continuation of readings

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
1	-13.8	-12	-10.5	-9.9	-10.3			
2	-9.7							
3	-5.1	-4.5	-3.1	-2.6	-7.5			
4	-3	-1.9	-0.2	+0.4	+0.1			
5	-0.7	+1	+2.3	+2	+0.3			
6	-0.3	+1.4	+2.5	+2.2	0			
7	-2.7	-3.6	-2.3	-2.9	-8.1			
8	-7.3	-7.3	-6.8	-7.5	-8.4			

Level Readings - Continuation of levels

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
9	10.2087	10.2104	10.2106	10.2109	10.2118			
10	10.6701	10.6718	10.6737	10.6741	10.6760			
11	10.1928	10.1944	10.1951	10.1951	10.1961			
12	10.4810	10.4828	10.4840	10.4843	10.4852			
13	9.5170	9.5180	9.5196	9.5202	9.5156			
14	9.5561	9.5576	9.5589	9.5596	9.5527			
15	9.5647	9.5664	9.5668	9.5673	9.5663			
16	9.5682	9.5699	9.5700	9.5695	9.5688			
Taken by	DH	JH	JH	JH	NM			
Serial No.	TS16	524015		521856	6128			

Level Movement (Displayed in Millimeters) - Continuation of readings

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
9	-11.4	-9.7	-9.5	-9.2	-8.4			
10	-14.4	-12.7	-10.8	-10.4	-8.6			
11	-12.5	-10.9	-10.2	-10.2	-9.3			
12	-14.9	-13.1	-11.9	-11.6	-10.8			
13	-6.5	-5.5	-3.9	-3.3	-8			
14	-5	-3.5	-2.2	-1.5	-8.5			
15	-8.1	-6.4	-6	-5.5	-6.6			
16	-6.6	-4.9	-4.8	-5.3	-6.1			


Level Readings - Continuation of levels

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
17	9.5606	9.5602	9.5621	9.5623	9.5611			
18	9.4779	9.4782	9.4796	9.4792	9.4762			
19	9.5491	9.5495	9.5499	9.5492	9.5476			
20	9.4614	9.4627	9.4637	9.4632	9.4617			
Taken by	DH	JH	JH	JH	NM			
Serial No.	TS16	524015		521856	6128			

Level Movement (Displayed in Millimeters) - Continuation of readings

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
17	-4.4	-4.8	-2.9	-2.7	-4			
18	-1.5	-1.2	+0.2	-0.2	-3.3			
19	-1.8	-1.4	-1	-1.7	-3.4			
20	-2.9	-1.6	-0.6	-1.1	-2.7			

Level Readings Chart (Points 1 - 20)

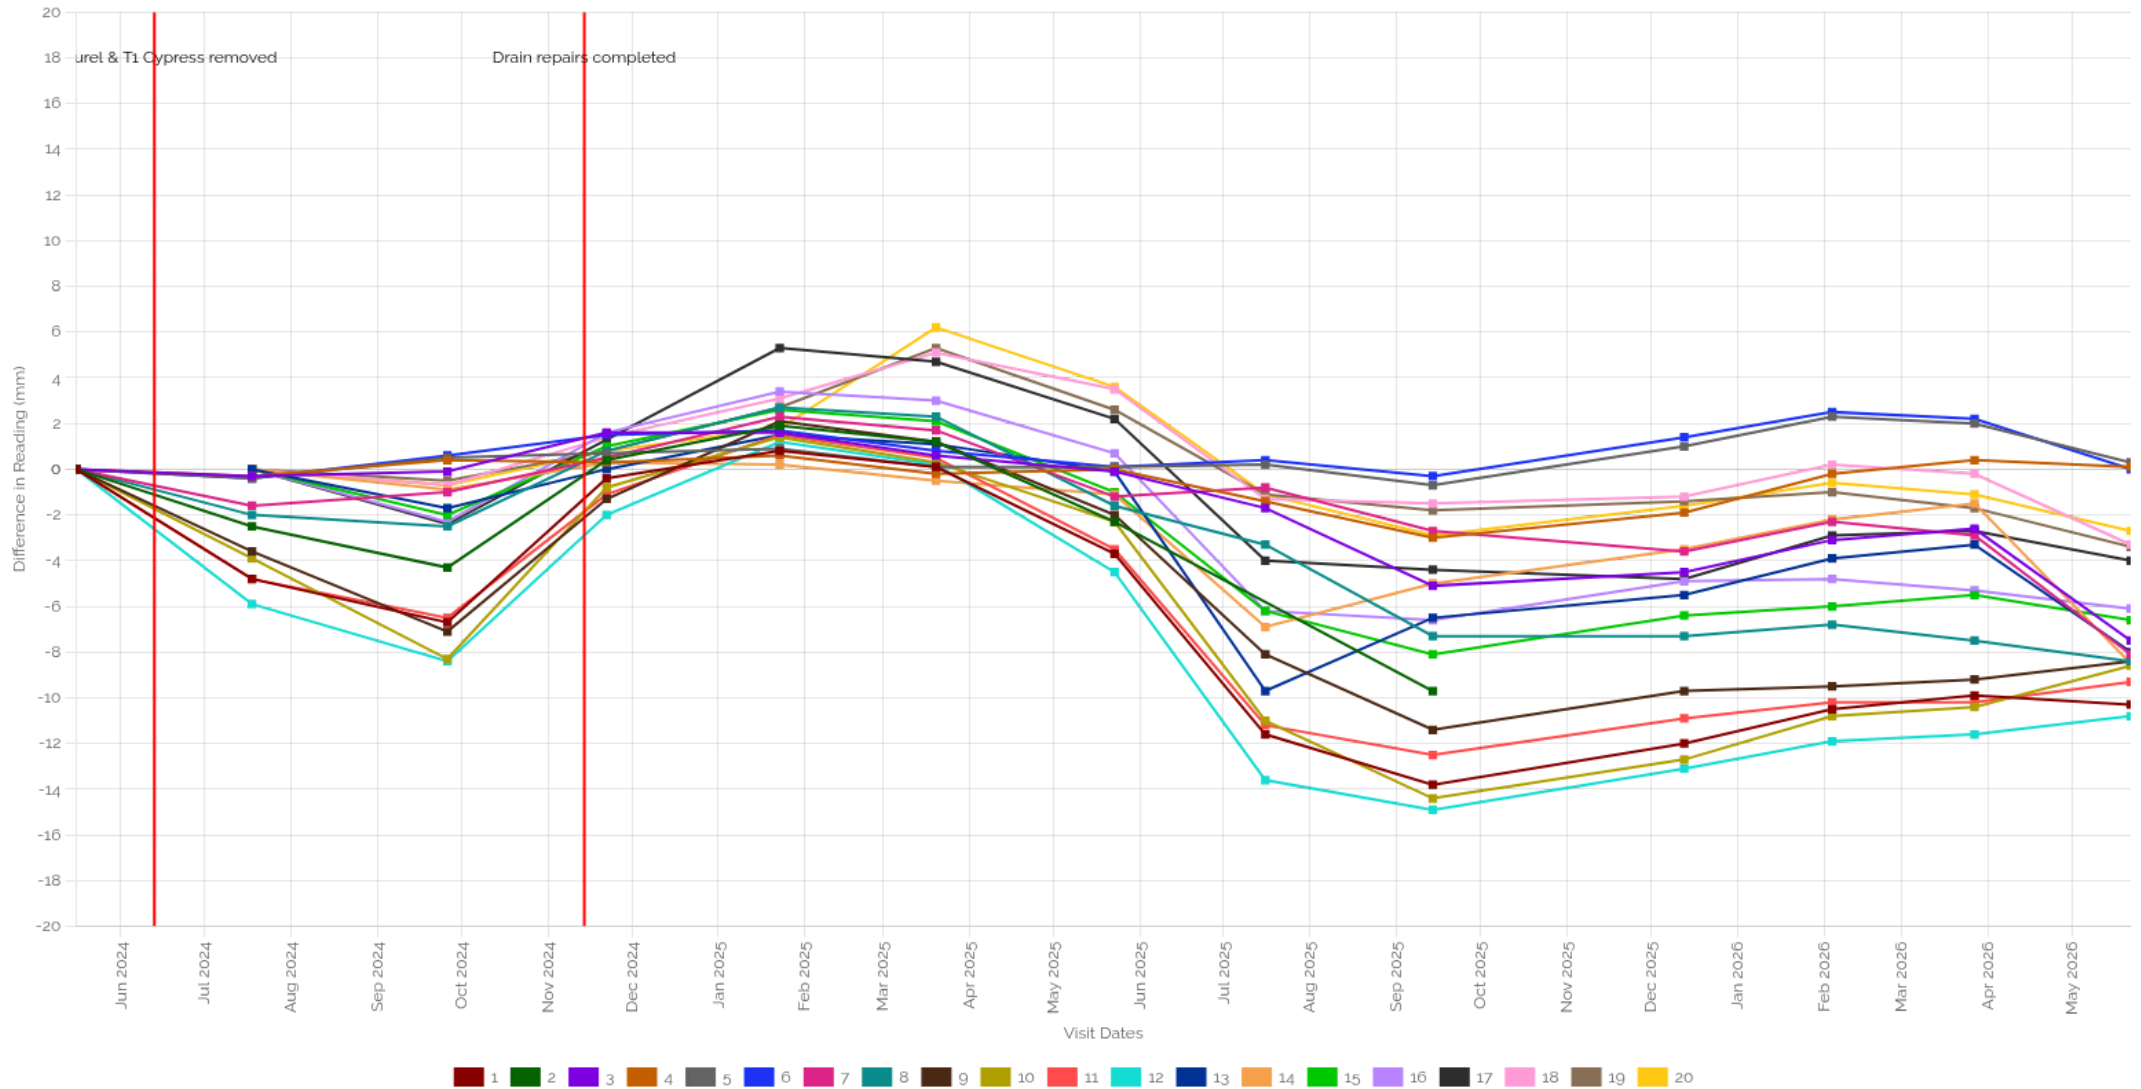

Crack Monitoring

Int dining room below window

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
H	40.68	40.31	40.43	40.28	40.41	40.39	40.32	40.93
Taken by	AP	NA	AP	N/A	AP	AP	TF	AP
Callipers	0570	045	0570	162	0570	0570	1254	0570

Int dining room below window - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
H	0	-0.37	-0.25	-0.4	-0.27	-0.29	-0.36	0.25


Crack Monitoring

Int dining room below window

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
H	39.84	40.37	39.75	40.65	40.59			
Taken by	DH	JH	JH	JH	NM			
Callipers	0302	1527	1527	1527	4969			

Int dining room below window - Crack Readings Differences (Displayed in Millimetres)

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
H	-0.84	-0.31	-0.93	-0.03	-0.09			

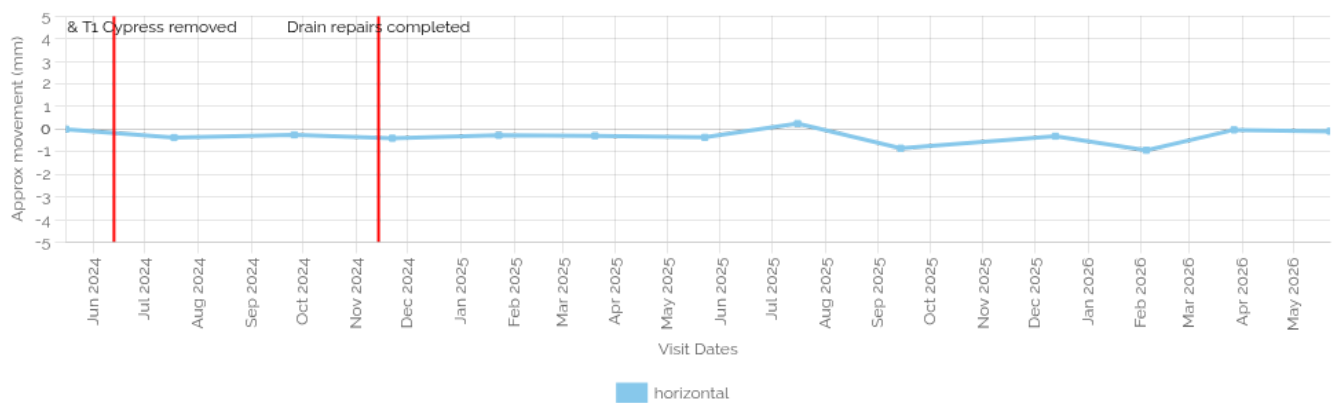

Int dining room below window - Visit #1



Int dining room below window - Visit #13



Crack Monitoring

Int front left bedroom above door

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
H	62.56	62.06	62.61	62	62.49	62.34	62.13	62.69
D	77.5	76.96	77.52	76.89	77.44	77.39	77.04	77.61
C	48.59	48.45	48.46	48.12	48.7	48.47	48.49	48.6
Taken by	AP	NA	AP	N/A	AP	AP	TF	AP
Callipers	0570	045	0570	162	0570	0570	1254	0570

Int front left bedroom above door - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
H	0	-0.5	0.05	-0.56	-0.07	-0.22	-0.43	0.13
D	0	-0.54	0.02	-0.61	-0.06	-0.11	-0.46	0.11
C	0	-0.14	-0.13	-0.47	0.11	-0.12	-0.1	0.01


Crack Monitoring

Int front left bedroom above door


	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
H	62.54	62.13	62.22	62.35	62.51			
D	77.37	77.02	77.24	77.25	77.46			
C	48.33	48.29	48.3	48.28	48.51			
Taken by	DH	JH	JH	JH	NM			
Callipers	0302	1527	1527	1527	4969			

Int front left bedroom above door - Crack Readings Differences (Displayed in Millimetres)

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
H	-0.02	-0.43	-0.34	-0.21	-0.05			
D	-0.13	-0.48	-0.26	-0.25	-0.04			
C	-0.27	-0.3	-0.3	-0.31	-0.08			

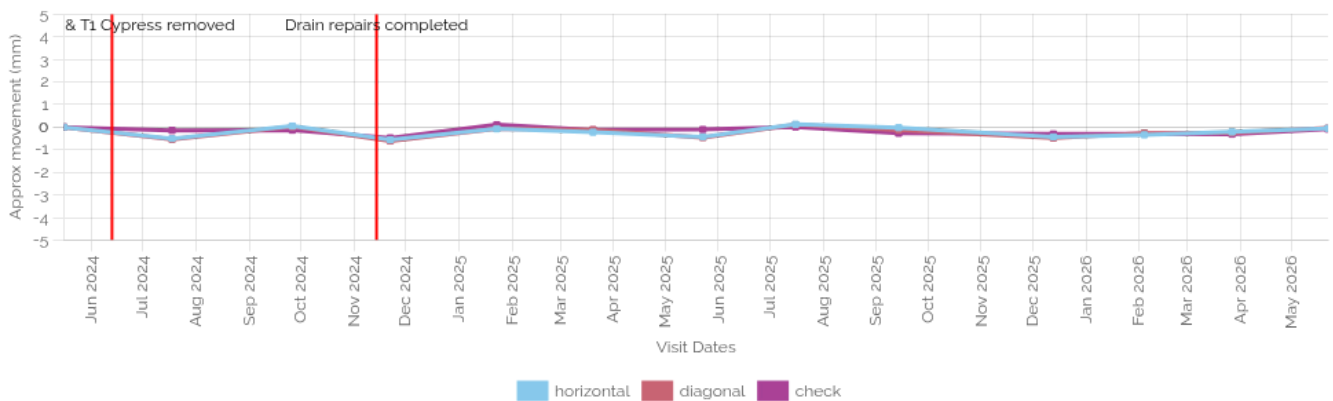

Int front left bedroom above door - Visit #1

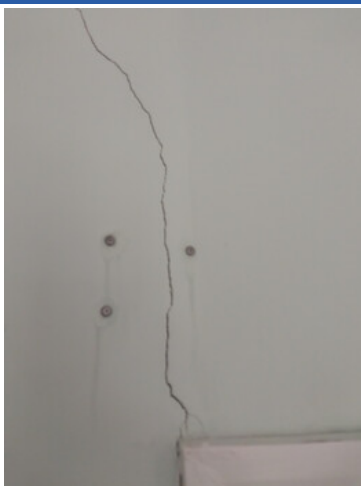

Int front left bedroom above door - Visit #13



Crack Monitoring

Int upstairs landing above rhs bedroom door

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
H	56.6	56.21	56.56	56.23	56.54	56.31	56.11	56.48
D	69.24	68.88	69.21	68.91	69.19	68.97	68.81	69.15
C	42.39	42.25	42.29	42.03	42.36	42.09	42.08	42.27
Taken by	AP	NA	AP	N/A	AP	AP	TF	AP
Callipers	0570	045	0570	162	0570	0570	1254	0570

Int upstairs landing above rhs bedroom door - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
H	0	-0.39	-0.03	-0.37	-0.05	-0.29	-0.49	-0.11
D	0	-0.36	-0.02	-0.32	-0.05	-0.26	-0.43	-0.09
C	0	-0.14	-0.1	-0.36	-0.03	-0.3	-0.31	-0.12


Crack Monitoring

Int upstairs landing above rhs bedroom door

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
H	56.23	56.24		56.21	56.47			
D	68.87	68.87		68.83	69.07			
C	41.92	41.9		41.83	42.11			
Taken by	DH	JH	JH	JH	NM			
Callipers	0302	1527	1527	1527	4969			

Int upstairs landing above rhs bedroom door - Crack Readings Differences (Displayed in Millimetres)

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
H	-0.37	-0.36		-0.39	-0.12			
D	-0.37	-0.37		-0.41	-0.17			
C	-0.48	-0.49		-0.56	-0.29			

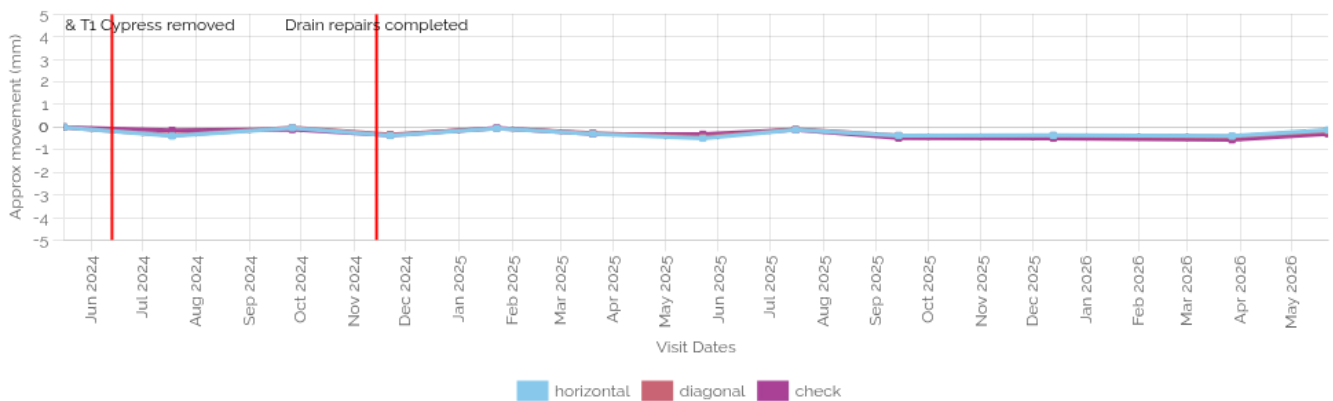

Int upstairs landing above rhs bedroom door - Visit #1



Int upstairs landing above rhs bedroom door - Visit #13



Crack Monitoring

Int upstairs landing above bathroom door

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
H	62.61	62.18	62.64	62.21	62.55	62.34	62.15	62.6
D	75.5	75.18	75.56	75.31	75.5	75.34	75.03	75.6
C	48.17	48.09	48.17	47.85	48.21	47.94	47.97	48.05
Taken by	AP	NA	AP	N/A	AP	AP	TF	AP
Callipers	0570	045	0570	162	0570	0570	1254	0570

Int upstairs landing above bathroom door - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
H	0	-0.43	0.03	-0.4	-0.06	-0.27	-0.46	-0.01
D	0	-0.32	0.06	-0.19	0	-0.16	-0.47	0.1
C	0	-0.08	0	-0.32	0.05	-0.23	-0.2	-0.11


Crack Monitoring

Int upstairs landing above bathroom door


	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
H	62.23	62.22		62.24	62.3			
D	75.37	75.26		75.13	75.32			
C	47.8	47.79		47.78	48.06			
Taken by	DH	JH	JH	JH	NM			
Callipers	0302	1527	1527	1527	4969			

Int upstairs landing above bathroom door - Crack Readings Differences (Displayed in Millimetres)

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
H	-0.38	-0.39		-0.37	-0.31			
D	-0.13	-0.24		-0.37	-0.18			
C	-0.36	-0.37		-0.39	-0.11			

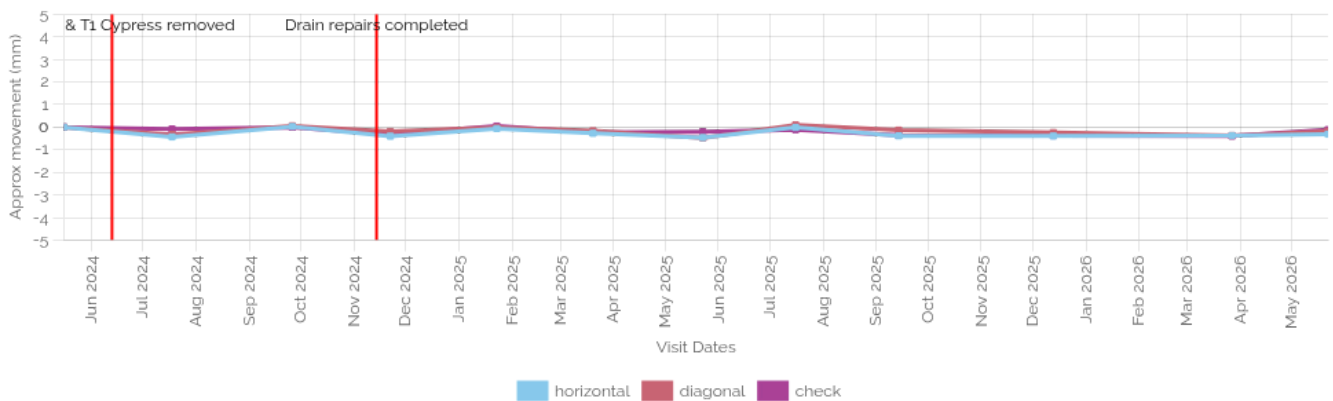

Int upstairs landing above bathroom door - Visit #1

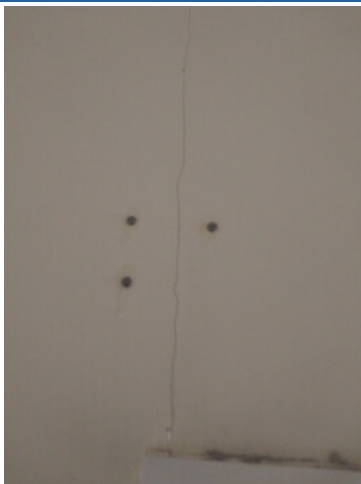

Int upstairs landing above bathroom door - Visit #13



Crack Monitoring

Int front hall above front door

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
V	56.28	55.83	55.92	55.77	56.37	56.13	55.68	56.12
Taken by	AP	NA	AP	N/A	AP	AP	TF	AP
Callipers	0570	045	0570	162	0570	0570	1254	0570

Int front hall above front door - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	15/05/24	17/07/24	25/09/24	21/11/24	22/01/25	19/03/25	22/05/25	15/07/25
V	0	-0.45	-0.36	-0.51	0.09	-0.15	-0.6	-0.16


Crack Monitoring

Int front hall above front door

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
V	55.86	56.03	55.94	55.95	56.07			
Taken by	DH	JH	JH	JH	NM			
Callipers	0302	1527	1527	1527	4969			

Int front hall above front door - Crack Readings Differences (Displayed in Millimetres)

	Visit 9	Visit 10	Visit 11	Visit 12	Visit 13	Visit 14	Visit 15	Visit 16
	13/09/25	12/12/25	03/02/26	26/03/26	21/05/26			
V	-0.42	-0.25	-0.34	-0.33	-0.21			

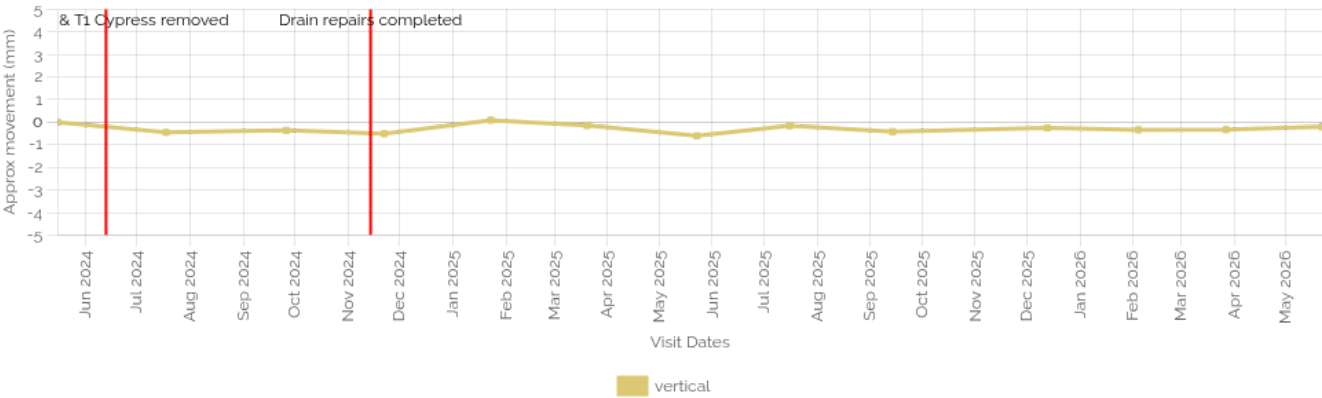

Int front hall above front door - Visit #1



Int front hall above front door - Visit #13

