


**LAND NORTH-WEST OF
SOUTHWATER, HORSHAM**

**TRANSPORT ASSESSMENT
ANNEX E – WALKING ROUTE AUDIT
TOOL**

FEBRUARY 2026

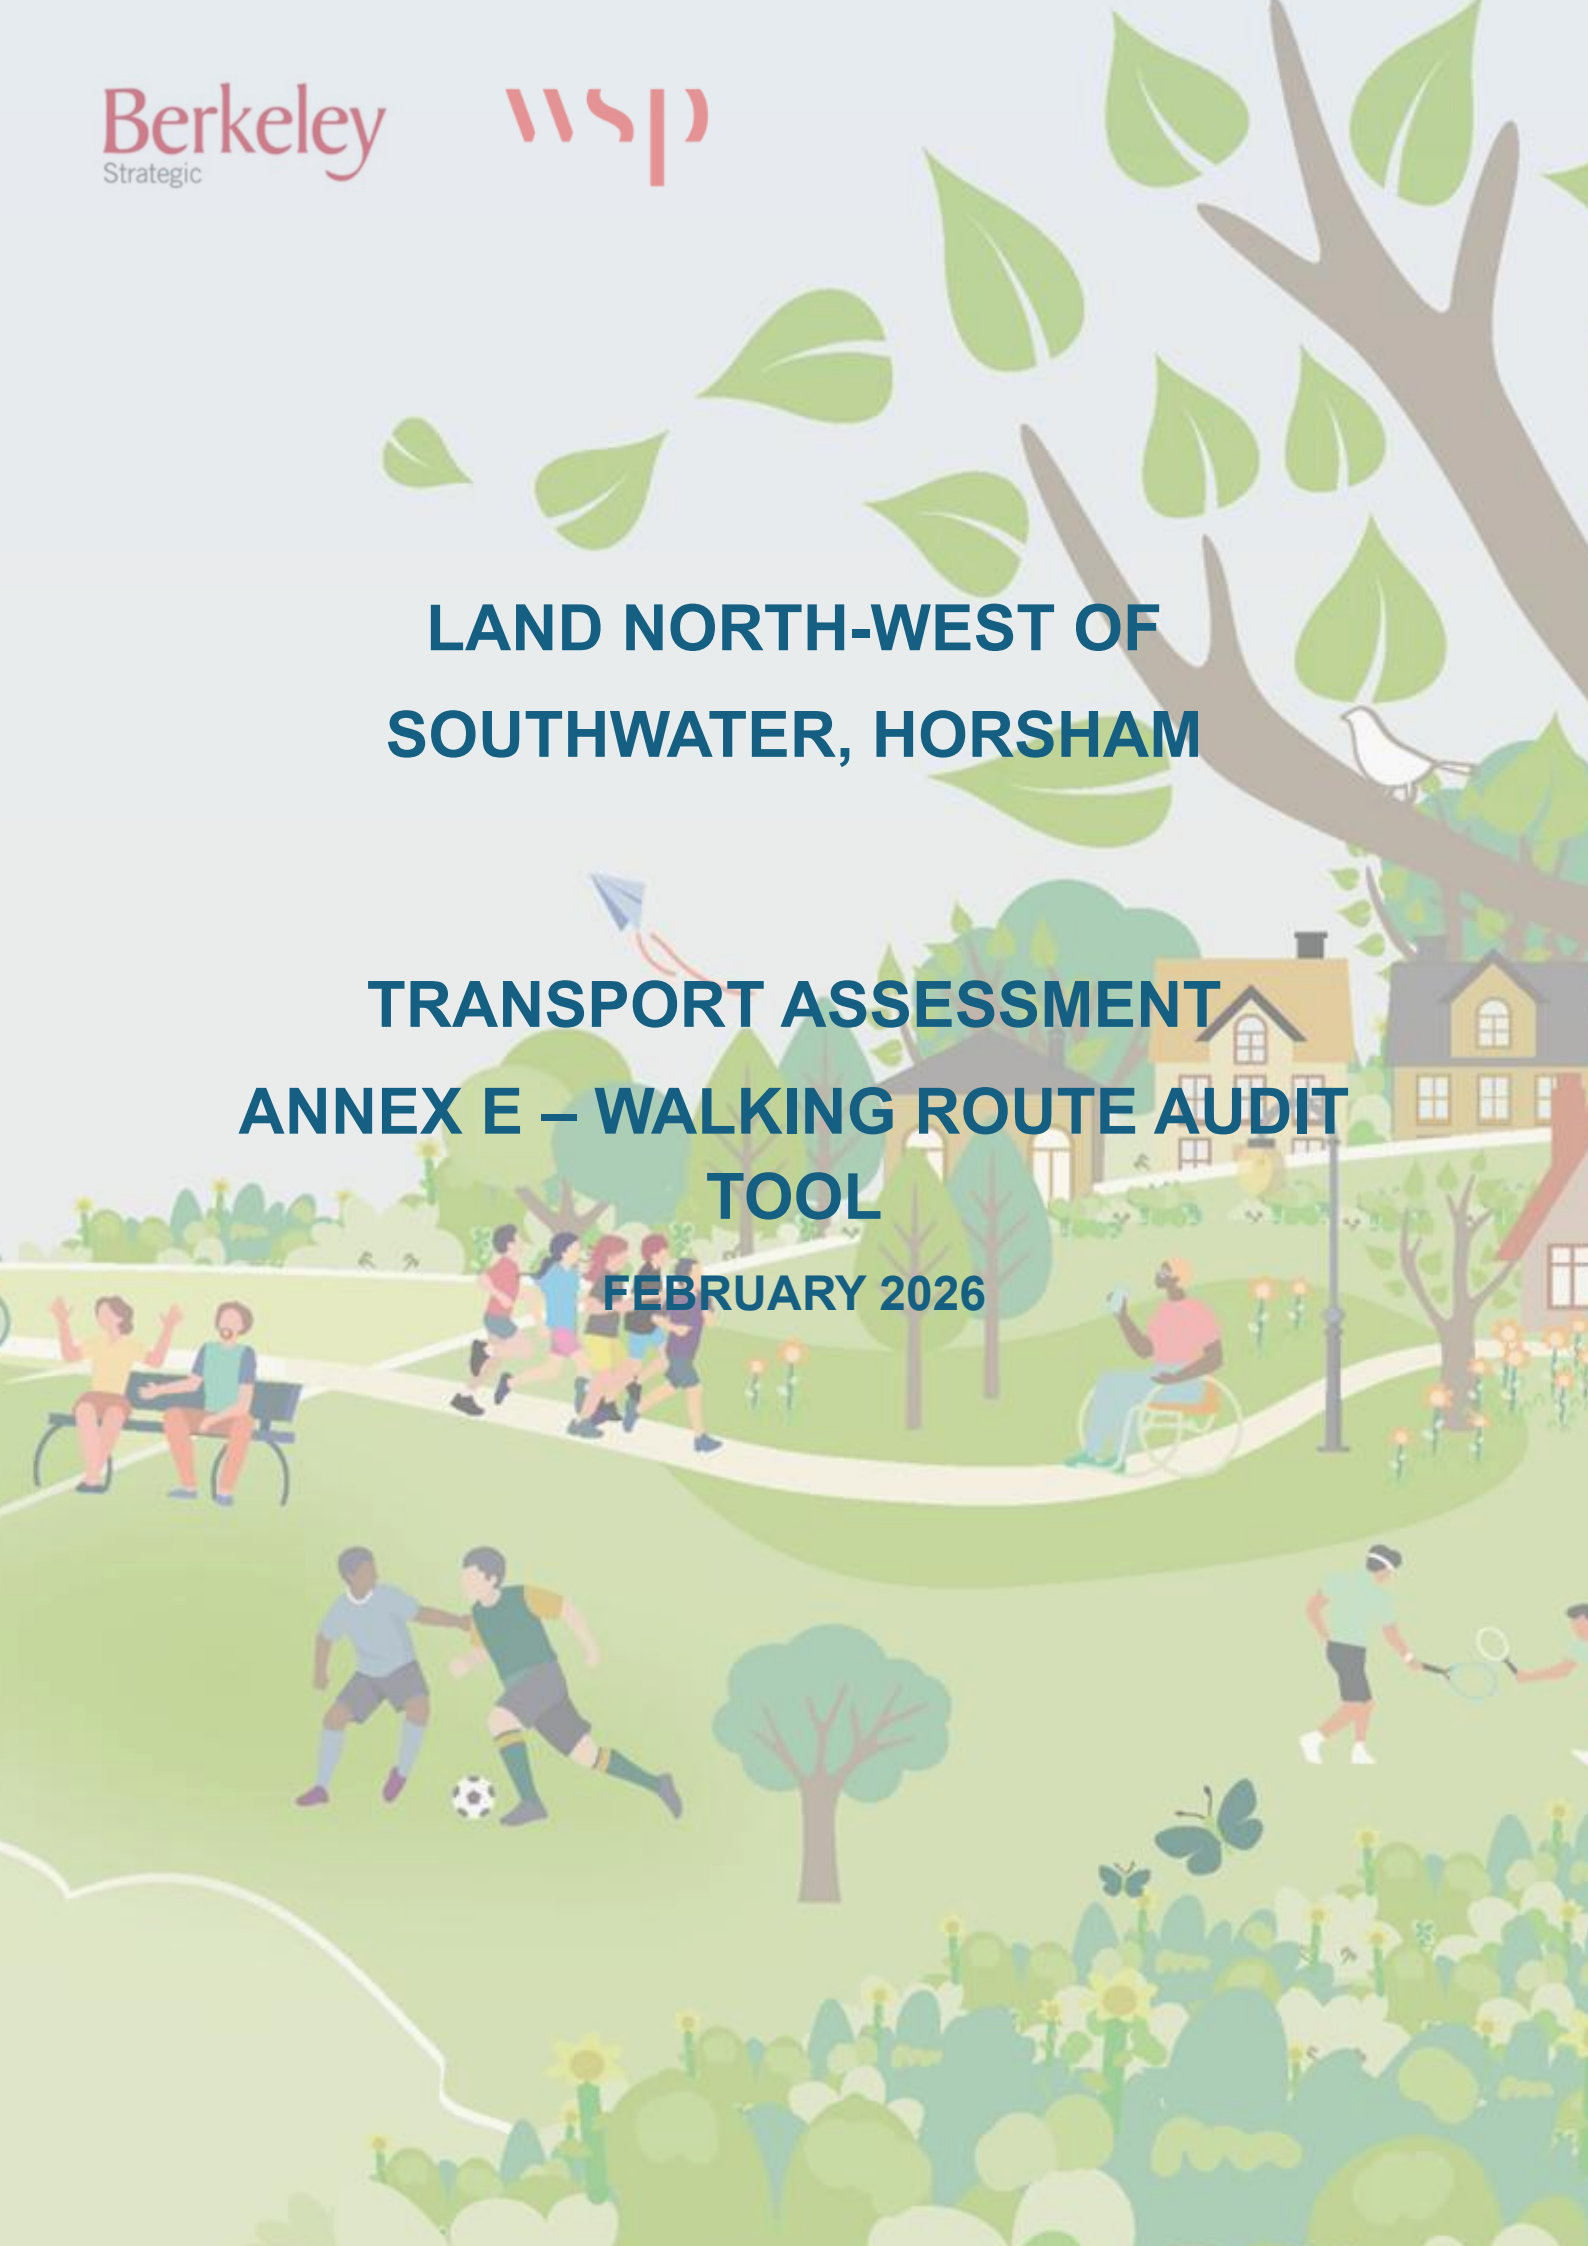

Local Cycling and Walking Infrastructure Plans

Walking Route Audit Tool

Overview

The primary function of the Walking Route Audit Tool (WRAT) is to assess the current condition and suitability of a walking route. The WRAT is intended to be used during or following a site visit and provides a means of ensuring that all of the factors are considered.

Walking Route Audit Tool Criteria

The WRAT uses a range of criteria to assess how well a route meets the core design outcomes, with scoring ranging from 2, being the highest, to 0, being the lowest.

The criteria are:

- attractiveness
- comfort
- directness
- safety
- coherence

How to use the RST

The WRAT requires the auditor to score the route against the following criteria:

0 for poor provision (RED)

1 for provision which is adequate but should be improved if possible (AMBER)

2 for good quality provision (GREEN)

A score of 70% (i.e. a score of 28 out of a potential 40 points) should normally be regarded as a minimum level of provision overall. Routes which score less than this, and factors which are scored as zero should be used to identify where improvements are required. As the scoring is sometimes qualitative the tool also allows the auditor to add comments explaining their score allocation. The actions column allows auditors to record solutions to any of the issues identified on the route e.g.

Summary

General information regarding the route can be entered at the bottom of the tool.

Further Information

LCWIP Guidance (Annex C) provides further information about the WRAT.

Acknowledgement

The WRAT was developed by Local Transport Projects Ltd. as part of the Active Travel Wales Guidance.

Local Cycling and Walking Infrastructure Plan: Walking Route Selection Tool
Walking Route Audit Tool

Audit Categories	2 (Green)	1 (Amber)	0 (Red)	Score	Comments	Actions
1. ATTRACTIVENESS - maintenance	Footways well maintained, with no significant issues noted.	Minor littering. Overgrown vegetation. Street furniture falling into minor disrepair (for example, peeling paint).	Littering and/or dog mess prevalent. Seriously overgrown vegetation, including low branches. Street furniture falling into major disrepair.			
2. ATTRACTIVENESS - fear of crime	No evidence of vandalism with appropriate natural surveillance.	Minor vandalism. Lack of active frontage and natural surveillance (e.g. houses set back or back onto street).	Major or prevalent vandalism. Evidence of criminal/antisocial activity. Route is isolated, not subject to natural surveillance (including where sight lines are inadequate).			
3. ATTRACTIVENESS - traffic noise and pollution	Traffic noise and pollution do not affect the attractiveness	Levels of traffic noise and/or pollution could be improved	Severe traffic pollution and/or severe traffic noise			
4. ATTRACTIVENESS - other	Examples of 'other' attractiveness issues include: - Evidence that lighting is not present, or is deficient; - Temporary features affecting the attractiveness of routes (e.g. refuse sacks). - Excessive use of guardrail or bollards					
ATTRACTIVENESS				0		
5. COMFORT - condition	Footways level and in good condition, with no trip hazards.	Some defects noted, typically isolated (such as trenching or patching) or minor (such as cracked, but level pavers). Defects unlikely to result in trips or difficulty for wheelchairs, prams etc. Some footway crossovers resulting in uneven surface.	Large number of footway crossovers resulting in uneven surface, subsided or fretted pavement, or significant uneven patching or trenching.			
6. COMFORT - footway width	Able to accommodate all users without 'give and take' between users or walking on roads. Footway widths generally in excess of 2m.	Footway widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Footway widths of less than 1.5m (i.e. standard wheelchair width). Limited footway width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.			
7. COMFORT - width on staggered crossings/ pedestrian islands/refuges	Able to accommodate all users without 'give and take' between users or walking on roads. Widths generally in excess of 2m to accommodate wheel-chair users.	Widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Widths of less than 1.5m (i.e. standard wheelchair width). Limited width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.			
8. COMFORT - footway parking	No instances of vehicles parking on footways noted. Clearance widths generally in excess of 2m between permanent obstructions.	Clearance widths between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads due to footway parking. Footway parking causes some deviation from desire lines.	Clearance widths less than 1.5m. Footway parking requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay. Footway parking causes significant deviation from desire lines.			
9. COMFORT - gradient	There are no slopes on footway.	Slopes exist but gradients do not exceed 8 per cent (1 in 12).	Gradients exceed 8 per cent (1 in 12).			
10. COMFORT - other	Examples of 'other' comfort issues include: - Temporary obstructions restricting clearance width for pedestrians (e.g. driveway gates opened into footway); - Barriers/gates restricting access; and - Bus shelters restricting clearance width. - Poorly drained footways resulting in noticeable ponding issues/slippery surfaces					
COMFORT				0		
11. DIRECTNESS - footway provision	Footways are provided to cater for pedestrian desire lines (e.g. adjacent to road).	Footway provision could be improved to better cater for pedestrian desire lines.	Footways are not provided to cater for pedestrian desire lines.			
12. DIRECTNESS - location of crossings in relation to desire lines	Crossings follow desire lines.	Crossings partially diverting pedestrians away from desire lines.	Crossings deviate significantly from desire lines.			
13. DIRECTNESS - gaps in traffic (where no controlled crossings present or if likely to cross outside of controlled crossing)	Crossing of road easy, direct, and comfortable and without delay (< 5s average).	Crossing of road direct, but associated with some delay (up to 15s average).	Crossing of road associated indirect, or associated with significant delay (>15s average).			
14. DIRECTNESS - impact of controlled crossings on journey time	Crossings are single phase pelican/puffin or zebra crossings.	Crossings are staggered but do not add significantly to journey time. Unlikely to wait >5s in pedestrian island.	Staggered crossings add significantly to journey time. Likely to wait >10s in pedestrian island.			
15. DIRECTNESS - green man time	Green man time is of sufficient length to cross comfortably.	Pedestrians would benefit from extended green man time but current time unlikely to deter users.	Green man time would not give vulnerable users sufficient time to cross comfortably.			
16. DIRECTNESS - other	Examples of 'other' directness issues include: - Routes to/from bus stops not accommodated; - Steps restricting access for all users; - Confusing layout for pedestrians creating severance issues for users.					
DIRECTNESS				0		
17. SAFETY - traffic volume	Traffic volume low, or pedestrians can keep distance from moderate traffic volumes.	Traffic volume moderate and pedestrians in close proximity.	High traffic volume, with pedestrians unable to keep their distance from traffic.			
18. SAFETY - traffic speed	Traffic speeds low, or pedestrians can keep distance from moderate traffic speeds.	Traffic speeds moderate and pedestrians in close proximity.	High traffic speeds, with pedestrians unable to keep their distance from traffic.			
19. SAFETY - visibility	Good visibility for all users.	Visibility could be somewhat improved but unlikely to result in collisions.	Poor visibility, likely to result in collisions.			
SAFETY				0		
20. COHERENCE - dropped kerbs and tactile paving	Adequate dropped kerb and tactile paving provision.	Dropped kerbs and tactile paving provided, albeit not to current standards.	Dropped kerbs and tactile paving absent or incorrect.			
COHERENCE				0		
Total Score				0		

ROUTE SUMMARY


Route Name	
Length	
Name of Assessor(s)	
Date of Assessment	

Criterion	Performance Scores
Attractiveness	0
Comfort	0
Directness	0
Safety	0
Coherence	0
Total	0

Comments	
Actions	

Date Modified: 19/01/26

Drawn By: INTJ159563

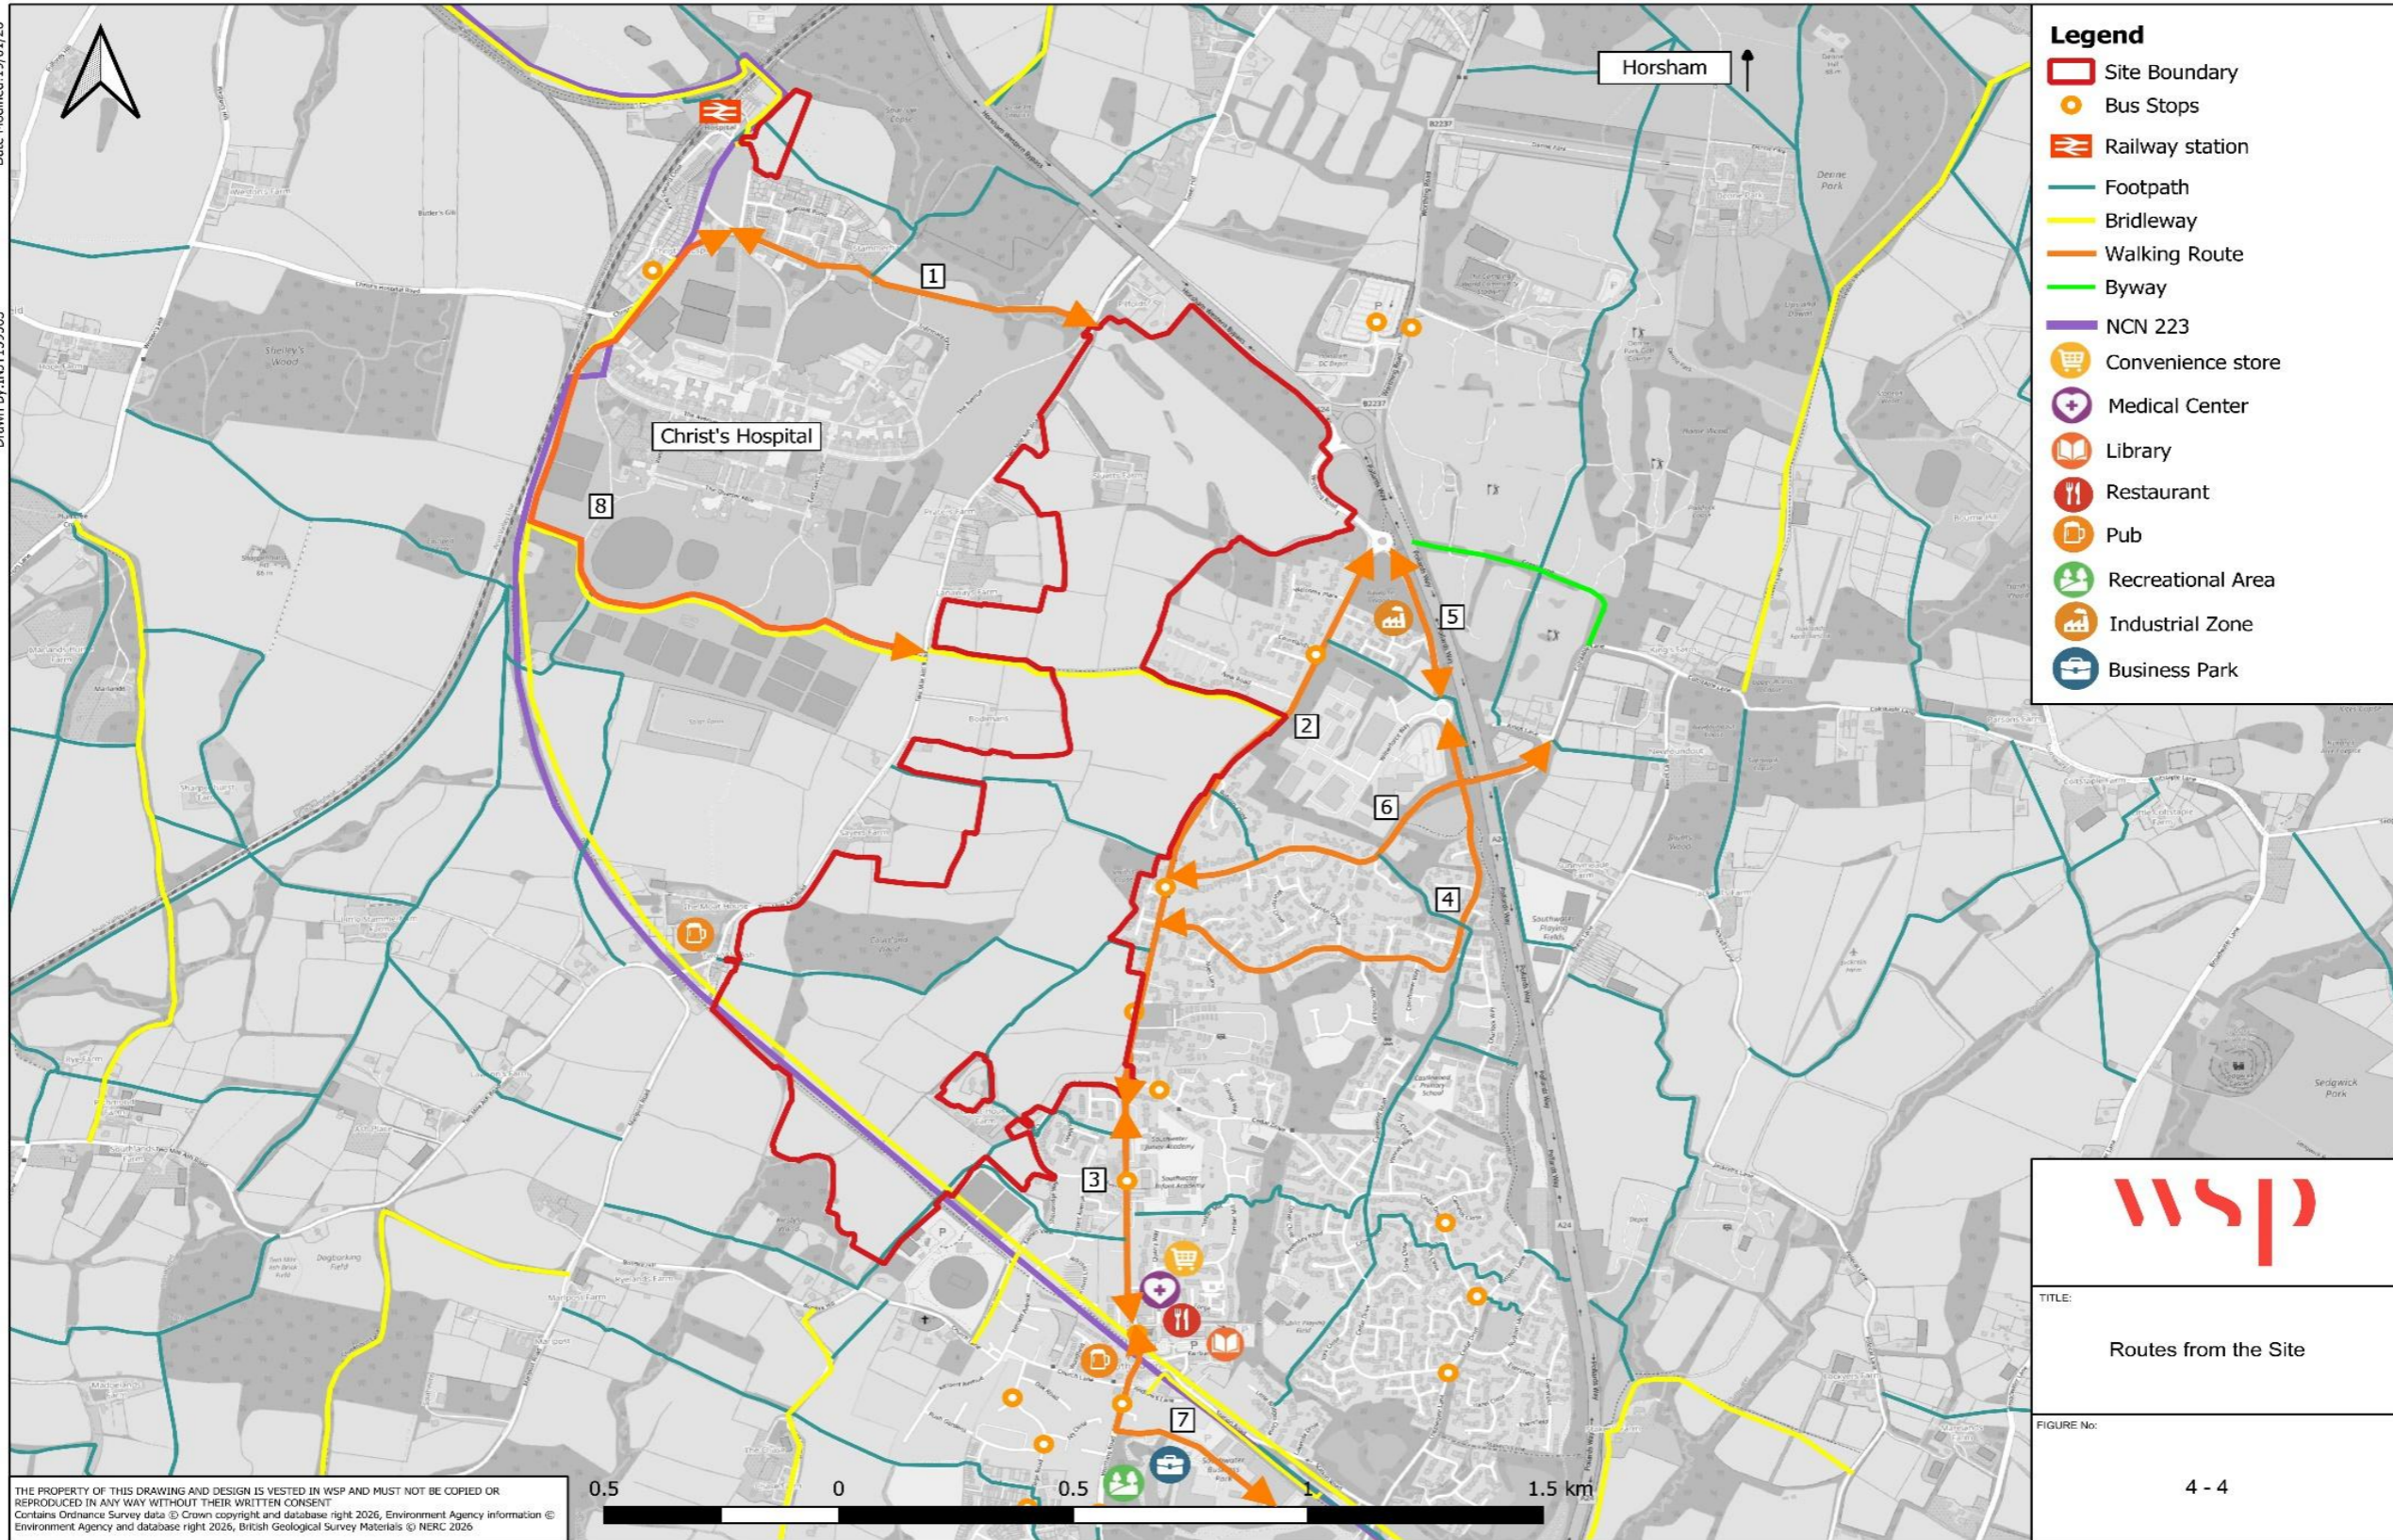

Legend

- Site Boundary
- Bus Stops
- ➔ Railway station
- Footpath
- Bridleway
- Walking Route
- Byway
- NCN 223
- 🛒 Convenience store
- 🏥 Medical Center
- 📖 Library
- 🍴 Restaurant
- 🍺 Pub
- 🌳 Recreational Area
- 🏭 Industrial Zone
- 🏢 Business Park

WSP

TITLE:
Routes from the Site

FIGURE No:
4 - 4

THE PROPERTY OF THIS DRAWING AND DESIGN IS VESTED IN WSP AND MUST NOT BE COPIED OR REPRODUCED IN ANY WAY WITHOUT THEIR WRITTEN CONSENT
 Contains Ordnance Survey data © Crown copyright and database right 2026, Environment Agency information © Environment Agency and database right 2026, British Geological Survey Materials © NERC 2026



Local Cycling and Walking Infrastructure Plan: Walking Route Selection Tool
Walking Route Audit Tool

Audit Categories	2 (Green)	1 (Amber)	0 (Red)	Score	Comments	Actions
1. ATTRACTIVENESS - maintenance	Footways well maintained, with no significant issues noted.	Minor littering. Overgrown vegetation. Street furniture falling into minor disrepair (for example, peeling paint).	Littering and/or dog mess prevalent. Seriously overgrown vegetation, including low branches. Street furniture falling into major disrepair.	2	Footways well maintained, with no significant issues noted.	
2. ATTRACTIVENESS - fear of crime	No evidence of vandalism with appropriate natural surveillance.	Minor vandalism. Lack of active frontage and natural surveillance (e.g. houses set back or back onto street).	Major or prevalent vandalism. Evidence of criminal/antisocial activity. Route is isolated, not subject to natural surveillance (including where sight lines are inadequate).	2	No evidence of vandalism with appropriate natural surveillance.	
3. ATTRACTIVENESS - traffic noise and pollution	Traffic noise and pollution do not affect the attractiveness	Levels of traffic noise and/or pollution could be improved	Severe traffic pollution and/or severe traffic noise	2	Traffic noise and pollution do not affect the attractiveness	
4. ATTRACTIVENESS - other	Examples of 'other' attractiveness issues include: - Evidence that lighting is not present, or is deficient; - Temporary features affecting the attractiveness of routes (e.g. refuse sacks). - Excessive use of guardrail or bollards			0	Evidence that lighting is not present everywhere	
ATTRACTIVENESS				6		
5. COMFORT - condition	Footways level and in good condition, with no trip hazards.	Some defects noted, typically isolated (such as trenching or patching) or minor (such as cracked, but level pavers). Defects unlikely to result in trips or difficulty for wheelchairs, prams etc. Some footway crossovers resulting in uneven surface.	Large number of footway crossovers resulting in uneven surface, subsided or fretted pavement, or significant uneven patching or trenching.	1	Defects unlikely to result in trips or difficulty for wheelchairs, prams etc	
6. COMFORT - footway width	Able to accommodate all users without 'give and take' between users or walking on roads. Footway widths generally in excess of 2m.	Footway widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Footway widths of less than 1.5m (i.e. standard wheelchair width). Limited footway width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	1	Footway widths of between approximately 1.5m and 2m.	
7. COMFORT - width on staggered crossings/ pedestrian islands/refuges	Able to accommodate all users without 'give and take' between users or walking on roads. Widths generally in excess of 2m to accommodate wheel-chair users.	Widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Widths of less than 1.5m (i.e. standard wheelchair width). Limited width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	1	Widths of between approximately 1.5m and 2m.	
8. COMFORT - footway parking	No instances of vehicles parking on footways noted. Clearance widths generally in excess of 2m between permanent obstructions.	Clearance widths between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads due to footway parking. Footway parking causes some deviation from desire lines.	Clearance widths less than 1.5m. Footway parking requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay. Footway parking causes significant deviation from desire lines.	2	No instances of vehicles parking on footways noted.	
9. COMFORT - gradient	There are no slopes on footway.	Slopes exist but gradients do not exceed 8 per cent (1 in 12).	Gradients exceed 8 per cent (1 in 12).	2	There are no slopes on footway.	
10. COMFORT - other	Examples of 'other' comfort issues include: - Temporary obstructions restricting clearance width for pedestrians (e.g. driveway gates opened into footway); - Barriers/gates restricting access, and - Bus shelters restricting clearance width. - Poorly drained footways resulting in noticeable ponding issues/slippery surfaces					
COMFORT				7		
11. DIRECTNESS - footway provision	Footways are provided to cater for pedestrian desire lines (e.g. adjacent to road).	Footway provision could be improved to better cater for pedestrian desire lines.	Footways are not provided to cater for pedestrian desire lines.	1	Footway provision could be improved to better cater for pedestrian desire lines.	
12. DIRECTNESS - location of crossings in relation to desire lines	Crossings follow desire lines.	Crossings partially diverting pedestrians away from desire lines.	Crossings deviate significantly from desire lines.	1	Crossings partially diverting pedestrians away from desire lines.	
13. DIRECTNESS - gaps in traffic (where no controlled crossings present or if likely to cross outside of controlled crossing)	Crossing of road easy, direct, and comfortable and without delay (< 5s average).	Crossing of road direct, but associated with some delay (up to 15s average).	Crossing of road associated indirect, or associated with significant delay (>15s average).	1	Crossing of road direct, but associated with some delay (up to 15s average).	
14. DIRECTNESS - Impact of controlled crossings on journey time	Crossings are single phase pelican/puffin or zebra crossings.	Crossings are staggered but do not add significantly to journey time. Unlikely to wait >5s in pedestrian island.	Staggered crossings add significantly to journey time. Likely to wait >10s in pedestrian island.	0	There is no controlled crossing	
15. DIRECTNESS - green man time	Green man time is of sufficient length to cross comfortably.	Pedestrians would benefit from extended green man time but current time unlikely to deter users.	Green man time would not give vulnerable users sufficient time to cross comfortably.	0		
16. DIRECTNESS - other	Examples of 'other' directness issues include: - Routes to/from bus stops not accommodated; - Steps restricting access for all users; - Confusing layout for pedestrians creating severance issues for users.					
DIRECTNESS				3		
17. SAFETY - traffic volume	Traffic volume low, or pedestrians can keep distance from moderate traffic volumes.	Traffic volume moderate and pedestrians in close proximity.	High traffic volume, with pedestrians unable to keep their distance from traffic.	2	Traffic volume low	
18. SAFETY - traffic speed	Traffic speeds low, or pedestrians can keep distance from moderate traffic speeds.	Traffic speeds moderate and pedestrians in close proximity.	High traffic speeds, with pedestrians unable to keep their distance from traffic.	2	Traffic speeds low	
19. SAFETY - visibility	Good visibility for all users.	Visibility could be somewhat improved but unlikely to result in collisions.	Poor visibility, likely to result in collisions.	2	Good visibility for all users.	
SAFETY				6		
20. COHERENCE - dropped kerbs and tactile paving	Adequate dropped kerb and tactile paving provision.	Dropped kerbs and tactile paving provided, albeit not to current standards.	Dropped kerbs and tactile paving absent or incorrect.	2	Adequate dropped kerb and tactile paving provision.	
COHERENCE				2		
			Total Score	24		

ROUTE SUMMARY

Route Name	Christ's Hospital Road
Length	950m
Name of Assessor(s)	Dusan Jovanovic
Date of Assessment	14.11.2025

Criterion	Performance Scores
Attractiveness	6
Comfort	7
Directness	3
Safety	6
Coherence	2
Total	24

Comments	
Actions	

Local Cycling and Walking Infrastructure Plan: Walking Route Selection Tool
Walking Route Audit Tool

Audit Categories	2 (Green)	1 (Amber)	0 (Red)	Score	Comments	Actions
1. ATTRACTIVENESS - maintenance	Footways well maintained, with no significant issues noted.	Minor littering. Overgrown vegetation. Street furniture falling into minor disrepair (for example, peeling paint).	Littering and/or dog mess prevalent. Seriously overgrown vegetation, including low branches. Street furniture falling into major disrepair.	2	Well maintained footways	
2. ATTRACTIVENESS - fear of crime	No evidence of vandalism with appropriate natural surveillance.	Minor vandalism. Lack of active frontage and natural surveillance (e.g. houses set back or back onto street).	Major or prevalent vandalism. Evidence of criminal/antisocial activity. Route is isolated, not subject to natural surveillance (including where sight lines are inadequate).	2	Properties on either/ both sides of the road provide natural surveillance	
3. ATTRACTIVENESS - traffic noise and pollution	Traffic noise and pollution do not affect the attractiveness	Levels of traffic noise and/or pollution could be improved	Severe traffic pollution and/or severe traffic noise	1		
4. ATTRACTIVENESS - other	Examples of 'other' attractiveness issues include: - Evidence that lighting is not present, or is deficient; - Temporary features affecting the attractiveness of routes (e.g. refuse sacks). - Excessive use of guardrail or bollards			2	Lighting provided	
ATTRACTIVENESS				7		
5. COMFORT - condition	Footways level and in good condition, with no trip hazards.	Some defects noted, typically isolated (such as trenching or patching) or minor (such as cracked, but level pavers). Defects unlikely to result in trips or difficulty for wheelchairs, prams etc. Some footway crossovers resulting in uneven surface.	Large number of footway crossovers resulting in uneven surface, subsided or fretted pavement, or significant uneven patching or trenching.	2	Footways are of good condition on Worthing Road	
6. COMFORT - footway width	Able to accommodate all users without 'give and take' between users or walking on roads. Footway widths generally in excess of 2m.	Footway widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Footway widths of less than 1.5m (i.e. standard wheelchair width). Limited footway width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	1	Footway widths of between approximately 1.5m and 2m.	
7. COMFORT - width on staggered crossings/ pedestrian islands/refuges	Able to accommodate all users without 'give and take' between users or walking on roads. Widths generally in excess of 2m to accommodate wheel-chair users.	Widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Widths of less than 1.5m (i.e. standard wheelchair width). Limited width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	2		
8. COMFORT - footway parking	No instances of vehicles parking on footways noted. Clearance widths generally in excess of 2m between permanent obstructions.	Clearance widths between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads due to footway parking. Footway parking causes some deviation from desire lines.	Clearance widths less than 1.5m. Footway parking requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay. Footway parking causes significant deviation from desire lines.	2	No on-street parking occurs on Worthing Road.	
9. COMFORT - gradient	There are no slopes on footway.	Slopes exist but gradients do not exceed 8 per cent (1 in 12).	Gradients exceed 8 per cent (1 in 12).	2	The footways are flat in terms of slopes	
10. COMFORT - other	Examples of 'other' comfort issues include: - Temporary obstructions restricting clearance width for pedestrians (e.g. driveway gates opened into footway); - Barriers/gates restricting access, and - Bus shelters restricting clearance width. - Poorly drained footways resulting in noticeable ponding issues/slippery surfaces			2	No other issues	
COMFORT				11		
11. DIRECTNESS - footway provision	Footways are provided to cater for pedestrian desire lines (e.g. adjacent to road).	Footway provision could be improved to better cater for pedestrian desire lines.	Footways are not provided to cater for pedestrian desire lines.	2	The footways and crossings provide pedestrian desire lines	
12. DIRECTNESS - location of crossings in relation to desire lines	Crossings follow desire lines.	Crossings partially diverting pedestrians away from desire lines.	Crossings deviate significantly from desire lines.	1	Pedestrian crossing on the desire lines	
13. DIRECTNESS - gaps in traffic (where no controlled crossings present or if likely to cross outside of controlled crossing)	Crossing of road easy, direct, and comfortable and without delay (< 5s average).	Crossing of road direct, but associated with some delay (up to 15s average).	Crossing of road associated indirect, or associated with significant delay (>15s average).	1	Traffic levels are quite high on Worthing Road which may increase the crossing delay	
14. DIRECTNESS - Impact of controlled crossings on journey time	Crossings are single phase pelican/puffin or zebra crossings.	Crossings are staggered but do not add significantly to journey time. Unlikely to wait >5s in pedestrian island.	Staggered crossings add significantly to journey time. Likely to wait >10s in pedestrian island.	0	No signalled crossings provided	
15. DIRECTNESS - green man time	Green man time is of sufficient length to cross comfortably.	Pedestrians would benefit from extended green man time but current time unlikely to deter users.	Green man time would not give vulnerable users sufficient time to cross comfortably.	0	No signalled crossings provided	
16. DIRECTNESS - other	Examples of 'other' directness issues include: - Routes to/from bus stops not accommodated; - Steps restricting access for all users; - Confusing layout for pedestrians creating severance issues for users.			2	Footways provide for all users	
DIRECTNESS				6		
17. SAFETY - traffic volume	Traffic volume low, or pedestrians can keep distance from moderate traffic volumes.	Traffic volume moderate and pedestrians in close proximity.	High traffic volume, with pedestrians unable to keep their distance from traffic.	1	Traffic levels are quite high on Worthing Road as it is the main through Southwater	
18. SAFETY - traffic speed	Traffic speeds low, or pedestrians can keep distance from moderate traffic speeds.	Traffic speeds moderate and pedestrians in close proximity.	High traffic speeds, with pedestrians unable to keep their distance from traffic.	1	Traffic Speeds limits are between 30-40mph	
19. SAFETY - visibility	Good visibility for all users.	Visibility could be somewhat improved but unlikely to result in collisions.	Poor visibility, likely to result in collisions.	2	Visibility is no issue on any of the crossings	
SAFETY				4		
20. COHERENCE - dropped kerbs and tactile paving	Adequate dropped kerb and tactile paving provision.	Dropped kerbs and tactile paving provided, albeit not to current standards.	Dropped kerbs and tactile paving absent or incorrect.	2	Drop kerbs and Tactile paving is required	
COHERENCE				2		
			Total Score	30		

ROUTE SUMMARY

Route Name	Worthing Road - 1
Length	1450m
Name of Assessor(s)	Philip Moss
Date of Assessment	14.11.2025

Criterion	Performance Scores
Attractiveness	7
Comfort	11
Directness	6
Safety	4
Coherence	2
Total	30

Comments	
Actions	

Local Cycling and Walking Infrastructure Plan: Walking Route Selection Tool
Walking Route Audit Tool

Audit Categories	2 (Green)	1 (Amber)	0 (Red)	Score	Comments	Actions
1. ATTRACTIVENESS - maintenance	Footways well maintained, with no significant issues noted.	Minor littering. Overgrown vegetation. Street furniture falling into minor disrepair (for example, peeling paint).	Littering and/or dog mess prevalent. Seriously overgrown vegetation, including low branches. Street furniture falling into major disrepair.	2	Footway is of a significant quality	
2. ATTRACTIVENESS - fear of crime	No evidence of vandalism with appropriate natural surveillance.	Minor vandalism. Lack of active frontage and natural surveillance (e.g. houses set back or back onto street).	Major or prevalent vandalism. Evidence of criminal/social activity. Route is isolated, not subject to natural surveillance (including where sight lines are inadequate).	2	Natural surveillance from units on both sides	
3. ATTRACTIVENESS - traffic noise and pollution	Traffic noise and pollution do not affect the attractiveness	Levels of traffic noise and/or pollution could be improved	Severe traffic pollution and/or severe traffic noise	1		
4. ATTRACTIVENESS - other	Examples of 'other' attractiveness issues include: - Evidence that lighting is not present, or is deficient; - Temporary features affecting the attractiveness of routes (e.g. refuse sacks). - Excessive use of guardrail or bollards			2	Lighting provided both sides of carriageway	
ATTRACTIVENESS				7		
5. COMFORT - condition	Footways level and in good condition, with no trip hazards.	Some defects noted, typically isolated (such as trenching or patching) or minor (such as cracked, but level pavers). Defects unlikely to result in trips or difficulty for wheelchairs, prams etc. Some footway crossovers resulting in uneven surface.	Large number of footway crossovers resulting in uneven surface, subsided or fretted pavement, or significant uneven patching or trenching.	2	Footways are of good condition on Worthing Road	
6. COMFORT - footway width	Able to accommodate all users without 'give and take' between users or walking on roads. Footway widths generally in excess of 2m.	Footway widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Footway widths of less than 1.5m (i.e. standard wheelchair width). Limited footway width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	1	Footway widths of between approximately 1.5m and 2m.	
7. COMFORT - width on staggered crossings/ pedestrian islands/refuges	Able to accommodate all users without 'give and take' between users or walking on roads. Widths generally in excess of 2m to accommodate wheel-chair users.	Widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Widths of less than 1.5m (i.e. standard wheelchair width). Limited width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	2		
8. COMFORT - footway parking	No instances of vehicles parking on footways noted. Clearance widths generally in excess of 2m between permanent obstructions.	Clearance widths between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads due to footway parking. Footway parking causes some deviation from desire lines.	Clearance widths less than 1.5m. Footway parking requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay. Footway parking causes significant deviation from desire lines.	2	No on-street parking occurs on Worthing Road.	
9. COMFORT - gradient	There are no slopes on footway.	Slopes exist but gradients do not exceed 8 per cent (1 in 12).	Gradients exceed 8 per cent (1 in 12).	2	The footways are flat in terms of slopes	
10. COMFORT - other	Examples of 'other' comfort issues include: - Temporary obstructions restricting clearance width for pedestrians (e.g. driveway gates opened into footway); - Barriers/gates restricting access; and - Bus shelters restricting clearance width. - Poorly drained footways resulting in noticeable ponding issues/slippery surfaces			2	No other issues	
COMFORT				11		
11. DIRECTNESS - footway provision	Footways are provided to cater for pedestrian desire lines (e.g. adjacent to road).	Footway provision could be improved to better cater for pedestrian desire lines.	Footways are not provided to cater for pedestrian desire lines.	2		
12. DIRECTNESS - location of crossings in relation to desire lines	Crossings follow desire lines.	Crossings partially diverting pedestrians away from desire lines.	Crossings deviate significantly from desire lines.	1		
13. DIRECTNESS - gaps in traffic (where no controlled crossings present or if likely to cross outside of controlled crossing)	Crossing of road easy, direct, and comfortable and without delay (< 5s average).	Crossing of road direct, but associated with some delay (up to 15s average).	Crossing of road associated indirect, or associated with significant delay (>15s average).	1		
14. DIRECTNESS - Impact of controlled crossings on journey time	Crossings are single phase pelican/puffin or zebra crossings.	Crossings are staggered but do not add significantly to journey time. Unlikely to wait >5s in pedestrian island.	Staggered crossings add significantly to journey time. Likely to wait >10s in pedestrian island.	1	Signal crossings are provided (majority have no stagger but a couple do)	
15. DIRECTNESS - green man time	Green man time is of sufficient length to cross comfortably.	Pedestrians would benefit from extended green man time but current time unlikely to deter users.	Green man time would not give vulnerable users sufficient time to cross comfortably.	2	Enough green time is provided for users	
16. DIRECTNESS - other	Examples of 'other' directness issues include: - Routes to/from bus stops not accommodated; - Steps restricting access for all users; - Confusing layout for pedestrians creating severance issues for users.			2		
DIRECTNESS				9		
17. SAFETY - traffic volume	Traffic volume low, or pedestrians can keep distance from moderate traffic volumes.	Traffic volume moderate and pedestrians in close proximity.	High traffic volume, with pedestrians unable to keep their distance from traffic.	1	Traffic levels are quite high on Worthing Road as it is the main through Southwater	
18. SAFETY - traffic speed	Traffic speeds low, or pedestrians can keep distance from moderate traffic speeds.	Traffic speeds moderate and pedestrians in close proximity.	High traffic speeds, with pedestrians unable to keep their distance from traffic.	1	Traffic Speeds limits are between 30mph	
19. SAFETY - visibility	Good visibility for all users.	Visibility could be somewhat improved but unlikely to result in collisions.	Poor visibility, likely to result in collisions.	2	Visibility is no issue on any of the crossings	
SAFETY				4		
20. COHERENCE - dropped kerbs and tactile paving	Adequate dropped kerb and tactile paving provision.	Dropped kerbs and tactile paving provided, albeit not to current standards.	Dropped kerbs and tactile paving absent or incorrect.	2		
COHERENCE				2		
			Total Score	33		

ROUTE SUMMARY

Route Name	Worthing Road - 2
Length	480m
Name of Assessor(s)	Philip Moss
Date of Assessment	14.11.2025

Criterion	Performance Scores
Attractiveness	7
Comfort	11
Directness	9
Safety	4
Coherence	2
Total	33

Comments	
Actions	

Local Cycling and Walking Infrastructure Plan: Walking Route Selection Tool
Walking Route Audit Tool

Audit Categories	2 (Green)	1 (Amber)	0 (Red)	Score	Comments	Actions
1. ATTRACTIVENESS - maintenance	Footways well maintained, with no significant issues noted.	Minor littering. Overgrown vegetation. Street furniture falling into minor disrepair (for example, peeling paint).	Littering and/or dog mess prevalent. Seriously overgrown vegetation, including low branches. Street furniture falling into major disrepair.	2	Footways well maintained, with no significant issues noted.	
2. ATTRACTIVENESS - fear of crime	No evidence of vandalism with appropriate natural surveillance.	Minor vandalism. Lack of active frontage and natural surveillance (e.g. houses set back or back onto street).	Major or prevalent vandalism. Evidence of criminal/social activity. Route is isolated, not subject to natural surveillance (including where sight lines are inadequate).	2	No evidence of vandalism with appropriate natural surveillance.	
3. ATTRACTIVENESS - traffic noise and pollution	Traffic noise and pollution do not affect the attractiveness	Levels of traffic noise and/or pollution could be improved	Severe traffic pollution and/or severe traffic noise	2	Traffic noise and pollution do not affect the attractiveness	
4. ATTRACTIVENESS - other	Examples of 'other' attractiveness issues include: - Evidence that lighting is not present, or is deficient; - Temporary features affecting the attractiveness of routes (e.g. refuse sacks). - Excessive use of guardrail or bollards			2	Lighting is well installed	
ATTRACTIVENESS				8		
5. COMFORT - condition	Footways level and in good condition, with no trip hazards.	Some defects noted, typically isolated (such as trenching or patching) or minor (such as cracked, but level pavers). Defects unlikely to result in trips or difficulty for wheelchairs, prams etc. Some footway crossovers resulting in uneven surface.	Large number of footway crossovers resulting in uneven surface, subsided or fretted pavement, or significant uneven patching or trenching.	2	Footways level and in good condition, with no trip hazards.	
6. COMFORT - footway width	Able to accommodate all users without 'give and take' between users or walking on roads. Footway widths generally in excess of 2m.	Footway widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Footway widths of less than 1.5m (i.e. standard wheelchair width). Limited footway width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	2	Able to accommodate all users without 'give and take' between users or walking on roads.	
7. COMFORT - width on staggered crossings/ pedestrian islands/refuges	Able to accommodate all users without 'give and take' between users or walking on roads. Widths generally in excess of 2m to accommodate wheel-chair users.	Widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Widths of less than 1.5m (i.e. standard wheelchair width). Limited width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	2	Able to accommodate all users without 'give and take' between users or walking on roads.	
8. COMFORT - footway parking	No instances of vehicles parking on footways noted. Clearance widths generally in excess of 2m between permanent obstructions.	Clearance widths between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads due to footway parking. Footway parking causes some deviation from desire lines.	Clearance widths less than 1.5m. Footway parking requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay. Footway parking causes significant deviation from desire lines.	2	No instances of vehicles parking on footways noted.	
9. COMFORT - gradient	There are no slopes on footway.	Slopes exist but gradients do not exceed 8 per cent (1 in 12).	Gradients exceed 8 per cent (1 in 12).	2	There are no slopes on footway	
10. COMFORT - other	Examples of 'other' comfort issues include: - Temporary obstructions restricting clearance width for pedestrians (e.g. driveway gates opened into footway); - Barriers/gates restricting access; and - Bus shelters restricting clearance width. - Poorly drained footways resulting in noticeable ponding issues/slippery surfaces					
COMFORT				10		
11. DIRECTNESS - footway provision	Footways are provided to cater for pedestrian desire lines (e.g. adjacent to road).	Footway provision could be improved to better cater for pedestrian desire lines.	Footways are not provided to cater for pedestrian desire lines.	2	Footways are provided to cater for pedestrian desire lines	
12. DIRECTNESS - location of crossings in relation to desire lines	Crossings follow desire lines.	Crossings partially diverting pedestrians away from desire lines.	Crossings deviate significantly from desire lines.	2	Crossings follow desire lines.	
13. DIRECTNESS - gaps in traffic (where no controlled crossings present or if likely to cross outside of controlled crossing)	Crossing of road easy, direct, and comfortable and without delay (< 5s average).	Crossing of road direct, but associated with some delay (up to 15s average).	Crossing of road associated indirect, or associated with significant delay (>15s average).	2	Crossing of road easy, direct, and comfortable and without delay	
14. DIRECTNESS - Impact of controlled crossings on journey time	Crossings are single phase pelican/puffin or zebra crossings.	Crossings are staggered but do not add significantly to journey time. Unlikely to wait >5s in pedestrian island.	Staggered crossings add significantly to journey time. Likely to wait >10s in pedestrian island.	0	There is no controlled crossing	
15. DIRECTNESS - green man time	Green man time is of sufficient length to cross comfortably.	Pedestrians would benefit from extended green man time but current time unlikely to deter users.	Green man time would not give vulnerable users sufficient time to cross comfortably.	0		
16. DIRECTNESS - other	Examples of 'other' directness issues include: - Routes to/from bus stops not accommodated; - Steps restricting access for all users; - Confusing layout for pedestrians creating severance issues for users.					
DIRECTNESS				6		
17. SAFETY - traffic volume	Traffic volume low, or pedestrians can keep distance from moderate traffic volumes.	Traffic volume moderate and pedestrians in close proximity.	High traffic volume, with pedestrians unable to keep their distance from traffic.	2	Traffic volume low	
18. SAFETY - traffic speed	Traffic speeds low, or pedestrians can keep distance from moderate traffic speeds.	Traffic speeds moderate and pedestrians in close proximity.	High traffic speeds, with pedestrians unable to keep their distance from traffic.	2	Traffic speeds low	
19. SAFETY - visibility	Good visibility for all users.	Visibility could be somewhat improved but unlikely to result in collisions.	Poor visibility, likely to result in collisions.	2	Good visibility for all users.	
SAFETY				6		
20. COHERENCE - dropped kerbs and tactile paving	Adequate dropped kerb and tactile paving provision.	Dropped kerbs and tactile paving provided, albeit not to current standards.	Dropped kerbs and tactile paving absent or incorrect.	2	Adequate dropped kerb and tactile paving provision.	
COHERENCE				2		
			Total Score	32		

ROUTE SUMMARY

Route Name	Blakes Farm Road - 1
Length	1300m
Name of Assessor(s)	Dusan Jovanovic
Date of Assessment	14.11.2025

Criterion	Performance Scores
Attractiveness	8
Comfort	10
Directness	6
Safety	6
Coherence	2
Total	32

Comments	
Actions	

Local Cycling and Walking Infrastructure Plan: Walking Route Selection Tool
Walking Route Audit Tool

Audit Categories	2 (Green)	1 (Amber)	0 (Red)	Score	Comments	Actions
1. ATTRACTIVENESS - maintenance	Footways well maintained, with no significant issues noted.	Minor littering. Overgrown vegetation. Street furniture falling into minor disrepair (for example, peeling paint).	Littering and/or dog mess prevalent. Seriously overgrown vegetation, including low branches. Street furniture falling into major disrepair.	2	Footways well maintained, with no significant issues noted.	
2. ATTRACTIVENESS - fear of crime	No evidence of vandalism with appropriate natural surveillance.	Minor vandalism. Lack of active frontage and natural surveillance (e.g. houses set back or back onto street).	Major or prevalent vandalism. Evidence of criminal/social activity. Route is isolated, not subject to natural surveillance (including where sight lines are inadequate).	2	No evidence of vandalism with appropriate natural surveillance.	
3. ATTRACTIVENESS - traffic noise and pollution	Traffic noise and pollution do not affect the attractiveness	Levels of traffic noise and/or pollution could be improved	Severe traffic pollution and/or severe traffic noise	2	Traffic noise and pollution do not affect the attractiveness	
4. ATTRACTIVENESS - other	Examples of 'other' attractiveness issues include: - Evidence that lighting is not present, or is deficient; - Temporary features affecting the attractiveness of routes (e.g. refuse sacks). - Excessive use of guardrail or bollards			1	Lighting is deficient	
ATTRACTIVENESS				7		
5. COMFORT - condition	Footways level and in good condition, with no trip hazards.	Some defects noted, typically isolated (such as trenching or patching) or minor (such as cracked, but level pavers). Defects unlikely to result in trips or difficulty for wheelchairs, prams etc. Some footway crossovers resulting in uneven surface.	Large number of footway crossovers resulting in uneven surface, subsided or fretted pavement, or significant uneven patching or trenching.	2	Footways level and in good condition, with no trip hazards.	
6. COMFORT - footway width	Able to accommodate all users without 'give and take' between users or walking on roads. Footway widths generally in excess of 2m.	Footway widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Footway widths of less than 1.5m (i.e. standard wheelchair width). Limited footway width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	1	Footway widths of between approximately 1.5m and 2m.	
7. COMFORT - width on staggered crossings/ pedestrian islands/refuges	Able to accommodate all users without 'give and take' between users or walking on roads. Widths generally in excess of 2m to accommodate wheel-chair users.	Widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Widths of less than 1.5m (i.e. standard wheelchair width). Limited width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	0	Widths of less than 1.5m.	
8. COMFORT - footway parking	No instances of vehicles parking on footways noted. Clearance widths generally in excess of 2m between permanent obstructions.	Clearance widths between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads due to footway parking. Footway parking causes some deviation from desire lines.	Clearance widths less than 1.5m. Footway parking requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay. Footway parking causes significant deviation from desire lines.	2	No instances of vehicles parking on footways noted.	
9. COMFORT - gradient	There are no slopes on footway.	Slopes exist but gradients do not exceed 8 per cent (1 in 12).	Gradients exceed 8 per cent (1 in 12).	2	There are no slopes on footway	
10.COMFORT - other	Examples of 'other' comfort issues include: - Temporary obstructions restricting clearance width for pedestrians (e.g. driveway gates opened into footway); - Barriers/gates restricting access; and - Bus shelters restricting clearance width. - Poorly drained footways resulting in noticeable ponding issues/slippery surfaces					
COMFORT				7		
11.DIRECTNESS - footway provision	Footways are provided to cater for pedestrian desire lines (e.g. adjacent to road).	Footway provision could be improved to better cater for pedestrian desire lines.	Footways are not provided to cater for pedestrian desire lines.	2	Footways are provided to cater for pedestrian desire lines	
12.DIRECTNESS - location of crossings in relation to desire lines	Crossings follow desire lines.	Crossings partially diverting pedestrians away from desire lines.	Crossings deviate significantly from desire lines.	2	Crossings follow desire lines.	
13.DIRECTNESS - gaps in traffic (where no controlled crossings present or if likely to cross outside of controlled crossing)	Crossing of road easy, direct, and comfortable and without delay (< 5s average).	Crossing of road direct, but associated with some delay (up to 15s average).	Crossing of road associated indirect, or associated with significant delay (>15s average).	2	Crossing of road easy, direct, and comfortable and without delay	
14.DIRECTNESS - Impact of controlled crossings on journey time	Crossings are single phase pelican/puffin or zebra crossings.	Crossings are staggered but do not add significantly to journey time. Unlikely to wait >5s in pedestrian island.	Staggered crossings add significantly to journey time. Likely to wait >10s in pedestrian island.	0	There is no controlled crossing	
15. DIRECTNESS - green man time	Green man time is of sufficient length to cross comfortably.	Pedestrians would benefit from extended green man time but current time unlikely to deter users.	Green man time would not give vulnerable users sufficient time to cross comfortably.	0		
16.DIRECTNESS - other	Examples of 'other' directness issues include: - Routes to/from bus stops not accommodated; - Steps restricting access for all users; - Confusing layout for pedestrians creating severance issues for users.					
DIRECTNESS				6		
17.SAFETY - traffic volume	Traffic volume low, or pedestrians can keep distance from moderate traffic volumes.	Traffic volume moderate and pedestrians in close proximity.	High traffic volume, with pedestrians unable to keep their distance from traffic.	2	Traffic volume low	
18.SAFETY - traffic speed	Traffic speeds low, or pedestrians can keep distance from moderate traffic speeds.	Traffic speeds moderate and pedestrians in close proximity.	High traffic speeds, with pedestrians unable to keep their distance from traffic.	2	Traffic speeds low	
19.SAFETY - visibility	Good visibility for all users.	Visibility could be somewhat improved but unlikely to result in collisions.	Poor visibility, likely to result in collisions.	2	Good visibility for all users.	
SAFETY				6		
20. COHERENCE - dropped kerbs and tactile paving	Adequate dropped kerb and tactile paving provision.	Dropped kerbs and tactile paving provided, albeit not to current standards.	Dropped kerbs and tactile paving absent or incorrect.	2	Adequate dropped kerb and tactile paving provision.	
COHERENCE				2		
			Total Score	28		

ROUTE SUMMARY

Route Name	Blakes Farm Road - 2
Length	320m
Name of Assessor(s)	Dusan Jovanovic
Date of Assessment	14.11.2025

Criterion	Performance Scores
Attractiveness	7
Comfort	7
Directness	6
Safety	6
Coherence	2
Total	28

Comments	
Actions	

Local Cycling and Walking Infrastructure Plan: Walking Route Selection Tool
Walking Route Audit Tool

Audit Categories	2 (Green)	1 (Amber)	0 (Red)	Score	Comments	Actions
1. ATTRACTIVENESS - maintenance	Footways well maintained, with no significant issues noted.	Minor littering. Overgrown vegetation. Street furniture falling into minor disrepair (for example, peeling paint).	Littering and/or dog mess prevalent. Seriously overgrown vegetation, including low branches. Street furniture falling into major disrepair.	2	Footways well maintained, with no significant issues noted.	
2. ATTRACTIVENESS - fear of crime	No evidence of vandalism with appropriate natural surveillance.	Minor vandalism. Lack of active frontage and natural surveillance (e.g. houses set back or back onto street).	Major or prevalent vandalism. Evidence of criminal/social activity. Route is isolated, not subject to natural surveillance (including where sight lines are inadequate).	2	No evidence of vandalism with appropriate natural surveillance.	
3. ATTRACTIVENESS - traffic noise and pollution	Traffic noise and pollution do not affect the attractiveness	Levels of traffic noise and/or pollution could be improved	Severe traffic pollution and/or severe traffic noise	2	Traffic noise and pollution do not affect the attractiveness	
4. ATTRACTIVENESS - other	Examples of 'other' attractiveness issues include: - Evidence that lighting is not present, or is deficient; - Temporary features affecting the attractiveness of routes (e.g. refuse sacks). - Excessive use of guardrail or bollards			1	Lighting is deficient	
ATTRACTIVENESS				7		
5. COMFORT - condition	Footways level and in good condition, with no trip hazards.	Some defects noted, typically isolated (such as trenching or patching) or minor (such as cracked, but level pavers). Defects unlikely to result in trips or difficulty for wheelchairs, prams etc. Some footway crossovers resulting in uneven surface.	Large number of footway crossovers resulting in uneven surface, subsided or fretted pavement, or significant uneven patching or trenching.	2	Footways level and in good condition, with no trip hazards.	
6. COMFORT - footway width	Able to accommodate all users without 'give and take' between users or walking on roads. Footway widths generally in excess of 2m.	Footway widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Footway widths of less than 1.5m (i.e. standard wheelchair width). Limited footway width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	1	Footway widths of between approximately 1.5m and 2m.	
7. COMFORT - width on staggered crossings/ pedestrian islands/refuges	Able to accommodate all users without 'give and take' between users or walking on roads. Widths generally in excess of 2m to accommodate wheel-chair users.	Widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Widths of less than 1.5m (i.e. standard wheelchair width). Limited width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	1	Footway widths of between approximately 1.5m and 2m.	
8. COMFORT - footway parking	No instances of vehicles parking on footways noted. Clearance widths generally in excess of 2m between permanent obstructions.	Clearance widths between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads due to footway parking. Footway parking causes some deviation from desire lines.	Clearance widths less than 1.5m. Footway parking requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay. Footway parking causes significant deviation from desire lines.	2	No instances of vehicles parking on footways noted.	
9. COMFORT - gradient	There are no slopes on footway.	Slopes exist but gradients do not exceed 8 per cent (1 in 12).	Gradients exceed 8 per cent (1 in 12).	1	Slopes existing on the approach to bridge	
10. COMFORT - other	Examples of 'other' comfort issues include: - Barriers/gates restricting access, and - Bus shelters restricting clearance width. - Poorly drained footways resulting in noticeable ponding issues/slippery surfaces			2		
COMFORT				9		
11. DIRECTNESS - footway provision	Footways are provided to cater for pedestrian desire lines (e.g. adjacent to road).	Footway provision could be improved to better cater for pedestrian desire lines.	Footways are not provided to cater for pedestrian desire lines.	2	Footways are provided to cater for pedestrian desire lines	
12. DIRECTNESS - location of crossings in relation to desire lines	Crossings follow desire lines.	Crossings partially diverting pedestrians away from desire lines.	Crossings deviate significantly from desire lines.	2	Crossings follow desire lines.	
13. DIRECTNESS - gaps in traffic (where no controlled crossings present or if likely to cross outside of controlled crossing)	Crossing of road easy, direct, and comfortable and without delay (< 5s average).	Crossing of road direct, but associated with some delay (up to 15s average).	Crossing of road associated indirect, or associated with significant delay (>15s average).	2	Crossing of road easy, direct, and comfortable and without delay	
14. DIRECTNESS - Impact of controlled crossings on journey time	Crossings are single phase pelican/puffin or zebra crossings.	Crossings are staggered but do not add significantly to journey time. Unlikely to wait >5s in pedestrian island.	Staggered crossings add significantly to journey time. Likely to wait >10s in pedestrian island.	0	Informal crossings provided	
15. DIRECTNESS - green man time	Green man time is of sufficient length to cross comfortably.	Pedestrians would benefit from extended green man time but current time unlikely to deter users.	Green man time would not give vulnerable users sufficient time to cross comfortably.	0		
16. DIRECTNESS - other	Examples of 'other' directness issues include: - Routes to/from bus stops not accommodated; - Steps restricting access for all users; - Confusing layout for pedestrians creating severance issues for users.			1	Issues around on-street parking bays making the route difficult for accessible users	
DIRECTNESS				7		
17. SAFETY - traffic volume	Traffic volume low, or pedestrians can keep distance from moderate traffic volumes.	Traffic volume moderate and pedestrians in close proximity.	High traffic volume, with pedestrians unable to keep their distance from traffic.	2	Traffic volume low	
18. SAFETY - traffic speed	Traffic speeds low, or pedestrians can keep distance from moderate traffic speeds.	Traffic speeds moderate and pedestrians in close proximity.	High traffic speeds, with pedestrians unable to keep their distance from traffic.	2	Traffic speeds low	
19. SAFETY - visibility	Good visibility for all users.	Visibility could be somewhat improved but unlikely to result in collisions.	Poor visibility, likely to result in collisions.	2	Good visibility for all users.	
SAFETY				6		
20. COHERENCE - dropped kerbs and tactile paving	Adequate dropped kerb and tactile paving provision.	Dropped kerbs and tactile paving provided, albeit not to current standards.	Dropped kerbs and tactile paving absent or incorrect.	2	Adequate dropped kerb and tactile paving provision.	
COHERENCE				2		
			Total Score	31		

ROUTE SUMMARY

Route Name	Southwater Street
Length	980m
Name of Assessor(s)	Philip Moss
Date of Assessment	14.11.2025

Criterion	Performance Scores
Attractiveness	7
Comfort	9
Directness	7
Safety	6
Coherence	2
Total	31

Comments	
Actions	

Local Cycling and Walking Infrastructure Plan: Walking Route Selection Tool
Walking Route Audit Tool

Audit Categories	2 (Green)	1 (Amber)	0 (Red)	Score	Comments	Actions
1. ATTRACTIVENESS - maintenance	Footways well maintained, with no significant issues noted.	Minor littering. Overgrown vegetation. Street furniture falling into minor disrepair (for example, peeling paint).	Littering and/or dog mess prevalent. Seriously overgrown vegetation, including low branches. Street furniture falling into major disrepair.	2	Footways well maintained, with no significant issues noted.	
2. ATTRACTIVENESS - fear of crime	No evidence of vandalism with appropriate natural surveillance.	Minor vandalism. Lack of active frontage and natural surveillance (e.g. houses set back or back onto street).	Major or prevalent vandalism. Evidence of criminal/social activity. Route is isolated, not subject to natural surveillance (including where sight lines are inadequate).	2	No evidence of vandalism with appropriate natural surveillance.	
3. ATTRACTIVENESS - traffic noise and pollution	Traffic noise and pollution do not affect the attractiveness	Levels of traffic noise and/or pollution could be improved	Severe traffic pollution and/or severe traffic noise	2	Traffic noise and pollution do not affect the attractiveness	
4. ATTRACTIVENESS - other	Examples of 'other' attractiveness issues include: - Evidence that lighting is not present, or is deficient; - Temporary features affecting the attractiveness of routes (e.g. refuse sacks). - Excessive use of guardrail or bollards			2	Lighting is well present	
ATTRACTIVENESS				8		
5. COMFORT - condition	Footways level and in good condition, with no trip hazards.	Some defects noted, typically isolated (such as trenching or patching) or minor (such as cracked, but level pavers). Defects unlikely to result in trips or difficulty for wheelchairs, prams etc. Some footway crossovers resulting in uneven surface.	Large number of footway crossovers resulting in uneven surface, subsided or fretted pavement, or significant uneven patching or trenching.	2	Footways level and in good condition, with no trip hazards.	
6. COMFORT - footway width	Able to accommodate all users without 'give and take' between users or walking on roads. Footway widths generally in excess of 2m.	Footway widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Footway widths of less than 1.5m (i.e. standard wheelchair width). Limited footway width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	1	Footway widths of between approximately 1.5m and 2m.	
7. COMFORT - width on staggered crossings/ pedestrian islands/refuges	Able to accommodate all users without 'give and take' between users or walking on roads. Widths generally in excess of 2m to accommodate wheel-chair users.	Widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Widths of less than 1.5m (i.e. standard wheelchair width). Limited width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	0	Widths of less than 1.5m.	
8. COMFORT - footway parking	No instances of vehicles parking on footways noted. Clearance widths generally in excess of 2m between permanent obstructions.	Clearance widths between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads due to footway parking. Footway parking causes some deviation from desire lines.	Clearance widths less than 1.5m. Footway parking requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay. Footway parking causes significant deviation from desire lines.	2	No instances of vehicles parking on footways noted.	
9. COMFORT - gradient	There are no slopes on footway.	Slopes exist but gradients do not exceed 8 per cent (1 in 12).	Gradients exceed 8 per cent (1 in 12).	2	There are no slopes on footway	
10. COMFORT - other	Examples of 'other' comfort issues include: - Barriers/gates restricting access, and - Bus shelters restricting clearance width. - Poorly drained footways resulting in noticeable ponding issues/slippery surfaces					
COMFORT				7		
11. DIRECTNESS - footway provision	Footways are provided to cater for pedestrian desire lines (e.g. adjacent to road).	Footway provision could be improved to better cater for pedestrian desire lines.	Footways are not provided to cater for pedestrian desire lines.	2	Footways are provided to cater for pedestrian desire lines	
12. DIRECTNESS - location of crossings in relation to desire lines	Crossings follow desire lines.	Crossings partially diverting pedestrians away from desire lines.	Crossings deviate significantly from desire lines.	2	Crossings follow desire lines.	
13. DIRECTNESS - gaps in traffic (where no controlled crossings present or if likely to cross outside of controlled crossing)	Crossing of road easy, direct, and comfortable and without delay (< 5s average).	Crossing of road direct, but associated with some delay (up to 15s average).	Crossing of road associated indirect, or associated with significant delay (>15s average).	2	Crossing of road easy, direct, and comfortable and without delay	
14. DIRECTNESS - Impact of controlled crossings on journey time	Crossings are single phase pelican/puffin or zebra crossings.	Crossings are staggered but do not add significantly to journey time. Unlikely to wait >5s in pedestrian island.	Staggered crossings add significantly to journey time. Likely to wait >10s in pedestrian island.	0	There is no controlled crossing	
15. DIRECTNESS - green man time	Green man time is of sufficient length to cross comfortably.	Pedestrians would benefit from extended green man time but current time unlikely to deter users.	Green man time would not give vulnerable users sufficient time to cross comfortably.	0		
16. DIRECTNESS - other	Examples of 'other' directness issues include: - Routes to/from bus stops not accommodated; - Steps restricting access for all users; - Confusing layout for pedestrians creating severance issues for users.					
DIRECTNESS				6		
17. SAFETY - traffic volume	Traffic volume low, or pedestrians can keep distance from moderate traffic volumes.	Traffic volume moderate and pedestrians in close proximity.	High traffic volume, with pedestrians unable to keep their distance from traffic.	2	Traffic volume low	
18. SAFETY - traffic speed	Traffic speeds low, or pedestrians can keep distance from moderate traffic speeds.	Traffic speeds moderate and pedestrians in close proximity.	High traffic speeds, with pedestrians unable to keep their distance from traffic.	2	Traffic speeds low	
19. SAFETY - visibility	Good visibility for all users.	Visibility could be somewhat improved but unlikely to result in collisions.	Poor visibility, likely to result in collisions.	2	Good visibility for all users.	
SAFETY				6		
20. COHERENCE - dropped kerbs and tactile paving	Adequate dropped kerb and tactile paving provision.	Dropped kerbs and tactile paving provided, albeit not to current standards.	Dropped kerbs and tactile paving absent or incorrect.	2	Adequate dropped kerb and tactile paving provision.	
COHERENCE				2		
			Total Score	29		

ROUTE SUMMARY

Route Name	Southwater Business Park/Worthing Rd
Length	800m
Name of Assessor(s)	Dusan Jovanovic
Date of Assessment	14.11.2025

Criterion	Performance Scores
Attractiveness	8
Comfort	7
Directness	6
Safety	6
Coherence	2
Total	29

Comments	
Actions	

Local Cycling and Walking Infrastructure Plan: Walking Route Selection Tool
Walking Route Audit Tool

Audit Categories	2 (Green)	1 (Amber)	0 (Red)	Score	Comments	Actions
1. ATTRACTIVENESS - maintenance	Footways well maintained, with no significant issues noted.	Minor littering. Overgrown vegetation. Street furniture falling into minor disrepair (for example, peeling paint).	Littering and/or dog mess prevalent. Seriously overgrown vegetation, including low branches. Street furniture falling into major disrepair.	2	Overgrown vegetation	
2. ATTRACTIVENESS - fear of crime	No evidence of vandalism with appropriate natural surveillance.	Minor vandalism. Lack of active frontage and natural surveillance (e.g. houses set back or back onto street).	Major or prevalent vandalism. Evidence of criminal/social activity. Route is isolated, not subject to natural surveillance (including where sight lines are inadequate).	1	Lack of Natural Surveillance on the section before connecting into the PROWs through CH school	
3. ATTRACTIVENESS - traffic noise and pollution	Traffic noise and pollution do not affect the attractiveness	Levels of traffic noise and/or pollution could be improved	Severe traffic pollution and/or severe traffic noise	2	Traffic noise and pollution do not affect the attractiveness	
4. ATTRACTIVENESS - other	Examples of 'other' attractiveness issues include: - Evidence that lighting is not present, or is deficient; - Temporary features affecting the attractiveness of routes (e.g. refuse sacks). - Excessive use of guardrail or bollards			0	No lighting present	
ATTRACTIVENESS				5		
5. COMFORT - condition	Footways level and in good condition, with no trip hazards.	Some defects noted, typically isolated (such as trenching or patching) or minor (such as cracked, but level pavers). Defects unlikely to result in trips or difficulty for wheelchairs, prams etc. Some footway crossovers resulting in uneven surface.	Large number of footway crossovers resulting in uneven surface, subsided or fretted pavement, or significant uneven patching or trenching.	1	Defects unlikely to result in trips or difficulty for wheelchairs, prams etc	
6. COMFORT - footway width	Able to accommodate all users without 'give and take' between users or walking on roads. Footway widths generally in excess of 2m.	Footway widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Footway widths of less than 1.5m (i.e. standard wheelchair width). Limited footway width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	2	Footway width at least 2m	
7. COMFORT - width on staggered crossings/ pedestrian islands/refuges	Able to accommodate all users without 'give and take' between users or walking on roads. Widths generally in excess of 2m to accommodate wheel-chair users.	Widths of between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads.	Widths of less than 1.5m (i.e. standard wheelchair width). Limited width requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay.	2	No staggered crossings provided	
8. COMFORT - footway parking	No instances of vehicles parking on footways noted. Clearance widths generally in excess of 2m between permanent obstructions.	Clearance widths between approximately 1.5m and 2m. Occasional need for 'give and take' between users and walking on roads due to footway parking. Footway parking causes some deviation from desire lines.	Clearance widths less than 1.5m. Footway parking requires users to 'give and take' frequently, walk on roads and/or results in crowding/delay. Footway parking causes significant deviation from desire lines.	2	No instances of vehicles parking on footways noted.	
9. COMFORT - gradient	There are no slopes on footway.	Slopes exist but gradients do not exceed 8 per cent (1 in 12).	Gradients exceed 8 per cent (1 in 12).	2	There are no slopes on footway	
10. COMFORT - other	Examples of 'other' comfort issues include: - Temporary obstructions restricting clearance width for pedestrians (e.g. driveway gates opened into footway); - Barriers/gates restricting access; and - Bus shelters restricting clearance width. - Poorly drained footways resulting in noticeable ponding issues/slippery surfaces			1	Drainage issues on a short section on the PROW	
COMFORT				10		
11. DIRECTNESS - footway provision	Footways are provided to cater for pedestrian desire lines (e.g. adjacent to road).	Footway provision could be improved to better cater for pedestrian desire lines.	Footways are not provided to cater for pedestrian desire lines.	2	PROW is direct	
12. DIRECTNESS - location of crossings in relation to desire lines	Crossings follow desire lines.	Crossings partially diverting pedestrians away from desire lines.	Crossings deviate significantly from desire lines.	2	Crossing are in the correct location for the desire line of users	
13. DIRECTNESS - gaps in traffic (where no controlled crossings present or if likely to cross outside of controlled crossing)	Crossing of road easy, direct, and comfortable and without delay (< 5s average).	Crossing of road direct, but associated with some delay (up to 15s average).	Crossing of road associated indirect, or associated with significant delay (>15s average).	2	Limited traffic flows mean low delays are likely	
14. DIRECTNESS - Impact of controlled crossings on journey time	Crossings are single phase pelican/puffin or zebra crossings.	Crossings are staggered but do not add significantly to journey time. Unlikely to wait >5s in pedestrian island.	Staggered crossings add significantly to journey time. Likely to wait >10s in pedestrian island.	0		
15. DIRECTNESS - green man time	Green man time is of sufficient length to cross comfortably.	Pedestrians would benefit from extended green man time but current time unlikely to deter users.	Green man time would not give vulnerable users sufficient time to cross comfortably.	0		
16. DIRECTNESS - other	Examples of 'other' directness issues include: - Routes to/from bus stops not accommodated; - Steps restricting access for all users; - Confusing layout for pedestrians creating severance issues for users.			2		
DIRECTNESS				8		
17. SAFETY - traffic volume	Traffic volume low, or pedestrians can keep distance from moderate traffic volumes.	Traffic volume moderate and pedestrians in close proximity.	High traffic volume, with pedestrians unable to keep their distance from traffic.	2	Traffic volume low	
18. SAFETY - traffic speed	Traffic speeds low, or pedestrians can keep distance from moderate traffic speeds.	Traffic speeds moderate and pedestrians in close proximity.	High traffic speeds, with pedestrians unable to keep their distance from traffic.	2	Traffic speeds low	
19. SAFETY - visibility	Good visibility for all users.	Visibility could be somewhat improved but unlikely to result in collisions.	Poor visibility, likely to result in collisions.	2	Good visibility for all users.	
SAFETY				6		
20. COHERENCE - dropped kerbs and tactile paving	Adequate dropped kerb and tactile paving provision.	Dropped kerbs and tactile paving provided, albeit not to current standards.	Dropped kerbs and tactile paving absent or incorrect.	0	No informal facilities provided	
COHERENCE				0		
			Total Score	29		

ROUTE SUMMARY

Route Name	Christ's Hospital Road - Route 2
Length	2000m
Name of Assessor(s)	Philip Moss
Date of Assessment	14.11.2025

Criterion	Performance Scores
Attractiveness	5
Comfort	10
Directness	8
Safety	6
Coherence	0
Total	29

Comments	
Actions	