




LEVEL MONITORING - RELATIVE SURVEY READINGS

Provider Details			Client Details		Risk Address	
Name:	Gryphon Surveys		Client Name:		Occupier:	Mr C & Miss R Sandhu
Our Ref:	G7167-M1			B Maule & Co Ltd.	Address:	
Date of Issue:			Email:		Address:	11 Cape Copse
			Client Ref:		Town:	Rudgwick
Monitoring Details			Address:	Albion Chambers	County:	West Sussex
Instruction Date:	20/6/22		Address:	Matthew Street	Post Code:	RH12 3HG
First Reading Date:	5/7/22			Dunstable. Beds	Tel Home:	
Maximum No Visits:					Tel Work:	
Monitoring Duration:	6-8 Months		Post Code:	LU6 1SD	Mobile:	07985 673 735 - Miss Sandhu
Monitoring Intervals:	Bi Monthly		Tel:	01582 602260	Other:	
					Other:	

Reading Date:		5/7/22	16/9/22	28/11/22	18/1/23											
Point Name		1	2	3	4	5	6	7	8	9	10	RANGE	O/A			
1		10.4410	10.4407	10.4412	10.4411							0.5	0.1			
2		10.3707	10.3673	10.3710	10.3714							4.1	0.7			
3		10.3511	10.3448	10.3520	10.3529							8.1	1.8			
4		10.3506	10.3422	10.3541	10.3556							13.4	4.9			
5		10.5309	10.5203	10.5296	10.5319							11.6	1.0			
6		10.2648	10.2542	10.2644	10.2664							12.2	1.6			
7		10.3375	10.3254	10.3358	10.3382							12.8	0.8			
8		10.3430	10.3283	10.3381	10.3423							14.7	-0.7			
9		10.3587	10.3416	10.3513	10.3565							17.1	-2.2			
10		10.3694	10.3503	10.3598	10.3660							19.1	-3.4			
11		10.3368	10.3236	10.3320	10.3357							13.2	-1.1			
12		10.3465	10.3327	10.3410	10.3447							13.8	-1.8			
13		10.3889	10.3724	10.3794	10.3850							16.5	-3.9			
14		10.3352	10.3183	10.3251	10.3305							16.9	-4.6			
15		10.3483	10.3424	10.3456	10.3474							5.9	-0.9			
16		10.3382	10.3352	10.3372	10.3378							3.0	-0.4			
17		10.4224	10.4232	10.4230	10.4227							0.8	0.3			
18		10.4362	10.4373	10.4370	10.4366							1.1	0.4			
19		10.8326	10.8338	10.8337	10.8330							1.2	0.4			
TBM1		10.0000	9.9960	9.9966	9.9975											
TBM2		10.4825	10.4825	10.4825	10.4825											
TBM3		10.4528	10.4529	10.4528	10.4529											

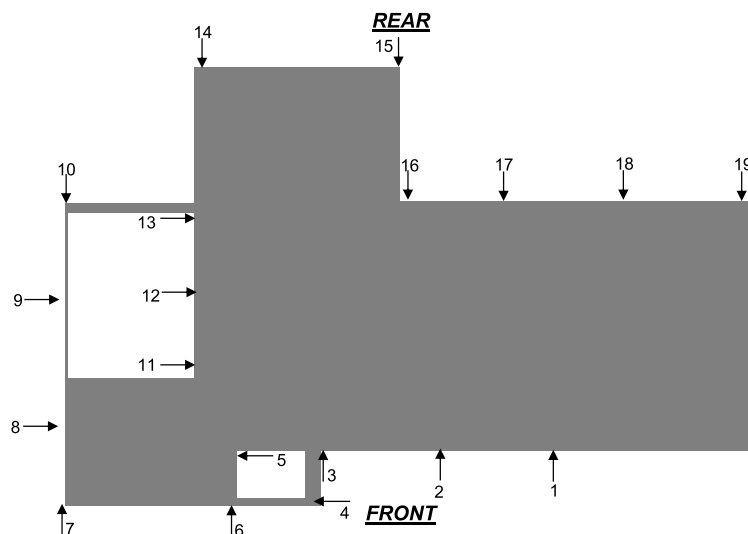

- The points could not be taken on a common brickcourse subsequently relative data only
- TBM 1 appears damaged, We have used TBM 2 as the stable point. 16/09/22
- Further readings will be taken on a bi-monthly basis.




GRYPHON SURVEYS LTD.
01277-212794
www.gryphon-surveys.co.uk

LEVEL MONITORING - RELATIVE MOVEMENT SKETCH

Client: B Maule & Co Ltd.

Client Ref: 0

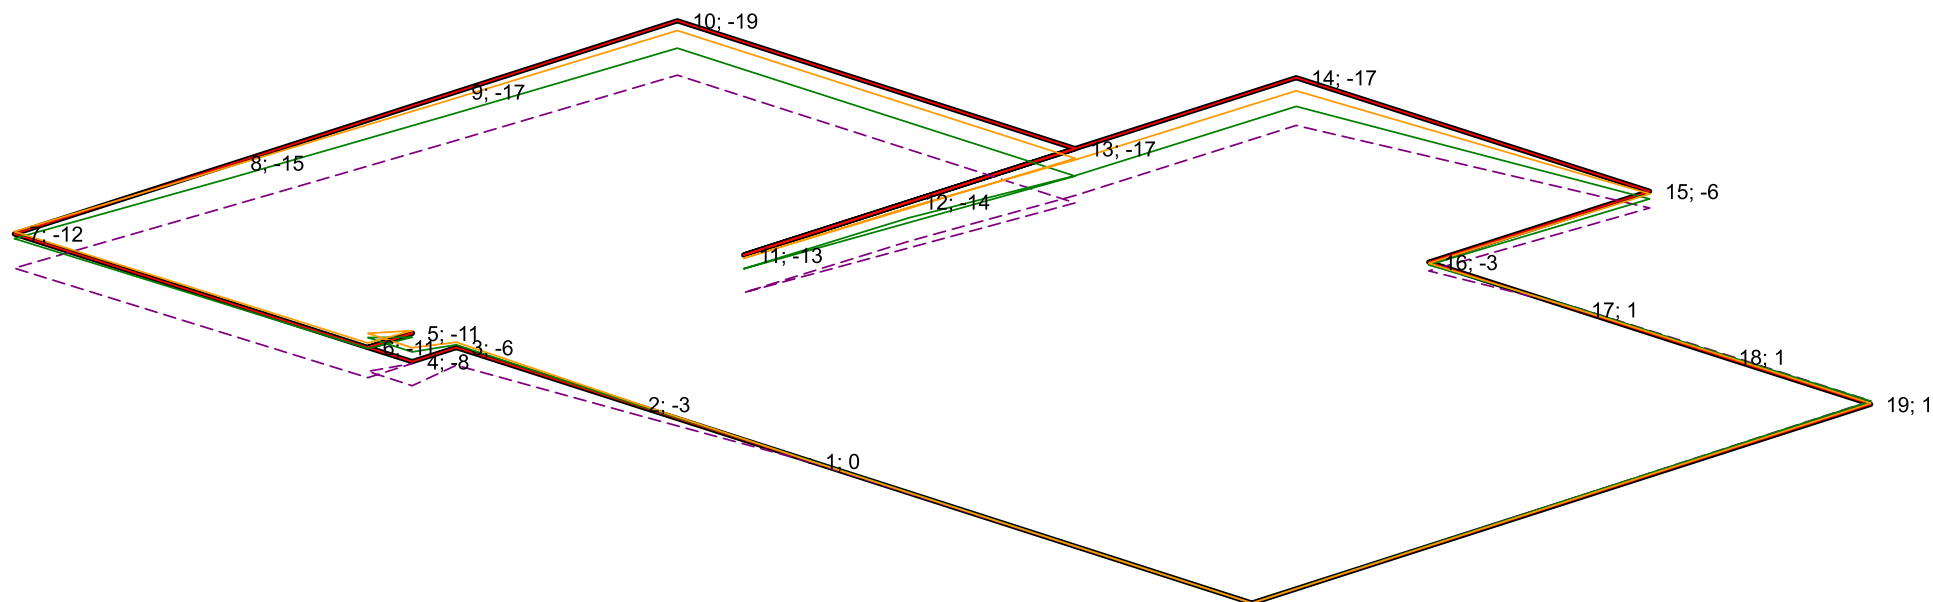

— Datum Reading	— Reading 1 (5/7/22)	- - Reading 2 (16/9/22)	— Reading 3 (28/11/22)	— Reading 4 (18/1/23)	- - - Reading 5 (0/1/00)
- - - Reading 6 (0/1/00)	- - - Reading 7 (0/1/00)	- - - Reading 8 (0/1/00)	- - - Reading 9 (0/1/00)	- - - Reading 10 (0/1/00)	

Notes:
Vertical distorted scale 1: 100

Point labels give level difference of last reading from original datum in mm.



LEVEL MONITORING - RELATIVE SURVEY READINGS


Client: B Maule & Co Ltd.

Client Ref:


0

Chart Scale 1:1000

1

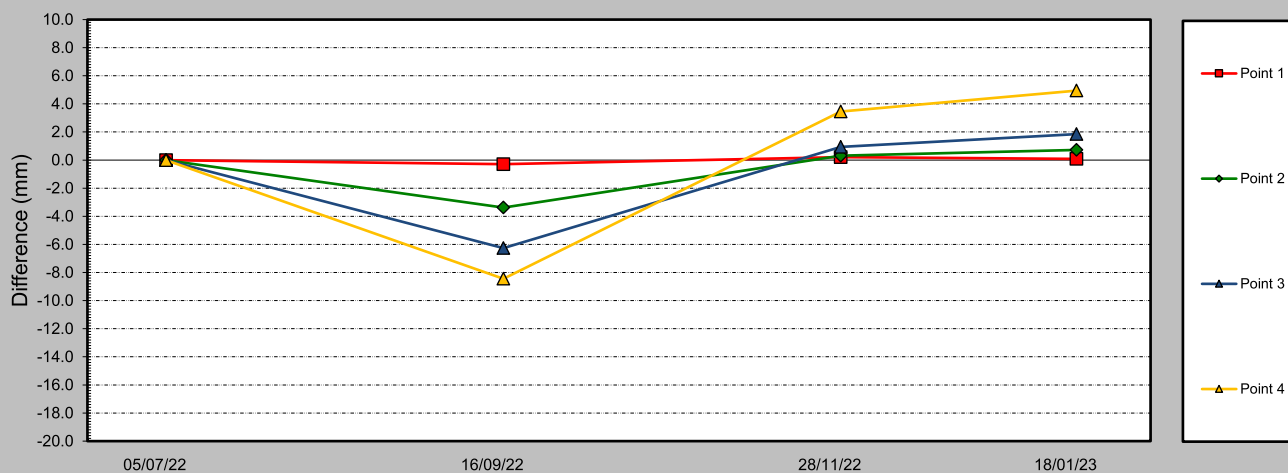

2

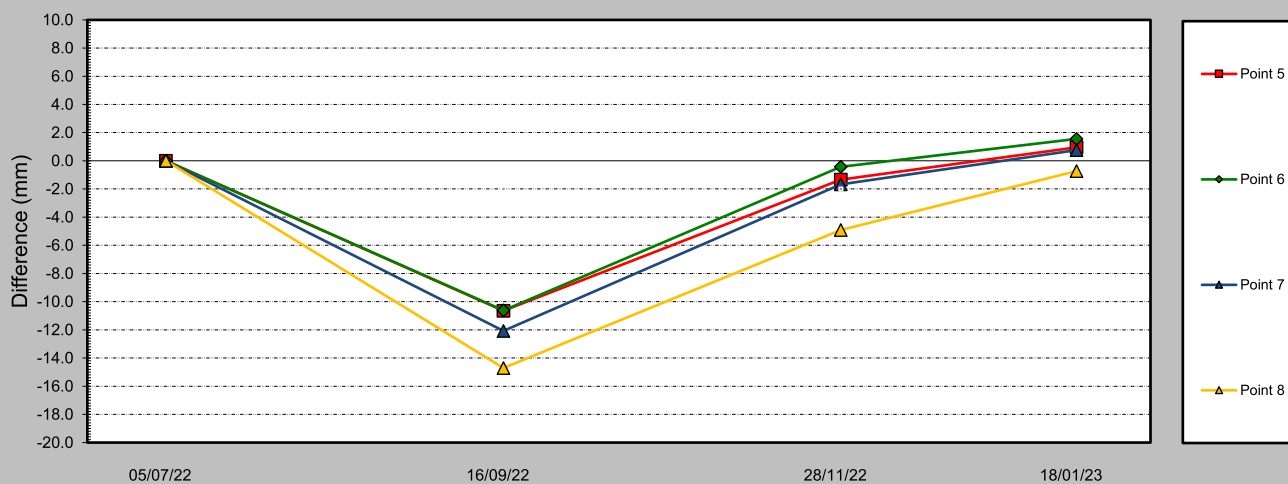

3

