



ARBORICULTURAL SURVEY

**Knowe Top Farm
Broadford Bridge Road
West Chiltington
West Sussex**

Document date: 25th June 2026

Document ref: PJC/7212/26-01 Rev -

PJC Consultancy Ltd
www.pjcconsultancy.com
contact@pjcconsultancy.com
01233 225365 - 01323 832120

The Watermill, The Mill Business Park,
Maidstone Road, Ashford, Kent.
TN26 1AE.

This report has been prepared by
PJC Consultancy Ltd
on behalf of
ECE Planning

Document author


Nick Betts HND For M.Arbor.A

Nick has attained an HND in forestry management and is a professional member of the Arboricultural Association. He has worked in the arboricultural and forestry industries for 26 years. He started his career as a forestry worker before qualifying as a tree surgeon, working in both the private and commercial sectors. He has been a practising consultant since 2004. He is a LANTRA accredited professional tree inspector.

Checked by

Peter Davies FdSc Arboriculture M.Arbor.A

Peter has a Foundation Degree in Arboriculture from the University of Brighton and is a professional member of the Arboricultural Association. He has over 15 years' experience in the arboricultural industry, originally working as a groundsman and feller, and progressing into consultancy. He is a LANTRA accredited professional tree inspector.

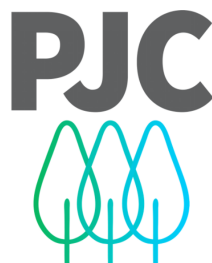

arboriculture . ecology . landscape



CONTENTS

1	INTRODUCTION	4
1.1	Instruction	4
1.2	Survey objectives	4
1.3	Contents of report	4
1.4	Documents and information provided.....	4
2	SURVEY METHODOLOGY	5
2.1	Tree survey information.....	5
2.2	Tree categorisation	5
2.3	Root protection areas	6
2.4	Limitations of survey.....	7
3	SITE VISIT AND SURVEY FINDINGS.....	8
3.1	Site visit.....	8
3.2	Site layout.....	8
3.3	Statutory tree protection.....	8
3.4	Findings.....	8
	Appendix 1: Tree Constraints Plan	9
	Appendix 2: Tree Survey Schedule	10
	Appendix 3: Cascade Chart for Tree Quality Assessment	11



1 INTRODUCTION

1.1 Instruction

- 1.1.1 PJC Consultancy has been instructed by ECE Planning to provide an initial arboricultural survey of Knowe Top Farm, Broadford Bridge Road, West Chiltington, West Sussex. The survey is to be undertaken in accordance with BS5837: 2012 'Trees in relation to design, demolition and construction – Recommendations'.

1.2 Survey objectives

- 1.2.1 This survey has been undertaken with the following objectives:
- To survey all trees within and adjacent to the site with trunk diameters of 75mm or more at a height of 1.5m.
 - To assess the quality and value of the existing tree stock in terms of arboricultural, landscape, historical/conservation, or public amenity value.
 - To provide information relating to planning constraints that may restrict works to trees at the site.
 - To provide an assessment of the material constraints posed by the existing tree stock on potential future developments at the site.
 - To aid the design process, ensuring prospective developments integrate appropriately with the existing tree stock, to maximise the potential of the proposed development site.

1.3 Contents of report

- 1.3.1 This report includes the following:
- A summary of the existing tree stock and notable arboricultural features.
 - Tree constraints plan in accordance with BS5837: 2012.
 - Tree survey schedule containing the relevant measurements and information for each tree or tree group as required in BS5837: 2012.

1.4 Documents and information provided

- 1.4.1 The following documents were used to aid the preparation of this report:
- Topographical Survey ref: HB Surveys Ltd 26029-02-T-E



2 SURVEY METHODOLOGY

2.1 Tree survey information

2.1.1 The following information was recorded in the tree survey schedule for each individual tree (average dimensions are recorded for groups):

- Tree reference number. (T=tree, G=group, H=hedgerow, W=woodland block).
- Species (common and scientific name).
- Overall tree height (m).
- Stem diameter (mm) per stem or average diameter for multi-stemmed trees with six or more stems.
- Branch spread (m) measured to the four cardinal points.
- Existing height (m) above ground level of lowest significant branch and direction of growth (for individual trees only).
- Existing height (m) above ground level of canopy.
- Age class (young, semi mature, early mature, mature, over mature or veteran).
- Physiological condition (good, fair, poor).
- Structural condition (good, fair, poor).
- Comments (general description of tree(s) including any notable features).
- Preliminary management recommendations (prescriptions for tree management processes based on the current land use and not related to the prospective development).
- Tree categorisation (see below).
- Root protection area (m²).
- Root protection radius (m).

2.2 Tree categorisation

2.2.1 The condition and value of each tree was evaluated based on the current land use. Each tree or tree group has been awarded either category A, B, C or U and a subcategory of either 1,2 or 3 or a combination of the subcategories.

2.2.2 Tree categorisation summary:

- A – Trees of good condition and high arboricultural, landscape or conservation value. Must have a potential life span in excess of forty years.
- B – Trees of moderate condition, with minor defects or sub-optimal form but are still of modest arboricultural, landscape or conservation value. Must have a potential life span in excess of twenty years.
- C – Unremarkable trees of poor condition or form with limited arboricultural, landscape or conservation value, or trees with a stem diameter under 150mm. Must have a potential life span in excess of ten years.
- U – Trees of such impaired condition that they cannot realistically be retained as living trees in the context of the current land use for more than ten years. These trees do not need to be removed if they are not dangerous and do not conflict with the proposed development, but should not be considered a constraint to development.



2.2.3 Tree sub categorisation summary:

- 1 – Trees have mainly arboricultural value, e.g. trees of good condition, form and vitality or rare tree species.
- 2 – Trees have mainly landscape value, e.g. trees of landscape prominence, that serve to screen unsightly views or that are required for privacy. Also trees present in groups that attain higher collective rating than they would as individuals.
- 3 – Trees with mainly cultural value including conservation, e.g. commemorative trees, trees of historical significance or veteran trees.

2.2.4 Each tree can only be categorised as A, B or C but may comply with more than one subcategory. A cascade chart further explaining how tree categorisation is decided is included in Appendix 3.

2.3 Root protection areas

2.3.1 A root protection area represents a calculation of the minimum volume of rooting medium required to support a tree. It is a standardised calculation based on the stem diameter(s) measured at 1.5m and is not necessarily representative of the actual root spread or total rooting area of a tree. The formulas used to calculate root protection areas are shown below:

Table 1: Root protection area formulas

Number of stems	Root protection area formula
Single stemmed trees	$\frac{(\text{stem diameter (mm)} \times 12)^2 \times \pi}{1000}$
Trees with two to five stems	$\sqrt{(\text{stem diameter } 1)^2 + (\text{stem diameter } 2)^2 \dots + (\text{stem diameter } 5)^2}$
Trees with more than five stems	$\sqrt{(\text{mean stem diameter})^2 \times \text{number of stems}}$

2.3.2 The root protection areas are plotted onto the tree constraints plan in Appendix 1 and are recorded in the tree survey schedule in Appendix 2. These are represented as a circle on the plan (unless significant rooting constraints are present), and are colour coded depending on the category the tree has been awarded. Where existing site conditions/features are present that are deemed likely to have affected the root morphology, the root protection areas have been represented as a polygon of equivalent area.

2.3.3 The proposed layout should avoid level changes or the placement of new buildings and areas of hard standing within the root protection areas of retained trees. In certain situations, engineered solutions are available to allow construction within the root protection areas however further input from an arboriculturist should be sought regarding their site-specific viability before these methods are relied upon.

2.3.4 The disturbance of a tree's root system can result in crown dieback and even death of the tree. Roots are used to support the tree structurally as well as the absorption of moisture and nutrients from the soil. They also act as storage and transport for water and nutrients.

2.3.5 Direct damage such as root severance can lead to ill health, as can compaction of the soil by construction traffic, heavy plant and storage of materials. Changing the nature of the surface above the growing medium, (i.e. from porous to non-porous), can alter the resources available to the tree, which in turn can lead to its decline.



2.3.6 The majority of root growth is usually found within the top 600mm of soil. As such, even a shallow disturbance within a root protection area can potentially have a significant impact on the tree.

2.3.7 The root protection areas must be left free from excavation and disturbance and protected from compaction or contamination during any proposed works. Any construction works within a root protection area required for the proposed development must be justifiable within an arboricultural impact assessment.

2.4 Limitations of survey

2.4.1 The survey methodology was restricted to a visual tree assessment from ground level. No tree climbing or invasive ground investigation was carried out for this report. Where existing site constraints are present such as ivy covered trees, a very dense under-storey, or where trees are located on third party land to which access was not granted, tree dimensions were estimated by eye as accurately as possible.

2.4.2 This survey represents a preliminary overview of the condition and value of trees at the site. It is not a detailed assessment of any individual tree and although preliminary management recommendations are included, this report will not be sufficient to be used as a detailed condition and safety survey.

2.4.3 The information and measurements in this report are representative of the date of the site visit. The tree survey data will need to be updated to reflect tree growth and changes in the condition of the trees after prolonged periods.



3 SITE VISIT AND SURVEY FINDINGS

3.1 Site visit

- 3.1.1 A site visit was carried out on 11th June 2026. The weather conditions at the time were overcast and raining. The visibility was adequate for visual tree inspection from ground level. Deciduous trees were in leaf.

3.2 Site layout

- 3.2.1 The site is located on the east side of Broadford Bridge Road, to the north of the settlement of West Chiltington. The site consists of a field planted with grape vines, with residential buildings to the south, as well as buildings used for the production of wine. The site is surrounded on all aspects by vineyards.

3.3 Statutory tree protection

- 3.3.1 Horsham District Council's online mapping tool was used on the date of this report to check whether there are any tree preservation orders (TPOs) within the site. No TPOs were shown within or immediately adjacent to the site.
- 3.3.2 However, the online mapping tool can be updated at any time, therefore any persons proposing to undertake tree works should still check the status of the trees with the local planning authority prior to undertaking any tree works. Failure to adhere to the TPO legislation could lead to prosecution and if convicted a fine and criminal record. The crown of a tree and its roots are protected. The person carrying out the works, the person instructing the works and the Directors of that company are potentially liable. Failure to check whether tree/s are the subject of TPO/s could not be used as mitigation.
- 3.3.3 The site is not in a Conservation Area.

3.4 Findings


- 3.4.1 A total of 11 trees, 2 tree groups and 2 hedgerows were surveyed. Their locations are shown on the tree constraints plan at Appendix 1 and details and measurements are shown in the tree survey schedule at Appendix 2.
- 3.4.2 A summary of their British Standard categorisation is shown at Table 2 below.

Table 2: Tree categorisation summary

Tree category	Individual tree	Tree group	Hedgerow
A	-	-	-
B	9	2	2
C	2	-	-
U	-	-	-
Total	11	2	2



Appendix 1: Tree Constraints Plan

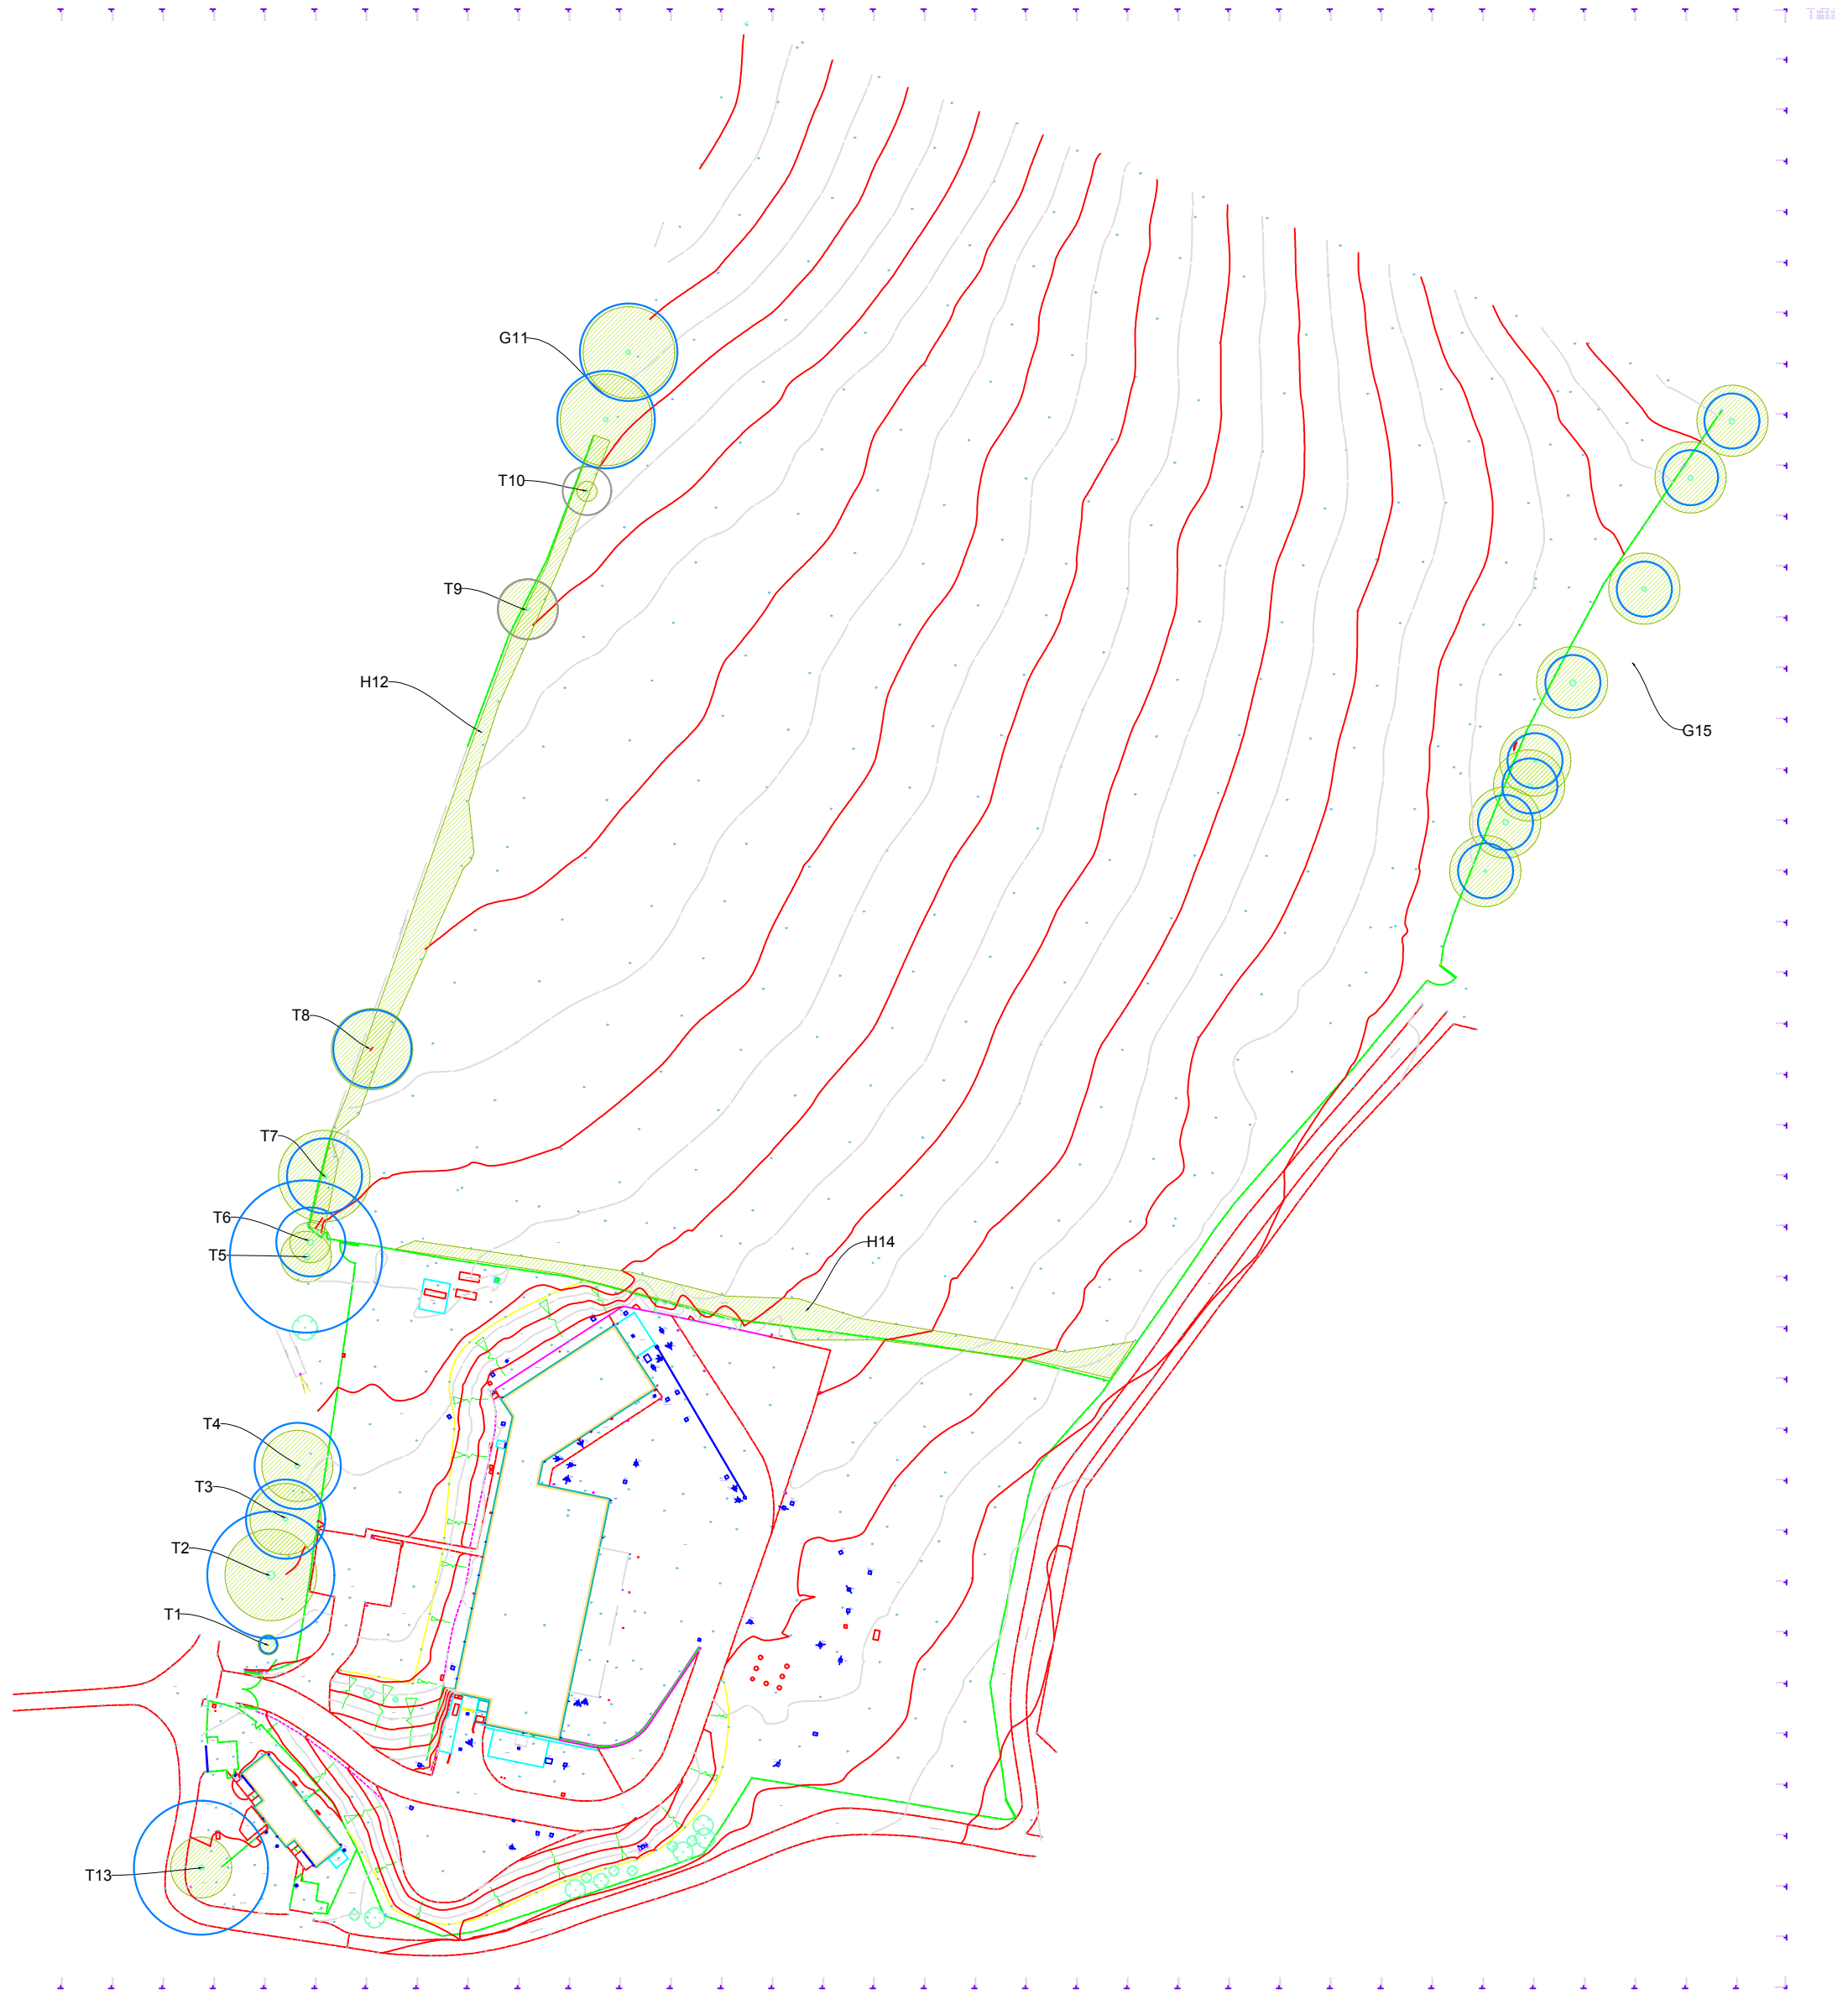


* Tree categorised in accordance with BS 5837:2012 'Trees in relation to design, demolition and construction - Recommendations'.

Tree survey schedule contains further information for each tree.

This drawing should be viewed in colour.

Tree numbers suffixed with PA indicate the tree position is approximate.

- Key:**
- Root protection area for category A* tree
 - Root protection area for category B* tree
 - Root protection area for category C* tree
 - Root protection area for category U* tree
 - Tree canopy



Drawing no: PJC/7212/26/A Rev: - Sheet number: 1 of 1

Client and site:
ECE Planning

Knowe Top Farm
West Chilmington
West Sussex

Drawing title: Tree Constraints Plan


Date drawn: 25/06/2026

Scale: 1:1250 at A3

Drawn by: NB

Checked by: PD

PJC

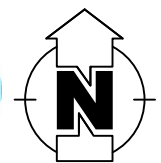

PJC Consultancy
The Watermill, The Mill Business
Park, Maidstone Road, Ashford,
Kent, TN26 1AE.

t: 01233 225365
e: contact@pjconsultancy.com
w: www.pjconsultancy.com



Appendix 2: Tree Survey Schedule

Site: Knowe Top Farm, West Chiltington, W. Sussex

Survey date: 11th June 2026

Surveyor: Nick Betts

Tree Survey Schedule



Tree ref.	Species	Height (m)	Stem diameter (mm)	Branch spread (m)	Crown clearance (m)	Age class	Physiological condition	Structural condition	Comments	Preliminary management recommendation	Category grading	Root Protection Area (m ²)	Root Protection Radius (m)
T1	Ash, (<i>Fraxinus excelsior</i>)	6	141	N: 2 E: 2 S: 2 W: 2	Crown: 2 Branch: 2	Semi mature	Fair	Good	No major visible defects	No action required at date of survey	B1	9.0	1.7
T2	Pedunculate oak, (<i>Quercus robur</i>)	16	1039	N: 9 E: 9 S: 9 W: 9	Crown: 5 Branch: 5	Mature	Good	Good	No major visible defects	No action required at date of survey	B2	488.4	12.5
T3	Pedunculate oak, (<i>Quercus robur</i>)	15	650	N: 7 E: 7 S: 7 W: 7	Crown: 5 Branch: 5	Mature	Good	Good	No major visible defects	No action required at date of survey	B2	191.2	7.8
T4	Pedunculate oak, (<i>Quercus robur</i>)	16	710	N: 7 E: 7 S: 7 W: 7	Crown: 6 Branch: 6	Mature	Good	Good	No major visible defects	No action required at date of survey	B2	228.1	8.5
T5	Pedunculate oak, (<i>Quercus robur</i>)	16	1600	N: 6 E: 6 S: 6 W: 6	Crown: 5 Branch: 5	Mature	Good	Good	No major visible defects	No action required at date of survey	B2	707.0	15.0
T6	Pedunculate oak, (<i>Quercus robur</i>)	16	565	N: 4 E: 4 S: 4 W: 4	Crown: 6 Branch: 6	Mature	Good	Good	No major visible defects	No action required at date of survey	B2	144.4	6.8

Site: Knowe Top Farm, West Chiltington, W. Sussex

Survey date: 11th June 2026

Surveyor: Nick Betts

Tree Survey Schedule



Tree ref.	Species	Height (m)	Stem diameter (mm)	Branch spread (m)	Crown clearance (m)	Age class	Physiological condition	Structural condition	Comments	Preliminary management recommendation	Category grading	Root Protection Area (m ²)	Root Protection Radius (m)
T7	Pedunculate oak, (Quercus robur)	16	620	N: 9 E: 9 S: 9 W: 9	Crown: 6 Branch: 6	Mature	Good	Good	No major visible defects	No action required at date of survey	B2	173.9	7.4
T8	Pedunculate oak, (Quercus robur)	15	640	N: 8 E: 8 S: 8 W: 8	Crown: 5 Branch: 5	Mature	Good	Good	No major visible defects	No action required at date of survey	B2	185.3	7.7
T9	Field maple, (Acer campestre)	9	489	N: 6 E: 6 S: 6 W: 6	Crown: 3 Branch: 3	Mature	Fair	Fair	No major visible defects	No action required at date of survey	C2	108.2	5.9
T10	Field maple, (Acer campestre)	6	400	N: 2 E: 2 S: 2 W: 2	Crown: 3 Branch: 3	Mature	Fair	Fair	No major visible defects	No action required at date of survey	C2	72.4	4.8
G11	Pedunculate oak, (Quercus robur)	18-20	800	N: 9 E: 9 S: 9 W: 9	Crown: 6 Branch: 6	Mature	Good	Good	No major visible defects	No action required at date of survey	B2	289.6	9.6
H12	Hawthorn, (Crataegus monogyna) Blackthorn, (Prunus spinosa)	2-3	200	N: 2 E: 2 S: 2 W: 2	Crown: 0 Branch: 0	Mature	Fair	Fair	No major visible defects	No action required at date of survey	B2	18.1	2.4

Site: Knowe Top Farm, West Chiltington, W. Sussex

Survey date: 11th June 2026

Surveyor: Nick Betts

Tree Survey Schedule



Tree ref.	Species	Height (m)	Stem diameter (mm)	Branch spread (m)	Crown clearance (m)	Age class	Physiological condition	Structural condition	Comments	Preliminary management recommendation	Category grading	Root Protection Area (m ²)	Root Protection Radius (m)
T13	Pedunculate oak, (Quercus robur)	15	1100	N: 6 E: 6 S: 6 W: 6	Crown: 4 Branch: 4	Mature	Good	Good	No major visible defects	No action required at date of survey	B2	547.5	13.2
H14	Hawthorn, (Crataegus monogyna) Blackthorn, (Prunus spinosa)	3-6	200	N: 2 E: 2 S: 2 W: 2	Crown: 0 Branch: 0	Mature	Fair	Fair	No major visible defects	No action required at date of survey	B2	18.1	2.4
G15	Pedunculate oak, (Quercus robur)	6-18	450	N: 7 E: 7 S: 7 W: 7	Crown: 5 Branch: 5	Mature	Good	Good	No major visible defects	No action required at date of survey	B2	91.6	5.4

Appendix 3: Cascade Chart for Tree Quality Assessment

Category and definition	Criteria (including subcategories where appropriate)			Identification on plan
Trees unsuitable for retention				
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of their current land use for longer than 10 years.	• Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after the removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning). • Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline. • Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality. Note Category U trees can have existing or potential conservation value which it might be desirable to preserve.			Red
	1 Mainly arboricultural qualities	2 Mainly landscape qualities	3 Mainly cultural values, including conservation	
Trees to be considered for retention				
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years.	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue).	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features.	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood--pasture).	Green
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years.	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remedial defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation.	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality.	Trees with material conservation or other cultural value.	Blue
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm.	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories.	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits.	Trees with no material conservation or other cultural value.	Grey



CONTACT DETAILS

Kent Office:

The Watermill
The Mill Business Park
Maidstone Road
Ashford
Kent
TN26 1AE

Tel: 01323 832120

Tel: 01233 225365

Author: Nick Betts

Date: 25th June 2026

E-mail: nick@pjconsultancy.com