



May 2026  
CBA10637 v3B

Thakeham Concrete  
Products Limited

# ARBORICULTURAL IMPLICATIONS ASSESSMENT

Site:  
Rock Road  
Storrington  
West Sussex  
RH20 3AD



Chesil House, Arrow Close  
Boyatt Wood, Hampshire, SO50 4SY  
Tel: 023 8098 6229 Email: [info@cbatrees.co.uk](mailto:info@cbatrees.co.uk)  
[www: cbatrees.co.uk](http://www.cbatrees.co.uk)  
*The Complete Arboricultural Consultancy*



## ARBORICULTURAL IMPLICATIONS ASSESSMENT

|                            |                                                              |
|----------------------------|--------------------------------------------------------------|
| Client:                    | Thakeham Concrete Products Limited                           |
| Site:                      | Rock Road, Storrington, West Sussex, RH20 3AD                |
| Arboricultural Consultant: | Stefan Rose <i>BSc (Hons), Tech Cert ArborA, TechArbor.A</i> |
| Date:                      | May 2026                                                     |

### 1.0 INTRODUCTION

- 1.1 This Arboricultural Implications Assessment (AIA) is for the outline planning application for land at Rock Road, Storrington, West Sussex, RH20 3AD. The site has benefitted from previous planning permission (DC/18/2095) for a very similar form of development in 2020, the notable changes are across the frontage of the site which is an additional area when compared to the previously approved scheme which primarily did not materialise to full planning due to the impact and complexities of the Covid-19 lockdown.
- 1.2 This is an assessment of the Arboricultural Implications that the current proposal will have on the site and the existing tree stock based on drawings provided by the client:
- 32301
  - THAK230417 IMP 04 D
  - LLD3475-LAN-REP-010-04-Landscape Design Strategy
  - LLD3475-LAN-DWG-010-04-Landscape Masterplan
- 1.3 The above topographical plan has been the basis of the tree survey and tree survey plan which has then been overlaid with the proposed plans to produce an Indicative Tree Retention, Removal and Tree Protection Plan (CBA10637.02A TRR&TPP).
- 1.4 This AIA will highlight areas of conflict of the proposed development with existing trees, groups or hedges and indicate which can be retained, that will need to be removed (where necessary) and ways to mitigate the impact on existing trees to acceptable levels so not to be detrimental on their long-term health.
- 1.5 **Note:** Any mitigating build techniques for working methodologies etc. that are detailed within this assessment must be agreed upon/accepted to ensure that

post planning approval, trees can be retained and protected during site works. Any noncompliance of the advised mitigation and protection measures is likely to lead to the loss of trees.

## **2.0 SCOPE AND PURPOSE OF REPORT**

- 2.1 This AIA considers the implications of the outline planning application development of land at Rock Road, Storrington, West Sussex, RH20 3AD. It considers any mitigation measures relating to trees and their impact upon the existing tree stock, and also provides solutions to any implications where possible, to ensure the safe and healthy retention of any trees which are considered to be worthy of retention should the proposals be put forward for planning permission.
- 2.2 This AIA only considers the implications of the works which are illustrated on the drawings detailed above. If any changes to the proposed layout occur, then further advice should be sought.

## **3.0 DEFINITION OF ROOT PROTECTION AREA (RPA)**

- 3.1 The RPA of a tree is defined in BS5837:2012 as a “*layout design tool indicating the minimum area around a tree deemed to contain sufficient roots and rooting volume to maintain the tree’s viability, and where the protection of the roots and soil structure is treated as a priority*”. This is calculated as an area based on the stem diameter of the tree. It is usually considered to be a circular shape centred on the trunk of the tree, unless an arboriculturist considers site factors may have affected this.
- 3.2 For this site, the trees, groups and hedges are all effectively open grown, so root protection areas remain unmodified from the polygon circular shape.

## **4.0 TREE PRESERVATION ORDER STATUS**

- 4.1 Some of the trees are protected by a Tree Preservation Order with reference:  
  
Land Between Patuca & Thakeham Tile Works, Rock Road, Thakeham (TPO/0820, served in 1985, this is an Area Order): Includes Trees 1 to 20, W2A containing W2.1 to W2.11 and W2B containing W2.12 to W2.40.  
  
Thakeham Tiles Rock Road, Storrington TPO/1298 (served in 2005) this is a Woodland Order): Includes W1 and possibly Trees 43-45.

## **5.0 TREE ASSESSMENT**

- 5.1 CBA Trees undertook a tree survey in accordance with BS5837:2012 on 4<sup>th</sup>, 6<sup>th</sup> and 17<sup>th</sup> March 2025. The tree survey exercise identified 84 (eighty four) individual trees, 14 (fourteen) groups of trees containing 5 (five) noted trees, 2 (two) hedges and 3 (three) woodland containing 108 (one hundred and eight)

noted on or adjacent to the site; the Tree Survey Schedule and Tree Survey Plan (CBA10637.01A TSP) are appended at CB1.

## 5.2 *Tree Categorisation Method*

**Category U =** Trees in such a condition that any value would be lost within 10 years or should be removed for reasons of sound arboricultural management.

- **Individual Trees:** 24, 60, 64, 74 and 79
- **Noted Trees in Woodlands:** W1.11, W2.18, W3.1, W3.3, W3.9 and W3.20

*NOTE: "Category U trees are those in such a condition they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years."*

**Category A =** Trees of high quality and value: in such a condition as to make a substantial contribution, (40 years or more is recommended).

- **Individual Trees:** 2, 22 and 56
- **Noted Trees in Woodlands:** W2.13, W2.15, W2.16, W2.23, W3.5, W3.13, W3.15 and W3.17

**Category B =** Trees of moderate quality and value, capable of making a significant contribution for more than 20 years.

- **Individual Trees:** 1, 4, 5, 6, 8, 10, 12, 14, 17, 20, 23, 26, 27, 29, 32, 35, 36, 37, 40, 41, 42, 43, 44, 48, 52, 57, 59, 67, 70, 78, 83
- **Group:** Grp 5
- **Noted Trees in Groups:** G5.2 and G5.5
- **Woodland:** W1
- **Noted Trees in Woodlands:** W1.44, W2.2, W2.4, W2.5, W2.6, W2.8, W2.9, W2.10, W2.11, W2.12, W2.14, W2.20, W2.21, W2.24, W2.25, W2.26, W2.27, W2.29, W2.31, W2.32, W2.33, W2.34, W2.35, W2.37, W2.38 and W2.40

**Category C =** Trees of low quality and value which might remain for a minimum of 10 years or young trees with stems of less than 150mm diameter.

- **Individual Trees:** 3, 7, 9, 11, 13, 15, 16, 18, 19, 21, 25, 28, 30, 31, 33, 34, 38, 39, 45, 46, 47, 49, 50, 51, 53, 54, 55, 58, 61, 62, 63, 65, 66, 68, 69, 71, 72, 73, 75, 76, 77, 80, 81, 82 and 84
- **Groups:** Grp 1, Grp 2, Grp 3, Grp 4, Grp 6, Grp 7, Grp 8, Grp 9, Grp 10, Grp 11, Grp 12, Grp 13 and Grp 14

- **Noted Trees in Groups:** G5.1, G5.3 and G5.4
- **Woodland:** W2 and W3
- **Noted Trees in Woodlands:** W1.1-W1.10, W1.12-W1.43, W2.1, W2.3, W2.17, W2.19, W2.22, W2.28, W2.30, W2.36, W3.2, W3.4, W3.6, W3.18 and W3.24
- **Hedges:** H1 and H2

*NOTE: "Trees under these categories are trees that should be a material consideration in the development process; the subcategories are intended to reflect arboricultural, landscape and cultural values respectively."*

- 5.3 For more details of the existing tree stock, refer to the Tree Survey Schedule (appended at CB1).

## 6.0 SOIL ASSESSMENT

- 6.1 The British Geological Map as referenced at [www.bgs.ac.uk](http://www.bgs.ac.uk) reveals that this property is located on the boundary of two classifications. The 1:50 000 scale bedrock geology descriptions are Fittleworth Member (Sandstone And Mudstone) to the north of the site and the southern end lies over Folkestone Formation (Sandstone).

*"The base of the formation is the contact of sand or sandstone of the formation with underlying silty clay or clayey silt of the Marehill Clay Member (Sandgate Formation) or with a heterogeneous succession of clays, silts and sands (Sandgate Formation, undifferentiated). This boundary can be diffuse in places" (British Geological Society, 2017).*

- 6.2 Although this appears to be primarily sedimentary rock there is some mention of the possibility of clay and silts at deeper levels within this formation.
- 6.3 It is advised that a separate soil analysis should be made to identify the presence of soils prone to volume change due to water content to inform the foundation design as part of a detailed planning application.

## 7.0 ARBORICULTURAL IMPLICATIONS ASSESSMENT

- 7.1 The following summary of implications relates to trees which will require mitigation measures or protection measures to allow for construction operations to be carried out on site to minimise the impact on trees, groups and hedges to be retained. The below assessment is based on the information that has been provided as part of an Outline application, and therefore precise layout, orientation of dwellings site levels etc. are not fully set at this stage. Therefore there is scope at Reserved Matters stage to ensure the site is designed (either through the layout itself or through engineering solutions) appropriately with regard to level changes across the site and the potential impact on the retained trees that this may have to ensure that retained trees can be appropriately retained.

- 7.2 As part of the assessment, dimensions have been scaled from the proposed drawing, reference THAK230417 IMP 04 D provided by Thrive Architects, modified to include the relevant tree survey data.
- 7.3 Five individual trees (24, 60, 64, 74 and 79) and six noted trees in some of the woodlands (W1.11, W2.18, W3.1, W3.3, W3.9 and W3.20) are considered to have a short useful life expectancy and would ordinarily be removed from a site or made safe for ecological habitat as part of good tree management regardless of any development proposals. These trees are therefore not considered to be a constraint for development planning purposes.
- 7.3.1 Of these trees, the proposal will seek to retain W3.1, W3.3, W3.9 and W3.20 once they have been reduced to a standing pole for ecological habitat.
- 7.4 Trees removed as a direct result of the proposed development:
- A grade – no individual trees, groups, hedges or woodlands
  - Six B grade individual trees - 48, 52, 57, 59, 78
  - 11 C grade individual trees - 46, 47, 51, 53, 54, 58, 65, 66, 80, 81, 82
  - 6 groups of trees (C grade) - Grp 6, Grp 7, Grp 10, Grp 11, Grp 13, Grp 14
  - One C grade hedge - H2
- 7.5 Groups removed in part as a direct result of the proposed development:
- Part of two C grade groups - Grp 8 and Grp 12
  - Part of Woodland W1 (B grade) including 43 C grade noted trees - W1.1-W1.10 and W1.12-W1.44
  - Part of Woodland W2B (C grade), northwest section removed mostly of Laurel but also one Birch plus six noted trees W2.28, W2.31, W2.32, W2.33, W2.34, W2.3
  - Part of Woodland 3 (grade C)
- 7.6 Individual Trees 1-4, 7, 8-23, 25-35, 37, 40, 41, 43, 44, 45, 67-73, 75, 77, 83 and 84; Groups 1-5, Group 9, retained parts of Group 8 and 12; retained section of W1, W2A, W2B and noted trees W3.2 and W3.4 are in close proximity to the existing structures, machinery and/or hard standing. They will require specific protection during the demolition phase or construction phase for the removal of the hard surfacing within the development phase to avoid damage to these trees, groups and woodlands proposed for retention.
- 7.7 General site caused damage to trees can come from a lack of onsite awareness and the need to protect not just the physical tree but also the area where the trees grow i.e. the roots in the ground and the environment where the trees grow.
- 7.8 Damage to the trees may be in the form of direct damage where roots are cut, ripped, snapped or shattered for ground works such as drainage, services or

foundations or alternatively where the trunks/branches are struck by plant machine movements or snapped by contractors where branches are in close proximity to the build.

- 7.9 Trees can also be damaged through indirect causes such as through compaction of the soft ground from the moving of plant machinery or the storage of materials as well as through phototoxic damage from mixing of materials damaging and compromising the tree's roots and rooting environment. This is easily avoided by establishing and maintaining tree protection measures at the start of site enabling works until completion of the project.
- 7.10 CBA Trees has not been provided with the proposed site levels of the site which could have a significant impact on the proposed retained trees, groups, hedge and woodland trees given the various undulations and levels within and across the site. Any level changes will need to avoid root protection areas. As stated above, site level details will be submitted in support of a future Reserved Matters application to demonstrate that the proposed development results in no adverse effects on the trees to be retained.
- 7.11 Drainage has been designed and located to avoid and minimise impact on root protection areas of trees, group, hedges and woodlands proposed for retention. Where potential conflicts do exist (Trees 63 and 84 and W3, W3.12 and W3.13), they will require specific protection during the demolition phase or construction phase for the removal of the hard surfacing within the development phase to avoid damage to these trees, groups and woodlands proposed for retention.
- 7.12 Once the demolition and removal of the existing built form and hard standing areas have been carried out, the tree protection measures for the construction phases of the site will need to be adjusted and/or amended.
- 7.13 Items such as contractor compound, parking and welfare offices, storage of materials, mixing of concrete/mortar will all need to be considered prior to any commencement of works on site so that any potential damage to trees from these are removed or reduced. Tree protection measures will need to inform the Construction Management Plan of the site.
- 7.14 Construction techniques will also be proposed to minimise the extent of ground disturbance and impact on trees beyond the footprint of built form and residential gardens.

## **8.0 PRE-DEVELOPMENT TREE WORKS**

- 8.1 All tree works will be undertaken prior to the commencement of site preparation and construction works.
- 8.2 **All permitted or approved tree work** should be carried out in accordance with the British Standard "*Recommendations for Tree Work*" BS3998:2010, by suitably qualified and experienced professional arborists. Under no

circumstances shall site personnel undertake any tree pruning operations. All tree surgery works should be carried out prior to the development of the site, and erection of protective barriers.

- 8.3 If any works are required to retained trees protected by a TPO prior to full planning permission being granted that details tree works, written approval must be obtained in advance from Horsham District Council.
- 8.4 Consideration should be given to the timing of the proposed tree works to avoid the active growing period of trees. Therefore, all tree work should ideally be carried out during the dormant period from November through to February and then again from June to August.
- 8.5 Due to the official bird nesting season considered to be from 1<sup>st</sup> March through to the 31<sup>st</sup> July (Natural England) depending on weather conditions, consideration must also be given to the potential for nesting birds. Therefore, if tree work is to be carried out within these months the project ecologist must be consulted to:
- Complete or advise on a pre-works survey which needs to be carried out by a suitably competent person. As a general rule, it should be assumed that birds will be nesting in trees, and it is down to contactors to assess, record and confirm that any works carried out in the management of trees and other vegetation has not disturbed actively nesting birds\*.
  - Ground vegetation, and therefore ground nesting birds, can often be overlooked by tree workers so additional care and controls should be taken when access and egress to the work site may also cause disturbance or damage to a nesting site. This is also true for retained trees on site as the removal of adjacent trees or remedial works on a tree may lead to an established nest being abandoned, exposed to the elements or predation. This action is also a breach of the Act and therefore could lead to prosecution due to the infringement of the Wildlife and Countryside Act 1981 and breaching the European Habitats Directive 1992/Nesting Birds Directive\*.
- 8.6 Although not apparent at the time of the site visit consideration should also be given to the presence of bats, and a full visual assessment should be undertaken before any works are carried out on the trees. Where bats are identified as a serious concern, a bat survey should be undertaken by qualified and trained personnel to identify the needs of the bats (roosts, resting place etc.) and no tree works can be carried out until the 'all clear' is given, or a programme of recommendations is received in writing.
- 8.7 Should additional tree works become apparent during the construction process; written consent will be required from Horsham District Council prior to these additional works being undertaken.

- 8.8 Trees to be removed to facilitate the development are detailed within the Tree Works Schedule appended at CB3.

## **9.0 SERVICES**


- 9.1 CBA Trees has been provided with the drainage proposals but have not been provided with other service location plans to establish if these will implicate the retained trees, groups, hedges and woodland trees for this outline planning application. This detail will be provided at full planning/reserved matters and designed to account for the retained trees.
- 9.2 Where new services and/or utilities are to be installed; these will be designed and located to be outside of retained rooting areas and allow for working space to install the route without impacting on trees, groups, hedges and woodland trees.

## **10.0 TREE PROTECTION MEASURES**

- 10.1 Once outline planning has been granted and the project moves towards a full planning application consent, details to discharge planning conditions as required will be provided. All site operations will be planned, implemented and supervised to prevent the following unless otherwise agreed in writing:
- Unplanned root severance
  - Damage to the bark, branches and trunks
  - Compaction of the soil within the Construction Exclusion Zone
  - Alterations in soil level
  - Soil contamination by phytotoxic materials such as herbicides, petrol, oils, diesel, cement and concrete washings or other construction additives
- 10.2 The principles of tree protection will follow:
- Before starting any site works in relation to this development proposal, tree protection will be installed in accordance with the Indicative Tree Retention, Removal and Tree Protection Plan (CBA10637.02A TRR&TPP appended at CB4). This will occur immediately following the completion of tree works and prior to any site preparation works starting. Phasing of site works may be programmed within the build programme and will enable tree protection to be set up and established for specific areas at a given time rather than have barriers up across areas that are not under construction. Barriers may be formed by existing fencing on site or purposely erected barriers that will need to be fit for purpose.
  - A copy of the Indicative Tree Retention, Removal and Tree Protection Plan (CBA10637.02 TRR&TPP) will be kept on site by the client. A specific copy will be kept in the site office of the appointed contractor as an immediate reference for all site operatives to review during working processes as required and to reference at the start of each phase or area of works.

- Given the nature of the existing site, it is recommended that the barrier will consist of a robust barrier where it (the barrier) is resistant to impact and requires a positive or considered movement/adjustment by contractors of the barrier to adjust its position.
- Installing the following protective barrier as indicated on Indicative Tree Retention, Removal and Tree Protection Plan (CBA10637.02 TRR&TPP) will protect the retained trees where new built form is proposed or where existing built for is to be removed.
- Where soft ground is present along the line of tree protection, the trees will be protected by installing the following protective fence as indicated on the Indicative Tree Retention, Removal and Tree Protection Plan (CBA10637.02A TRR&TPP appended at CB4). The barrier is to comprise of a vertical and horizontal framework, well braced to resist impacts, with vertical tubes spaced at a maximum interval of 3m. Onto this, weldmesh panels should be securely fixed with wire or scaffold clamps.

**Figure 1:** Protective Barrier

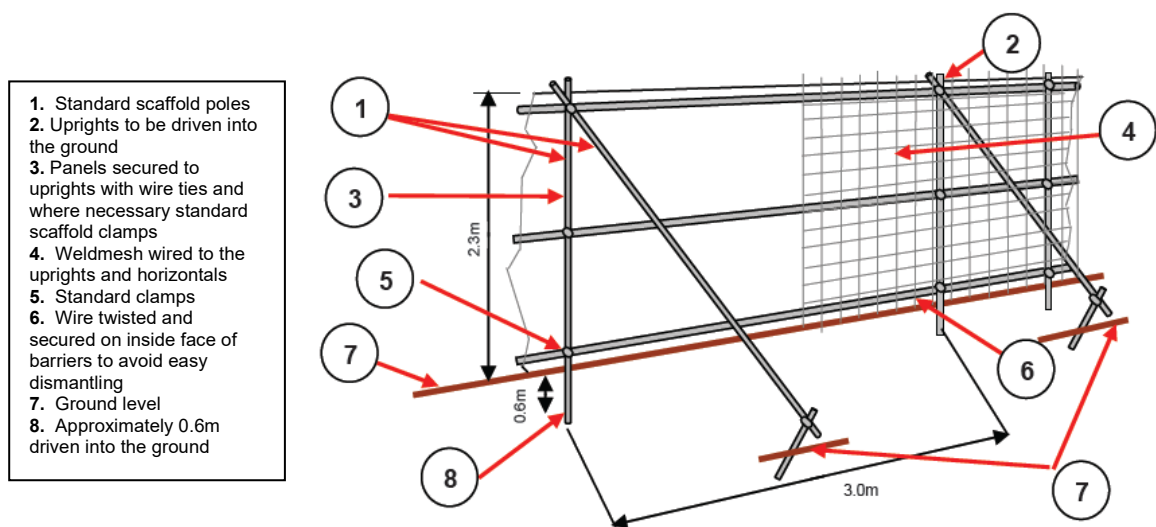

Example of protective barriers:



- 10.3 Tree protection measures will remain *in-situ* for the duration of the project. The areas protected by barriers will be regarded as **sacrosanct**, and the tree protective barriers shall not be taken down or relocated at any time without the prior written approval of the Tree Officer of Horsham District Council with the exception of the works to implement the swale works once this has been arboriculturally agreed.

## 11.0 PROPOSED MITIGATION

- 11.1 The application will seek to provide landscaping enhancements along with ecological enhancements, details of which are provided by the Landscape Architect Consultants. With the number of trees to be removed as part of the proposals, an allowance has been made for replacement planting that is suitable for the site in terms of soil type, planting location and the mature size of the proposed tree stock so that the trees have the opportunity to establish and grow to their full size without the continued need for pruning, to reduce or avoid the conflict between branches and built form.
- 11.2 The central area of the site, is largely by the nature of the current use of the site, devoid of trees and whilst it is acknowledged that trees would be removed, the proposed landscaping seeks to provide an improved soft landscaping setting across the site that will provide green links and improved ecology opportunities.
- 11.3 As part of this, woodland habitats will be enhanced to increase biodiversity and habitat opportunities.

## 12.0 CONCLUSION

- 12.1 The proposals for the outline planning application development of at Rock Road, Storrington, West Sussex, RH20 3AD have been assessed by a qualified and experienced arboricultural consultant in accordance with BS5837:2012 Trees in Relation to Design, Demolition and Construction – Recommendations.
- 12.2 The site benefitted from previous planning permission for a very similar form of development in 2020, the notable changes are across the frontage of the site when compared to the previously approved scheme which primarily did not materialise to full planning due to the Covid-19 lockdown.
- 12.3 In our opinion, the current development impacts are not dissimilar to the previous scheme and therefore should not be considered negatively this time round given the application is seeking the outline planning permission again.
- 12.4 Tree removals are as follows:
- 17 individual trees (of these six are considered to be B grade trees and 11 are considered to be C grade)
  - 6 groups of trees and 1 hedge (considered to be C grade)

- Sections of Group 8, W2B and W3 (considered to be C grade)
  - The inner side of W1 (considered to be B grade)
- 12.5 Five individual trees and six noted trees within the woodlands are considered to have a short useful life expectancy and would ordinarily be removed from a site or made safe for ecological habitat as part of good tree management regardless of any development proposals. These trees are therefore not considered to be a constraint for development planning purposes. The proposal will seek to retain four of these once they have been reduced to a standing pole for ecological habitat.
- 12.6 Soft landscaping and ecological enhancements will be provided as part of the proposal.
- 12.7 There is the opportunity for significant damage to occur to tree rooting systems, their rooting environments, trunks and branches of the retained trees, group and hedges if the precautions, tree protection, working principles and methodologies set out within this assessment are not adopted, adhered to by any appointed contractor and secured through planning conditions as part of detailed full planning application should outline planning permission be granted.
- 12.8 At reserved matters/full planning and planning conditions, should consent be granted, will provide the level of information that is required. The proposal is looking to re-establish the principle of planning is acceptable subject to detailed design.



## Appendices

|     |                                                                                     |
|-----|-------------------------------------------------------------------------------------|
| CB1 | Tree Survey Schedule and Tree Survey Plan CBA10637.01A TSP                          |
| CB2 | Root Protection Area Schedule                                                       |
| CB3 | Tree Works Schedule                                                                 |
| CB4 | Indicative Tree Retention, Removal and Tree Protection Plan<br>CBA10637.02A TRR&TPP |
| CB5 | Qualifications and Experience                                                       |





*The Professional Arboricultural Consultancy*

## TREE SURVEY NOTES

This Tree Survey has been undertaken within the recommendations of British Standards 5837:2012 and current arboricultural best practice.

- Each tree has been numbered and, where instructed, for future identification on site, has been tagged using small durable metal or plastic tags.
- Due to variations of existing ground levels through the site, height dimensions are estimated and are given in metres. Accurate heights, measured with the aid of optical instruments can be provided where instructed.
- Trunk/stem diameters are measured in mm at 1.5 metres above ground level, using a standard measuring tape as defined by British Standards, unless otherwise stated.
- Estimated branch spread is taken in metres from the centre of the trunk, at the four cardinal points of a compass, to achieve an accurate representation of the crown shape which will be recorded on the tree survey plan.

- An assessment of a tree's age classification is made in terms of its maturity within the site's landscape and defined as:

|           |          |                           |
|-----------|----------|---------------------------|
| <b>Y</b>  | <b>=</b> | <b>young trees</b>        |
| <b>SM</b> | <b>=</b> | <b>semi-mature trees</b>  |
| <b>EM</b> | <b>=</b> | <b>early mature trees</b> |
| <b>M</b>  | <b>=</b> | <b>mature trees</b>       |
| <b>OM</b> | <b>=</b> | <b>over-mature trees</b>  |

- An assessment of a tree's physiological condition is defined as:

|             |          |                                                                                                                                                                                                     |
|-------------|----------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Good</b> | <b>=</b> | <b>fully functioning biological system showing average vitality i.e. normal bud growth, leaf size, crown density and wound closure</b>                                                              |
| <b>Fair</b> | <b>=</b> | <b>fully functioning biological system showing below average vitality i.e. reduced bud growth, smaller leaf size, lower crown density and reduced wound closure</b>                                 |
| <b>Poor</b> | <b>=</b> | <b>a biological system with limited functionality showing significantly below average vitality i.e. limited bud growth, small and chlorotic leaves, low crown density and limited wound closure</b> |
| <b>Dead</b> | <b>=</b> | <b>dead</b>                                                                                                                                                                                         |

- An assessment of a tree's structural condition is defined as:

|             |          |                                                                                                           |
|-------------|----------|-----------------------------------------------------------------------------------------------------------|
| <b>Good</b> | <b>=</b> | <b>no significant structural defects</b>                                                                  |
| <b>Fair</b> | <b>=</b> | <b>structural defects which could be alleviated through remedial tree surgery or management practices</b> |
| <b>Poor</b> | <b>=</b> | <b>structural defects which cannot be alleviated through tree surgery or management practices</b>         |
| <b>Dead</b> | <b>=</b> | <b>dead</b>                                                                                               |

- An assessment of a tree's future life expectancy is defined as: **<10, 10+, 20+ or 40+ years.**

## Categorisation of Trees

The category for each tree is assessed using the recommendations of BS5837:2012. The assessment has not considered any site-specific development proposals, but will have considered any changes on or off-site which may have an effect on the conditions surrounding the surveyed trees.

The trees have been classified into one of the following categories (and one or more sub-categories [this will however not increase the value of the tree]) and are indicated on the associated drawings by colours as indicated.

| Category U                                                                                                                                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |                                                                                                                                                                                                                                                                   |                                                                                                                                        | Identification colour on plan |
|------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------|-------------------------------|
| Trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years | <ul style="list-style-type: none"> <li>Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning)</li> <li>Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline</li> <li>Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality</li> </ul> |                                                                                                                                                                                                                                                                   |                                                                                                                                        | <b>DARK RED</b>               |
| Category A                                                                                                                                           | 1 – Mainly arboricultural values                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | 2 – Mainly landscape values                                                                                                                                                                                                                                       | 3 – Mainly cultural values                                                                                                             | Identification colour on plan |
| <b>Trees of high quality</b> with an estimated remaining life expectancy of at least 40 years                                                        | Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)                                                                                                                                                                                                                                                                                                                                                                                               | Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features                                                                                                                                                            | Trees, groups or woodlands, of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture) | <b>LIGHT GREEN</b>            |
| Category B                                                                                                                                           | 1 – Mainly arboricultural values                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | 2 – Mainly landscape values                                                                                                                                                                                                                                       | 3 – Mainly cultural values                                                                                                             | Identification colour on plan |
| <b>Trees of moderate quality</b> with an estimated remaining life expectancy of at least 20 years                                                    | Trees that might be included in category A, but are down-graded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation                                                                                                                                                                                                                                                                     | Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality | Trees with material conservation value or other cultural value                                                                         | <b>MID BLUE</b>               |
| Category C                                                                                                                                           | 1 – Mainly arboricultural values                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | 2 – Mainly landscape values                                                                                                                                                                                                                                       | 3 – Mainly cultural values                                                                                                             | Identification colour on plan |
| <b>Trees of low quality</b> with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm        | Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits                                                              | Trees with no material conservation or other cultural value                                                                            | <b>GREY</b>                   |

Clients are advised that Tree Surveys are a basic data collection exercise and record of tree condition at the time of survey. This will identify any visible signs of ill-health or major defects, advising a further detailed investigation where appropriate. This will most often take the form of a request for either “*full ground level inspection*” or “*climbing inspection required*”. There may also be a further reference to the need for “*decay detection equipment*” to aid diagnosis. A tree survey does not include a comprehensive schedule or specification of remedial tree works, but may contain a guide to the work which might be undertaken by a prudent tree owner, purely for reasons of health and safety.

A Tree Survey should not be confused with a Tree Inspection or Arboricultural Implication Assessment, which are totally separate exercises.

|                                                                                   |                                         |                                                                |
|-----------------------------------------------------------------------------------|-----------------------------------------|----------------------------------------------------------------|
|  | <b>TREE SURVEY REPORT (BS5837:2012)</b> |                                                                |
|                                                                                   | <b>Site:</b>                            | Rock Road, Storrington, West Sussex, RH20 3AD                  |
|                                                                                   | <b>Date:</b>                            | 4th, 6th and 17th March 2025                                   |
|                                                                                   | <b>Consultant:</b>                      | Stefan Rose <i>BSc (Hons), TechCert (Arbor.A), TechArbor.A</i> |
|                                                                                   | <b>Tagged:</b>                          | No                                                             |

Notes:

1. It may be advised that some trees should have the ivy removed to enable a re-survey to be carried out. This would also alleviate the tree from becoming suppressed; carrying additional weight that increases the chance of windthrow due to a larger dense crown area; and only receiving restricted light. Unless otherwise stated, in order to prevent regrowth, it is only necessary to remove a 300mm section of ivy and clear around the base.
2. It may be advised that it was only possible to estimate the diameter of some trees because of ivy smothering, dense vegetation, or trees located off-site with no access.
3. The estimated remaining contribution in years, and the tree grading category have been calculated for the current situation and may alter where further investigation works are advised.
4. Some trees or groups may have been given an interim grade. The reason for the interim grading is addressed in the timescales given as this may have a bearing on health and safety and/or any development proposals.
5. Tree Groups have been assessed with estimated and representative data.
6. This is not a Tree Works Schedule. Any preliminary management recommendations are listed in the interests of health and safety and should be carried out by a prudent tree owner.
7. Any management recommendations are suggested for reasons of health and safety only, regardless of development proposals at this stage. However, the defects requiring remedial tree surgery are by their very nature potential wildlife habitats, including protected species which needs consideration prior to any tree surgery works commencing.
8. The data collected and any advice provided within this report is supplied in the interests of sound arboricultural management. Trees are a living dynamic organism that can be affected by external conditions (high winds, storms, snow, heavy rain or drought) and may occasionally fail without warning. It is therefore not possible to state with any certainty that any tree or group of trees is completely safe. The condition of a tree or group of trees can change rapidly as a result of external factors; we would advise that the occupier/ owners inspect the trees at least every 12 months or following periods of extreme weather and where concerns are raised relating to tree health that would be considered beyond the knowledge of a layperson, further arboricultural advice should be sought.

**TREE PRESERVATION ORDER:**  
Some of the trees are protected by a Tree Preservation Order with reference 'Land Between Patuca & Thakeham Tile Works, Rock Road, Thakeham (TPO 1995), served and administered by Horsham District Council: Includes trees 1 to 20, W2A containing W2.1 to W2.11 and W2B containing W2.12 to W2.40 (see trees annotated in red below).

| Tree No  | Species                                 | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |      |      |      | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                           | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|----------|-----------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|------|------|------|------------|--------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|          |                                         |         |                                 |                | N                 | E   | S   | W   | N                    | E    | S    | W    |            |                          |                                                                                                                                                                         |                                        |                          |      |
| 1<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>   | 20      | S                               | 670            | 8.0               | 6.0 | 7.0 | 7.0 | 16.0                 | 14.0 | 14.0 | 6.0  | M          | Good                     | Fair<br>Major deadwood and stubs in crown<br>Ivy on trunk and in crown<br>Woodland edge tree                                                                            | No works required at time of survey    | 40+                      | B1   |
| 2<br>TPO | Pedunculate Oak<br><i>Quercus robur</i> | 22      | S                               | 820            | 8.0               | 8.0 | 9.0 | 9.0 | 10.0                 | 8.0  | 8.0  | 8.0  | M          | Good                     | Good<br>Multi-stemmed at 6m above ground level<br>Crown shape distorted due to group pressure<br>Major deadwood in crown<br>Woodland edge tree                          | Remove deadwood                        | 40+                      | A1+2 |
| 3<br>TPO | Common Ash<br><i>Fraxinus excelsior</i> | 18      | S                               | 420            | 3.0               | 3.0 | 5.0 | 6.0 | 4.0                  | 4.0  | 3.0  | 3.0  | EM         | Fair                     | Fair<br>Ivy on trunk and in crown<br>Minor deadwood in crown<br>Crown shape distorted due to group pressure<br>Woodland edge tree                                       | No works required at time of survey    | 40+                      | C1+2 |
| 4<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>   | 19      | S                               | 500            | 4.0               | 4.0 | 5.0 | 4.0 | 6.0                  | 6.0  | 6.0  | 6.0  | M          | Good                     | Fair<br>Ivy on trunk<br>Crown shape distorted due to group pressure<br>Deadwood and stubs in crown<br>Woodland edge tree                                                | No works required at time of survey    | 40+                      | B1+2 |
| 5<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>   | 20      | S                               | 530            | 7.0               | 5.0 | 4.0 | 5.0 | 12.0                 | 12.0 | 12.0 | 12.0 | M          | Good                     | Good<br>Understorey limits survey of crown<br>Ivy on trunk and in crown                                                                                                 | No works required at time of survey    | 20+                      | B1+2 |
| 6<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>   | 20      | S                               | 540            | 7.0               | 5.0 | 2.0 | 0.0 | 7.0                  | 7.0  | 7.0  | 7.0  | M          | Good                     | Fair<br>Crown shape distorted due to woodland environment<br>Leans and weighted north<br>Major deadwood in crown but no significant target<br>Ivy on trunk and in crown | No works required at time of survey    | 20+                      | B1+2 |

| Tree No   | Species                                 | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |     |     |     | H't of Crown<br>AGL<br>(m) |      |      |      | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                            | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|-----------|-----------------------------------------|------------|-------------------------------------------|----------------------|-------------------------|-----|-----|-----|----------------------------|------|------|------|---------------|---------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|------|
|           |                                         |            |                                           |                      | N                       | E   | S   | W   | N                          | E    | S    | W    |               |                                 |                                                                                                                                                   |                                              |                                   |      |
| 7<br>TPO  | Pedunculate Oak<br><i>Quercus robur</i> | 16         | S                                         | 200                  | 5.0                     | 3.0 | 7.0 | 4.0 | 6.0                        | 4.0  | 4.0  | 4.0  | SM            | Fair                            | Fair<br>Tall and etoiled due to group pressure<br>Minor deadwood in crown<br>Woodland edge tree                                                   | No works required at time of survey          | 40+                               | C1   |
| 8<br>TPO  | Scots Pine<br><i>Pinus sylvestris</i>   | 19         | S                                         | 480                  | 4.0                     | 3.0 | 6.0 | 4.0 | 10.0                       | 10.0 | 6.0  | 8.0  | M             | Fair                            | Fair<br>Ivy on trunk and in crown<br>Deadwood and stubs<br>Woodland edge tree                                                                     | No works required at time of survey          | 40+                               | B1+2 |
| 9<br>TPO  | Pedunculate Oak<br><i>Quercus robur</i> | 16         | S                                         | 450                  | 3.0                     | 4.0 | 6.0 | 3.0 | 6.0                        | 5.0  | 4.0  | 4.0  | M             | Fair                            | Fair<br>Trunk and crown shape distorted due to group pressure<br>Weighted south<br>Minor deadwood in crown<br>Ivy on trunks<br>Woodland edge tree | No works required at time of survey          | 40+                               | C1+2 |
| 10<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>   | 20         | S                                         | 510                  | 4.0                     | 4.0 | 6.0 | 4.0 | 10.0                       | 10.0 | 10.0 | 10.0 | M             | Fair                            | Fair<br>Crown shape distorted due to group pressure<br>Ivy on trunk and in crown<br>Deadwood and stubs<br>Woodland edge tree                      | Sever ivy<br>Remove deadwood                 | 40+                               | B1+2 |
| 11<br>TPO | Pedunculate Oak<br><i>Quercus robur</i> | 19         | S                                         | 370                  | 4.0                     | 5.0 | 5.0 | 4.0 | 6.0                        | 6.0  | 6.0  | 6.0  | SM            | Good                            | Good<br>Crown shape distorted due to group pressure<br>Minor deadwood in crown<br>Woodland edge tree                                              | No works required at time of survey          | 40+                               | C1+2 |
| 12<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>   | 16         | S                                         | 530                  | 3.0                     | 3.0 | 3.0 | 5.0 | 8.0                        | 8.0  | 8.0  | 8.0  | M             | Good                            | Fair<br>Ivy on trunk and in crown<br>Deadwood and stubs<br>Woodland edge tree                                                                     | No works required at time of survey          | 40+                               | B1+2 |
| 13<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>   | 17         | S                                         | 260                  | 2.0                     | 2.0 | 1.0 | 2.0 | 9.0                        | 9.0  | 9.0  | 9.0  | SM            | Fair                            | Fair<br>Suppressed and stunted<br>Crown shape distorted due to group pressure<br>Deadwood and stubs                                               | No works required at time of survey          | 20+                               | C1   |

| Tree No   | Species                                     | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |      |     | H't of Crown AGL (m) |     |     |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                | Preliminary Management Recommendations        | Est. Rem. Contrib. (Yrs) | Cat  |
|-----------|---------------------------------------------|---------|---------------------------------|----------------|-------------------|-----|------|-----|----------------------|-----|-----|-----|------------|--------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------|--------------------------|------|
| 14<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>       | 20      | S                               | 560            | 5.0               | 3.0 | 4.0  | 6.0 | 8.0                  | 8.0 | 2.5 | 3.0 | M          | Good                     | Fair<br>Ivy on trunk and in crown<br>Crown shape distorted due to group pressure<br>Deadwood and stubs<br>Woodland edge tree                                                                 | Sever ivy<br>Remove deadwood                  | 40+                      | B1+2 |
| 15<br>TPO | False Acacia<br><i>Robinia pseudoacacia</i> | 19      | S                               | 360            | 3.0               | 5.0 | 5.0  | 6.0 | 8.0                  | 5.0 | 4.0 | 4.0 | SM         | Fair                     | Fair<br>Trunk and crown shape distorted due to group pressure<br>Major deadwood in crown<br>Weighted south<br>Woodland edge tree                                                             | Remove deadwood                               | 20+                      | C1   |
| 16<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>       | 15      | S                               | 350            | 2.0               | 2.0 | 3.0  | 2.0 | 8.0                  | 8.0 | 8.0 | 8.0 | SM         | Fair                     | Fair<br>Ivy on trunk and in crown<br>Deadwood and stubs<br>Woodland edge tree                                                                                                                | No works required at time of survey           | 20+                      | C1   |
| 17<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>       | 18      | S                               | 580            | 4.0               | 3.0 | 4.0  | 3.0 | 8.0                  | 8.0 | 6.0 | 6.0 | M          | Fair                     | Fair<br>Ivy on trunk and in crown<br>Deadwood and stubs<br>Woodland edge tree                                                                                                                | No works required at time of survey           | 40+                      | B1+2 |
| 18<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>       | 15      | S                               | 460            | 8.0               | 6.0 | 1.0  | 2.0 | 8.0                  | 8.0 | 8.0 | 8.0 | EM         | Good                     | Fair<br>Ivy on trunk - previously cut<br>Leans and weighted north<br>Woodland edge tree                                                                                                      | No works required at time of survey           | 40+                      | C1+2 |
| 19<br>1PO | Common Ash<br><i>Fraxinus excelsior</i>     | 15      | MS<5                            | 520            | 6.0               | 6.0 | 8.0  | 5.0 | 10.0                 | 4.0 | 3.0 | 3.0 | EM         | Fair                     | Fair<br>East trunk bifurcated at 1.2m above ground level<br>Tight fork with included bark<br>Subsidiary stem to west<br>Woodland edge tree                                                   | No works required at time of survey           | 40+                      | C1   |
| 20<br>TPO | Pedunculate Oak<br><i>Quercus robur</i>     | 23      | S                               | 700            | 5.0               | 7.0 | 11.0 | 6.0 | 8.0                  | 5.0 | 6.0 | 8.0 | M          | Good                     | Fair<br>Bark wound at base on west side occluding<br>Major deadwood in crown<br>Crown shape distorted due to group pressure<br>Weighted south<br>Trunk shape distorted<br>Woodland edge tree | Remove deadwood over neighbouring outbuilding | 40+                      | B1+2 |

| Tree No | Species                                           | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |      | H't of Crown AGL (m) |     |     |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                             | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|---------------------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|------|----------------------|-----|-----|-----|------------|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                                   |         |                                 |                | N                 | E   | S   | W    | N                    | E   | S   | W   |            |                          |                                                                                                                                                                                                                           |                                        |                          |      |
| 21      | Lawson Cypress<br><i>Chamaecyparis lawsoniana</i> | 20      | S                               | Est 400        | 2.5               | 2.0 | 1.5 | 2.0  | 2.0                  | 2.0 | 2.0 | 2.0 | M          | Good                     | Fair<br>Offsite<br>Unable to verify health and safety due to no access<br>Bifurcated at 7m above ground level                                                                                                             | No works required at time of survey    | 40+                      | C1+2 |
| 22      | Pedunculate Oak<br><i>Quercus robur</i>           | 26      | S                               | 770            | 9.0               | 7.0 | 6.0 | 8.0  | 5.0                  | 5.0 | 4.0 | 4.0 | M          | Good                     | Good<br>Growing with T23<br>Ivy on trunk and in crown<br>Major deadwood in crown<br>Epicormics in crown                                                                                                                   | Sever ivy<br>Remove deadwood           | 40+                      | A1+2 |
| 23      | Pedunculate Oak<br><i>Quercus robur</i>           | 26      | S                               | 560            | 6.0               | 8.0 | 8.0 | 10.0 | 8.0                  | 8.0 | 8.0 | 6.0 | M          | Good                     | Fair<br>Growing with T22<br>Large tear wound on lowest limb south at 6m above ground level<br>Bifurcated at 3m above ground level<br>Epicormics in crown<br>Crown shape distorted due to group pressure<br>Weighted south | Remove damaged limb at 6m south        | 40+                      | B1+2 |
| 24      | Sweet Chestnut<br><i>Castanea sativa</i>          | 10      | S                               | 650            | 3.5               | 3.5 | 3.5 | 3.5  | -                    | -   | -   | -   | Dead       | Dead                     | Poor<br>Dead tree                                                                                                                                                                                                         | Advise removal                         | -                        | U    |
| 25      | Lawson Cypress<br><i>Chamaecyparis lawsoniana</i> | 22      | S                               | 400            | 3.0               | 3.0 | 3.0 | 3.0  | 4.0                  | 4.0 | 4.0 | 4.0 | EM         | Fair                     | Fair<br>Bifurcated at 5m above ground level<br>Unable to verify health and safety due to no access                                                                                                                        | No works required at time of survey    | 20+                      | C1   |

| Tree No | Species                                 | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |     |      |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                                        | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|-----|------|-----|------------|--------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                         |         |                                 |                | N                 | E   | S   | W   | N                    | E   | S    | W   |            |                          |                                                                                                                                                                                                                                                      |                                        |                          |      |
| 26      | Common Beech<br><i>Fagus sylvatica</i>  | 24      | S                               | 670            | 7.0               | 5.0 | 7.0 | 6.0 | 5.0                  | 6.0 | 5.0  | 6.0 | M          | Good                     | Good<br>Shared canopy<br>Growing with T27<br>Growing on bank<br>Unable to verify health and safety due to no access<br>Minor deadwood throughout crown<br>Bark wound on underside of limb 3.5m south - branch reduced<br>Old pruning wounds in crown | No works required at time of survey    | 40+                      | B1+2 |
| 27      | Common Beech<br><i>Fagus sylvatica</i>  | 25      | S                               | 550            | 6.0               | 6.0 | 6.0 | 5.0 | 4.0                  | 8.0 | 10.0 | 6.0 | M          | Good                     | Fair<br>Shared canopy<br>Growing with T26<br>Growing on bank<br>Unable to verify health and safety due to limited access<br>Trunk and crown shape distorted due to group pressure<br>Weighted north                                                  | No works required at time of survey    | 40+                      | B1+2 |
| 28      | Pedunculate Oak<br><i>Quercus robur</i> | 21      | MS<5                            | 430            | 1.0               | 3.0 | 6.0 | 4.0 | 8.0                  | 6.0 | 6.0  | 6.0 | EM         | Good                     | Fair<br>Growing on bank<br>Unable to verify health and safety due to no access<br>Bifurcated at 1m above ground level<br>Old pruning wounds on trunk<br>Epicormics in crown<br>Crown shape distorted due to group pressure<br>Weighted south         | No works required at time of survey    | 20+                      | C1+2 |

| Tree No | Species                                 | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |      |      |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                         | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|------|------|-----|------------|--------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                         |         |                                 |                | N                 | E   | S   | W   | N                    | E    | S    | W   |            |                          |                                                                                                                                                                                                                       |                                        |                          |      |
| 29      | Common Beech<br><i>Fagus sylvatica</i>  | 25      | S                               | 600            | 8.0               | 5.0 | 9.0 | 7.0 | 6.0                  | 6.0  | 12.0 | 4.0 | M          | Good                     | Fair<br>Offsite<br>Unable to verify health and safety due to no access<br>Growing on bank<br>Crown shape distorted due to group pressure<br>Old pruning wounds in crown                                               | No works required at time of survey    | 40+                      | B1+2 |
| 30      | Common Beech<br><i>Fagus sylvatica</i>  | 20      | S                               | 570            | 8.0               | 8.0 | 7.0 | 3.0 | 6.0                  | 6.0  | 6.0  | 5.0 | M          | Good                     | Fair<br>Offsite<br>Unable to verify health and safety due to no access<br>Growing on bank<br>Storm damage and branch tear wound in east side of crown<br>Crown shape distorted due to group pressure<br>Weighted east | No works required at time of survey    | 40+                      | C1+2 |
| 31      | Pedunculate Oak<br><i>Quercus robur</i> | 19      | MS<5                            | Est 400        | 6.0               | 4.0 | 6.0 | 3.0 | 6.0                  | 10.0 | 8.0  | 6.0 | EM         | Good                     | Fair<br>Growing on bank<br>Unable to verify health and safety due to no access<br>Bifurcated at 1m above ground level<br>Ivy on trunks                                                                                | No works required at time of survey    | 20+                      | C1+2 |
| 32      | Pedunculate Oak<br><i>Quercus robur</i> | 23      | S                               | 550            | 8.0               | 6.0 | 8.0 | 9.0 | 8.0                  | 8.0  | 10.0 | 8.0 | M          | Good                     | Fair<br>Offsite<br>Unable to verify health and safety due to no access<br>Growing on bank<br>Major deadwood in crown<br>Estimated data                                                                                | No works required at time of survey    | 40+                      | B1+2 |

| Tree No | Species                                  | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |      |      |      | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                      | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|------------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|------|------|------|------------|--------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                          |         |                                 |                | N                 | E   | S   | W   | N                    | E    | S    | W    |            |                          |                                                                                                                                                                                                                                    |                                        |                          |      |
| 33      | Pedunculate Oak<br><i>Quercus robur</i>  | 17      | MS<5                            | Est 370        | 3.0               | 2.0 | 2.0 | 4.0 | 12.0                 | 12.0 | 6.0  | 6.0  | SM         | Good                     | Fair<br>Growing on bank<br>Unable to verify health and safety due to no access<br>Bifurcated at ground level<br>Tall and etiolated due to group pressure<br>Crown shape distorted due to group pressure<br>Minor deadwood in crown | No works required at time of survey    | 40+                      | C1+2 |
| 34      | Sweet Chestnut<br><i>Castanea sativa</i> | 19      | S                               | Est 370        | 5.0               | 3.0 | 6.0 | 7.0 | 6.0                  | 4.0  | 6.0  | 6.0  | M          | Good                     | Fair<br>Growing on bank<br>Unable to verify health and safety due to no access<br>Ivy on trunk and in crown<br>Epicormics on trunk<br>Crown shape distorted due to group pressure<br>Minor deadwood in crown                       | No works required at time of survey    | 40+                      | C1+2 |
| 35      | Pedunculate Oak<br><i>Quercus robur</i>  | 19      | S                               | Est 400        | 5.0               | 4.0 | 6.0 | 7.0 | 6.0                  | 6.0  | 7.0  | 6.0  | EM         | Good                     | Fair<br>Unable to verify health and safety due to no access<br>Epicormics on trunk and in crown<br>Trunk and crown shape distorted due to group pressure<br>Major deadwood in crown but no significant target                      | No works required at time of survey    | 40+                      | B1+2 |
| 36      | Scots Pine<br><i>Pinus sylvestris</i>    | 19      | S                               | Est 400        | 3.0               | 3.0 | 3.0 | 3.0 | 10.0                 | 10.0 | 10.0 | 10.0 | M          | Good                     | Fair<br>Growing on bank<br>Unable to verify health and safety due to no access<br>Deadwood and stubs                                                                                                                               | No works required at time of survey    | 40+                      | B1+2 |

| Tree No | Species                                  | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |      |      | H't of Crown AGL (m) |      |      |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                                  | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|------------------------------------------|---------|---------------------------------|----------------|-------------------|-----|------|------|----------------------|------|------|-----|------------|--------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                          |         |                                 |                | N                 | E   | S    | W    | N                    | E    | S    | W   |            |                          |                                                                                                                                                                                                                                                |                                        |                          |      |
| 37      | Pedunculate Oak<br><i>Quercus robur</i>  | 20      | MS<5                            | 680            | 4.0               | 3.0 | 8.0  | 9.0  | 6.0                  | 10.0 | 6.0  | 7.0 | M          | Good                     | Fair<br>Growing on bank<br>Unable to verify health and safety due to no access<br>Bifurcated at 1m above ground level<br>Tight forks with included bark<br>Major deadwood in crown                                                             | Remove deadwood                        | 40+                      | B1+2 |
| 38      | Common Beech<br><i>Fagus sylvatica</i>   | 18      | S                               | Est 450        | 5.0               | 3.0 | 7.0  | 9.0  | 4.0                  | 14.0 | 4.0  | 6.0 | EM         | Fair                     | Fair<br>Growing on bank<br>Unable to verify health and safety due to no access<br>Trunk and crown shape distorted due to group pressure<br>Weighted south west<br>Ivy on trunk and in crown                                                    | No works required at time of survey    | 10+                      | C1   |
| 39      | Sweet Chestnut<br><i>Castanea sativa</i> | 17      | S                               | Est 400        | 4.0               | 3.0 | 6.0  | 4.0  | 4.0                  | 4.0  | 4.0  | 4.0 | EM         | Fair                     | Fair<br>Growing on bank<br>Unable to verify health and safety due to no access<br>Storm damage and branch tear wound in crown on north side                                                                                                    | Remove storm damage                    | 10+                      | C1+2 |
| 40      | Pedunculate Oak<br><i>Quercus robur</i>  | 23      | S                               | 1000           | 10.0              | 9.0 | 10.0 | 12.0 | 17.0                 | 15.0 | 18.0 | 8.0 | M          | Good                     | Fair<br>Growing on bank<br>Unable to verify health and safety due to no access<br>Ivy on trunk and in crown - previously cut<br>Crown shape distorted due to group pressure<br>Trifurcated at 6m above ground level<br>Major deadwood in crown | Remove deadwood                        | 40+                      | B1+2 |

| Tree No | Species                                 | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |     |      |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                          | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|-----|------|-----|------------|--------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                         |         |                                 |                | N                 | E   | S   | W   | N                    | E   | S    | W   |            |                          |                                                                                                                                                                                                        |                                        |                          |      |
| 41      | Pedunculate Oak<br><i>Quercus robur</i> | 18      | S                               | 650            | 6.0               | 5.0 | 6.0 | 6.0 | 5.0                  | 4.0 | 2.0  | 2.0 | M          | Fair                     | Fair<br>Growing on bank<br>Ivy on trunk and in crown - previously cut<br>Low hanging branches<br>Crown shape distorted due to group pressure<br>Weighted west                                          | No works required at time of survey    | 20+                      | B1+2 |
| 42      | Scots Pine<br><i>Pinus sylvestris</i>   | 16      | S                               | 390            | 4.0               | 4.5 | 4.0 | 4.0 | 10.0                 | 7.0 | 5.0  | 4.0 | EM         | Good                     | Fair<br>Growing on bank<br>Ivy on trunk and in crown<br>Crown shape distorted due to group pressure                                                                                                    | No works required at time of survey    | 20+                      | B1+2 |
| 43      | Pedunculate Oak<br><i>Quercus robur</i> | 10      | MS<5                            | 540            | 5.0               | 5.0 | 6.0 | 6.0 | 2.0                  | 2.0 | 2.0  | 4.0 | EM         | Good                     | Fair<br>Growing on bank<br>Ivy on trunk and in crown<br>Bifurcated at 1.1m above ground level<br>Low hanging branches<br>Epicormics on trunk<br>Old pruning wounds in crown<br>Minor deadwood in crown | No works required at time of survey    | 40+                      | B1+2 |
| 44      | Pedunculate Oak<br><i>Quercus robur</i> | 20      | S                               | 450            | 9.0               | 8.0 | 5.0 | 4.0 | 5.0                  | 8.0 | 10.0 | 8.0 | EM         | Fair                     | Good<br>Growing on bank<br>Ivy on trunk and in crown<br>Bifurcated at 8m above ground level<br>Trunk and crown shape distorted due to group pressure<br>Weighted east                                  | No works required at time of survey    | 20+                      | B1+2 |

| Tree No | Species                                  | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |     |     |      | H't of Crown<br>AGL<br>(m) |     |     |     | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                                                                                                          | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|---------|------------------------------------------|------------|-------------------------------------------|----------------------|-------------------------|-----|-----|------|----------------------------|-----|-----|-----|---------------|---------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|------|
|         |                                          |            |                                           |                      | N                       | E   | S   | W    | N                          | E   | S   | W   |               |                                 |                                                                                                                                                                                                                                 |                                              |                                   |      |
| 45      | Pedunculate Oak<br><i>Quercus robur</i>  | 15         | S                                         | 460                  | 5.0                     | 5.0 | 6.0 | 10.0 | 4.0                        | 4.0 | 2.0 | 4.0 | EM            | Good                            | Fair<br>Growing on bank<br>Trunk and crown shape<br>distorted due to group pressure<br>Epicormics on trunk and in<br>crown<br>Bifurcated at 4.5m above<br>ground level<br>Major deadwood in crown<br>Weighted west              | No works required at time<br>of survey       | 20+                               | C1+2 |
| 46      | Sweet Chestnut<br><i>Castanea sativa</i> | 22         | MS<5                                      | 700                  | 5.0                     | 8.0 | 6.0 | 6.0  | 8.0                        | 6.0 | 8.0 | 8.0 | M             | Good                            | Fair<br>Growing on bank<br>Trifurcated at ground level<br>Basal suckers<br>Trunk and crown shape<br>distorted due to group pressure<br>Major deadwood in crown<br>Previously topped<br>Soil heaped at base                      | Remove deadwood                              | 20+                               | C1+2 |
| 47      | Sweet Chestnut<br><i>Castanea sativa</i> | 22         | MS<5                                      | 590                  | 7.0                     | 6.0 | 4.0 | 6.0  | 6.0                        | 6.0 | 6.0 | 6.0 | M             | Fair                            | Fair<br>Growing on bank<br>Bark wound at base on north<br>side occluding<br>Trunk and crown shape<br>distorted due to group pressure<br>Previously topped<br>Bifurcated at ground level<br>Basal suckers<br>Soil heaped at base | No works required at time<br>of survey       | 20+                               | C1+2 |

| Tree No | Species                                            | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |     |     |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                          | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|----------------------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|-----|-----|-----|------------|--------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                                    |         |                                 |                | N                 | E   | S   | W   | N                    | E   | S   | W   |            |                          |                                                                                                                                                        |                                        |                          |      |
| 48      | Pedunculate Oak<br><i>Quercus robur</i>            | 24      | S                               | 650            | 7.0               | 8.0 | 5.0 | 7.5 | 6.0                  | 6.0 | 6.0 | 6.0 | M          | Good                     | Fair<br>Growing on bank<br>Ivy on trunk and in crown limits survey<br>Trunk and crown shape distorted due to group pressure<br>Soil heaped around base | Sever ivy<br>Remove deadwood           | 40+                      | B1+2 |
| 49      | Silver Birch<br><i>Betula pendula</i>              | 20      | S                               | 290            | 3.0               | 3.0 | 4.0 | 4.0 | 4.0                  | 4.0 | 3.0 | 3.0 | EM         | Good                     | Fair<br>Suppressed and stunted<br>Ivy on trunk<br>Bifurcated at 6m above ground level<br>Minor deadwood in crown                                       | No works required at time of survey    | 20+                      | C1   |
| 50      | Sweet Chestnut<br><i>Castanea sativa</i>           | 8       | MS<5                            | 210            | 4.0               | 4.0 | 4.0 | 2.0 | 2.0                  | 2.0 | 2.0 | 2.0 | SM         | Good                     | Fair<br>Previously topped<br>Low hanging branches<br>Ivy on trunk and in crown<br>Bifurcated at 1m above ground level                                  | No works required at time of survey    | 10+                      | C1   |
| 51      | Pedunculate Oak<br><i>Quercus robur</i>            | 9       | S                               | 250            | 3.0               | 3.5 | 7.0 | 4.0 | 2.0                  | 2.0 | 2.0 | 2.0 | SM         | Good                     | Fair<br>Ivy on trunk and in crown<br>Trunk and crown shape distorted due to group pressure<br>Leans and weighted south                                 | No works required at time of survey    | 10+                      | C1+2 |
| 52      | Pedunculate Oak<br><i>Quercus robur</i>            | 18      | MS<5                            | 490            | 5.0               | 6.0 | 4.0 | 8.0 | 5.0                  | 5.0 | 2.5 | 3.0 | EM         | Good                     | Fair<br>Growing on bank<br>Ivy on trunk and in crown<br>Bifurcated at ground level<br>Crown shape distorted due to group pressure                      | No works required at time of survey    | 40+                      | B1   |
| 53      | Leyland Cypress<br><i>X Cuprocyparis leylandii</i> | 23      | S                               | 370            | 3.0               | 2.0 | 2.0 | 3.0 | 1.0                  | 1.0 | 1.0 | 1.0 | EM         | Good                     | Fair<br>Growing on bank<br>Ivy on trunk and in crown<br>Low hanging branches<br>Minor deadwood in crown                                                | No works required at time of survey    | 20+                      | C1   |

| Tree No | Species                                 | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |     |     |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                             | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|-----|-----|-----|------------|--------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                         |         |                                 |                | N                 | E   | S   | W   | N                    | E   | S   | W   |            |                          |                                                                                                                                                                                                                                           |                                        |                          |      |
| 54      | Pedunculate Oak<br><i>Quercus robur</i> | 19      | S                               | 330            | 6.0               | 4.0 | 4.0 | 5.0 | 5.0                  | 6.0 | 5.0 | 4.0 | EM         | Good                     | Fair<br>Growing on bank<br>Trunk and crown shape distorted due to group pressure<br>Minor deadwood in crown                                                                                                                               | No works required at time of survey    | 20+                      | C1   |
| 55      | Pedunculate Oak<br><i>Quercus robur</i> | 15      | S                               | 230            | 3.0               | 3.0 | 5.0 | 3.0 | 4.0                  | 4.0 | 4.0 | 5.0 | SM         | Good                     | Fair<br>Ivy on trunk and in crown limits survey<br>Crown shape distorted due to group pressure<br>Weighted south<br>Bifurcated at approximately 6m above ground level                                                                     | No works required at time of survey    | 20+                      | C1   |
| 56      | Pedunculate Oak<br><i>Quercus robur</i> | 21      | S                               | 590            | 6.0               | 6.0 | 9.0 | 8.0 | 6.0                  | 4.0 | 4.0 | 5.0 | M          | Good                     | Good<br>Offsite<br>Unable to verify health and safety due to no access<br>Crown shape distorted<br>Weighted south<br>Major deadwood in crown                                                                                              | No works required at time of survey    | 40+                      | A1+2 |
| 57      | Pedunculate Oak<br><i>Quercus robur</i> | 24      | S                               | 530            | 6.0               | 8.0 | 6.0 | 6.0 | 10.0                 | 8.0 | 8.0 | 8.0 | M          | Good                     | Fair<br>Growing on bank<br>Storm damage and branch tear wound on east side of trunk at 5m above ground level<br>Crown shape distorted due to group pressure<br>Epicormics in crown<br>Possible roost formation<br>Major deadwood in crown | Remove and tidy storm damage           | 40+                      | B1+2 |

| Tree No | Species                                 | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |      |      |      | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                   | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|------|------|------|------------|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                         |         |                                 |                | N                 | E   | S   | W   | N                    | E    | S    | W    |            |                          |                                                                                                                                                                                                                                 |                                        |                          |      |
| 58      | Pedunculate Oak<br><i>Quercus robur</i> | 20      | S                               | 290            | 4.0               | 6.0 | 3.0 | 1.0 | 10.0                 | 10.0 | 10.0 | 10.0 | EM         | Good                     | Fair<br>Growing on bank<br>Tall and etiolated due to group pressure<br>Bifurcated at 6m above ground level<br>Crown shape distorted due to group pressure<br>Weighted east<br>Minor deadwood in crown                           | No works required at time of survey    | 20+                      | C1+2 |
| 59      | Pedunculate Oak<br><i>Quercus robur</i> | 22      | S                               | 480            | 7.0               | 5.0 | 4.0 | 6.0 | 5.0                  | 6.0  | 8.0  | 4.0  | M          | Good                     | Fair<br>Growing on bank<br>Bifurcated at 5.5m above ground level<br>Crown shape distorted due to group pressure<br>Weighted north<br>Minor deadwood in crown<br>Epicormics in crown                                             | No works required at time of survey    | 40+                      | B1+2 |
| 60      | Silver Birch<br><i>Betula pendula</i>   | 17      | MS<5                            | 470            | 7.0               | 7.0 | 6.0 | 6.0 | 5.0                  | 5.0  | 5.0  | 5.0  | M          | Fair                     | Poor<br>Trifurcated at ground level<br>Trunk and crown shape distorted due to group pressure<br>Branch tear wound and storm damage                                                                                              | Advise removal                         | <10                      | U    |
| 61      | Pedunculate Oak<br><i>Quercus robur</i> | 19      | S                               | Est 530        | 6.0               | 6.0 | 6.0 | 6.0 | 3.0                  | 3.0  | 3.0  | 3.0  | M          | Good                     | Fair<br>Offsite tree<br>Unable to verify health and safety due to no access<br>Epicormics on trunk and in crown<br>Previously crown reduced<br>Bifurcated ay 6m above ground level<br>Minor deadwood in crown<br>Estimated data | No works required at time of survey    | 40+                      | C1+2 |

| Tree No | Species                                 | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |     |     |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                              | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|-----|-----|-----|------------|--------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                         |         |                                 |                | N                 | E   | S   | W   | N                    | E   | S   | W   |            |                          |                                                                                                                                                            |                                        |                          |      |
| 62      | Common Hazel<br><i>Corylus avellana</i> | 10      | MS>6                            | 60             | 6.0               | 8.0 | 6.0 | 7.0 | 3.0                  | 3.0 | 3.0 | 3.0 | M          | Good                     | Fair<br>Multi-stemmed at ground level<br>Basal suckers<br>Decay in some stems                                                                              | Coppice mature stems at ground level   | 10+                      | C1+2 |
| 63      | Pedunculate Oak<br><i>Quercus robur</i> | 14      | S                               | 390            | 4.0               | 3.0 | 3.0 | 6.0 | 8.0                  | 4.0 | 4.0 | 4.0 | EM         | Fair                     | Poor<br>In decline<br>Major deadwood in crown<br>Waterlogged ground around base                                                                            | Remove deadwood                        | 10+                      | C1+2 |
| 64      | Goat Willow<br><i>Salix caprea</i>      | 5       | MS<5                            | 320            | 8.0               | 6.0 | 0.0 | 3.0 | 0.0                  | 0.0 | 0.0 | 0.0 | EM         | Poor                     | Poor<br>Basal decay with historical stem failure<br>Epicormics form crown                                                                                  | Advise removal                         | <10                      | U    |
| 65      | Pedunculate Oak<br><i>Quercus robur</i> | 22      | S                               | 240            | 5.0               | 5.0 | 2.0 | 4.0 | 3.0                  | 4.0 | 4.0 | 5.0 | SM         | Good                     | Fair<br>Growing on bank<br>Tall and etiolated due to group pressure<br>Crown shape distorted due to group pressure<br>Epicormics on trunk                  | No works required at time of survey    | 40+                      | C1+2 |
| 66      | Pedunculate Oak<br><i>Quercus robur</i> | 22      | S                               | 280            | 3.0               | 4.0 | 3.0 | 2.0 | 8.0                  | 8.0 | 8.0 | 8.0 | SM         | Good                     | Fair<br>Growing on bank<br>Tall and etiolated due to group pressure<br>Trunk and crown shape distorted due to group pressure<br>Leans west<br>Ivy on trunk | No works required at time of survey    | 20+                      | C1+2 |

| Tree No | Species                                 | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |      |      |      | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                                            | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|------|------|------|------------|--------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                         |         |                                 |                | N                 | E   | S   | W   | N                    | E    | S    | W    |            |                          |                                                                                                                                                                                                                                                          |                                        |                          |      |
| 67      | Pedunculate Oak<br><i>Quercus robur</i> | 20      | S                               | 590            | 6.0               | 7.0 | 4.0 | 6.0 | 2.0                  | 6.0  | 4.0  | 2.0  | M          | Good                     | Fair<br>Growing on bank<br>Bifurcated at 3m above ground level<br>Epicormics on trunk and in crown<br>Minor deadwood in crown<br>Low hanging branches<br>Previously crown reduced on north side of crown<br>Major deadwood in crown<br>Fuel tank to east | No works required at time of survey    | 40+                      | B1   |
| 68      | Scots Pine<br><i>Pinus sylvestris</i>   | 19      | S                               | 530            | 3.0               | 5.0 | 4.0 | 0.0 | 10.0                 | 10.0 | 10.0 | 10.0 | M          | Fair                     | Poor<br>Tsdgp<br>Deadwood and stubs<br>Weighted east                                                                                                                                                                                                     | No works required at time of survey    | 20+                      | C1+2 |
| 69      | Pedunculate Oak<br><i>Quercus robur</i> | 9       | S                               | 160            | 3.0               | 4.0 | 2.5 | 3.0 | 2.0                  | 3.0  | 3.0  | 2.0  | SM         | Good                     | Fair<br>Developing tree<br>Trunk and crown shape distorted due to group pressure<br>Low hanging branches                                                                                                                                                 | No works required at time of survey    | 20+                      | C1+2 |
| 70      | Scots Pine<br><i>Pinus sylvestris</i>   | 19      | S                               | 650            | 4.0               | 4.0 | 4.0 | 5.0 | 10.0                 | 6.0  | 6.0  | 6.0  | M          | Good                     | Fair<br>Upper trunk distorted<br>Deadwood and stubs<br>Crown shape distorted due to group pressure                                                                                                                                                       | No works required at time of survey    | 40+                      | B1+2 |
| 71      | Hazel<br><i>Corylus spp</i>             | 8       | MS<5                            | 210            | 6.0               | 4.0 | 6.0 | 5.0 | 2.0                  | 4.0  | 3.0  | 4.0  | M          | Good                     | Fair<br>Bifurcated at 1m above ground level<br>Basal suckers<br>Crown shape distorted due to group pressure                                                                                                                                              | No works required at time of survey    | 10+                      | C1+2 |

| Tree No | Species                                 | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |      |      |      | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                    | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|------|------|------|------------|--------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                         |         |                                 |                | N                 | E   | S   | W   | N                    | E    | S    | W    |            |                          |                                                                                                                                                                                                                                  |                                        |                          |      |
| 72      | Pedunculate Oak<br><i>Quercus robur</i> | 18      | MS<5                            | 500            | 4.0               | 4.0 | 6.0 | 6.0 | 8.0                  | 6.0  | 4.0  | 4.0  | EM         | Fair                     | Fair<br>Trifurcated at ground level<br>Ivy on trunk - previously cut<br>Crown shape distorted due to woodland environment<br>Epicormics in crown<br>Minor deadwood in crown<br>Woodland edge tree                                | No works required at time of survey    | 10+                      | C1+2 |
| 73      | Pedunculate Oak<br><i>Quercus robur</i> | 18      | S                               | 420            | 2.0               | 3.0 | 7.0 | 6.0 | 8.0                  | 8.0  | 8.0  | 8.0  | EM         | Fair                     | Poor<br>Multi-stemmed by 2.5m above ground level<br>Old pruning wounds in crown<br>East side of crown previously reduced<br>Epicormics on trunk and in crown<br>Crown shape distorted due to woodland edge<br>Woodland edge tree | No works required at time of survey    | 10+                      | C1+2 |
| 74      | Silver Birch<br><i>Betula pendula</i>   | 10      | MS<5                            | 290            | 2.0               | 6.0 | 2.0 | 1.0 | 5.0                  | 5.0  | 5.0  | 5.0  | EM         | Dead                     | Dead<br>Multi-stemmed by 1m above ground level<br>Only 2 trunks remain of which one has failed and the other trunk is dead                                                                                                       | Advise removal                         | -                        | U    |
| 75      | Common Ash<br><i>Fraxinus excelsior</i> | 23      | S                               | 530            | 5.0               | 6.0 | 7.0 | 2.0 | 8.0                  | 6.0  | 8.0  | 8.0  | M          | Good                     | Fair<br>Leans and weighted east<br>Crown shape distorted due to woodland environment<br>Previously crown reduced on east side of crown<br>Woodland edge tree                                                                     | No works required at time of survey    | 20+                      | C1+2 |
| 76      | Pedunculate Oak<br><i>Quercus robur</i> | 18      | S                               | 360            | 1.5               | 5.0 | 2.0 | 0.0 | 17.0                 | 17.0 | 17.0 | 17.0 | EM         | Fair                     | Fair<br>Ivy on trunk and in crown<br>Crown shape distorted due to woodland edge<br>Leans and weighted east<br>Major deadwood in crown<br>Woodland edge tree                                                                      | No works required at time of survey    | 10+                      | C1+2 |

| Tree No | Species                                  | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |      |      |      | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                               | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|------------------------------------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|------|------|------|------------|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                          |         |                                 |                | N                 | E   | S   | W   | N                    | E    | S    | W    |            |                          |                                                                                                                                                                                             |                                        |                          |      |
| 77      | Pedunculate Oak<br><i>Quercus robur</i>  | 9       | S                               | 390            | 3.0               | 3.0 | 5.0 | 1.0 | 3.0                  | 3.0  | 4.0  | 3.0  | EM         | Fair                     | Fair<br>Ivy on trunk and in crown limits survey<br>Crown shape distorted due to woodland environment<br>Woodland edge tree                                                                  | No works required at time of survey    | 40+                      | C1+2 |
| 78      | Pedunculate Oak<br><i>Quercus robur</i>  | 22      | S                               | 490            | 7.0               | 6.0 | 5.0 | 5.0 | 8.0                  | 9.0  | 8.0  | 9.0  | EM         | Fair                     | Fair<br>Ivy on trunk - previously cut<br>Crown shape distorted due to woodland environment<br>Major deadwood in crown<br>Woodland edge tree                                                 | No works required at time of survey    | 20+                      | B1+2 |
| 79      | Pedunculate Oak<br><i>Quercus robur</i>  | 21      | S                               | 550            | 7.0               | 4.0 | 4.0 | 7.0 | 6.0                  | 6.0  | 6.0  | 6.0  | M          | Fair                     | Poor<br>Large cavity forming with wildlife hole on south side of trunk<br>Crown shape distorted due to woodland environment<br>Major deadwood in crown                                      | Advise removal                         | <10                      | U    |
| 80      | Sweet Chestnut<br><i>Castanea sativa</i> | 15      | S                               | 570            | 2.0               | 3.0 | 3.0 | 2.0 | 3.0                  | 3.0  | 3.0  | 3.0  | M          | Fair                     | Poor<br>Old pruning wounds on trunk<br>Ivy on trunk and in crown<br>Previously pollarded at 3.5m above ground level<br>One stem left to grow                                                | No works required at time of survey    | 10+                      | C1+2 |
| 81      | Common Ash<br><i>Fraxinus excelsior</i>  | 17      | S                               | 270            | 4.0               | 4.0 | 4.0 | 3.0 | 8.0                  | 12.0 | 12.0 | 12.0 | EM         | Good                     | Fair<br>Old pruning wounds on trunk and in crown<br>Crown shape distorted due to woodland environment<br>Bifurcated at 8.5m above ground level<br>Epicormics in crown<br>Woodland edge tree | No works required at time of survey    | 10+                      | C1+2 |

| Tree No | Species                                                                    | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |     |     |     | H't of Crown<br>AGL<br>(m) |      |      |      | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                                                                                                                                                                                                                                                                             | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|---------|----------------------------------------------------------------------------|------------|-------------------------------------------|----------------------|-------------------------|-----|-----|-----|----------------------------|------|------|------|---------------|---------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|------|
|         |                                                                            |            |                                           |                      | N                       | E   | S   | W   | N                          | E    | S    | W    |               |                                 |                                                                                                                                                                                                                                                                                                                                                                                                    |                                              |                                   |      |
| 82      | Common Ash<br><i>Fraxinus excelsior</i>                                    | 17         | S                                         | 330                  | 4.0                     | 4.0 | 2.0 | 3.0 | 6.0                        | 6.0  | 6.0  | 6.0  | EM            | Fair                            | Fair<br>Old pruning wounds on trunk<br>and in crown<br>Crown shape distorted due to<br>woodland environment<br>Bifurcated at 6m above ground<br>level<br>Woodland edge tree                                                                                                                                                                                                                        | No works required at time<br>of survey       | 10+                               | C1   |
| 83      | Scots Pine<br><i>Pinus sylvestris</i>                                      | 24         | S                                         | 690                  | 2.5                     | 3.0 | 3.0 | 4.0 | 6.0                        | 6.0  | 6.0  | 6.0  | M             | Good                            | Fair<br>Ivy on trunk and in crown<br>Deadwood and stubs<br>Woodland edge tree                                                                                                                                                                                                                                                                                                                      | No works required at time<br>of survey       | 40+                               | B1+2 |
| 84      | Pedunculate Oak<br><i>Quercus robur</i>                                    | 19         | S                                         | 730                  | 10.0                    | 7.0 | 4.0 | 7.0 | 7.0                        | 12.0 | 15.0 | 12.0 | M             | Poor                            | Poor<br>Ganoderma fungal fruiting<br>bodies at base on north side -<br>basal decay (extent unknown)<br>Ivy on trunk and in crown<br>Bifurcated at 6m above ground<br>level<br>Crown shape distorted due to<br>woodland environment<br>Leans and weighted north<br>In decline<br>Major deadwood in crown<br>Decay and cavity forming in<br>branch tear wound on west<br>trunk<br>Woodland edge tree | Remove major deadwood                        | 10+                               | C1   |
| Grp 1   | Scots Pine<br>Hazel<br>Sweet Chestnut<br>Japanese Cedar<br>Pedunculate Oak | 10         | S                                         | 200                  | -                       | -   | -   | -   | -                          | -    | -    | -    | SM            | Good                            | Fair<br>Developing trees<br>Trunk and crown shapes<br>distorted due to group pressure<br>Low hanging branches                                                                                                                                                                                                                                                                                      | No works required at time<br>of survey       | 20+                               | C1+2 |

| Tree No | Species                                                                          | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |   |   |   | H't of Crown AGL (m) |   |   |   | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                     | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|----------------------------------------------------------------------------------|---------|---------------------------------|----------------|-------------------|---|---|---|----------------------|---|---|---|------------|--------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                                                                  |         |                                 |                | N                 | E | S | W | N                    | E | S | W |            |                          |                                                                                                                                                                                   |                                        |                          |      |
| Grp 2   | Sweet Chestnut<br>Holly<br>Pedunculate Oak                                       | 8       | MS                              | 250            | -                 | - | - | - | -                    | - | - | - | SM         | Fair                     | Poor<br>Growing on bank<br>Trunk and crown shapes distorted due to group pressure<br>Major deadwood in some crowns                                                                | No works required at time of survey    | 10+                      | C1   |
| Grp 3   | Birch Oak<br>Beech<br>Rhododendron<br>Yew<br>Holly                               | 14      | MS                              | 250            | -                 | - | - | - | -                    | - | - | - | SM         | Fair                     | Fair<br>Trunk and crown shapes distorted due to group pressure                                                                                                                    | No works required at time of survey    | 40+                      | C1+2 |
| Grp 4   | Birch<br>Holly<br>Goat Willow<br>Hawthorn<br>Scots Pine<br>Hazel<br>Rhododendron | 12      | S                               | 250            | -                 | - | - | - | -                    | - | - | - | SM         | Poor                     | Fair<br>Growing on bank<br>Trunk and crown shapes distorted due to group pressure<br>Shrub border with self-set trees growing<br>Low hanging branches<br>Minor deadwood in crowns | No works required at time of survey    | 40+                      | C1+2 |
| Grp 5   | Silver Birch<br>Pedunculate Oak<br>Scots Pine                                    | 19      | See below                       | See below      | -                 | - | - | - | -                    | - | - | - | M          | Good                     | Good<br>Growing on bank<br>Trunk and crown shapes distorted due to group pressure<br>Understorey of Rhododendron                                                                  | No works required at time of survey    | 40+                      | B1+2 |
| G5.1    | Silver Birch                                                                     | -       | S                               | 510            | -                 | - | - | - | -                    | - | - | - | M          | -                        | -                                                                                                                                                                                 | No works required at time of survey    | 40+                      | C1   |
| G5.2    | Pedunculate Oak                                                                  | -       | S                               | 390            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                                                                                                                                                                 | No works required at time of survey    | 40+                      | B1+2 |
| G5.3    | Scots Pine                                                                       | -       | S                               | 440            | -                 | - | - | - | -                    | - | - | - | M          | -                        | -                                                                                                                                                                                 | Remove hanging branches                | 40+                      | C1   |
| G5.4    | Pedunculate Oak                                                                  | -       | S                               | 300            | -                 | - | - | - | -                    | - | - | - | SM         | -                        | -                                                                                                                                                                                 | No works required at time of survey    | 40+                      | C1   |
| G5.5    | Pedunculate Oak                                                                  | -       | S                               | 390            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                                                                                                                                                                 | No works required at time of survey    | 40+                      | B1   |

| Tree No | Species                                        | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |   |   |   | H't of Crown AGL (m) |   |   |   | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                       | Preliminary Management Recommendations                         | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|------------------------------------------------|---------|---------------------------------|----------------|-------------------|---|---|---|----------------------|---|---|---|------------|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------|--------------------------|------|
|         |                                                |         |                                 |                | N                 | E | S | W | N                    | E | S | W |            |                          |                                                                                                                                                                                                                     |                                                                |                          |      |
| Grp 6   | Oak<br>Birch<br>Cherry<br>Field Maple          | 14      | MS                              | 200            | -                 | - | - | - | -                    | - | - | - | SM         | Fair                     | Good<br>Growing on bank<br>Bark wounds on trunks<br>Trunk and crown shapes distorted due to group pressure<br>Tall and etiolated due to group pressure<br>Developing trees<br>Minor deadwood in crowns              | Remove Oak with worst bark wound on edge of bank on track side | 10+                      | C1   |
| Grp 7   | Birch<br>Oak<br>Pine<br>Ash                    | 15      | S                               | 250            | -                 | - | - | - | -                    | - | - | - | SM         | Good                     | Fair<br>Growing on bank<br>Dead Oak in group<br>Trunk and crown shapes distorted due to group pressure                                                                                                              | Remove dead Oak                                                | 20+                      | C1+2 |
| Grp 8   | Pedunculate Oak<br>Goat Willow<br>Silver Birch | 15      | S                               | 300            | -                 | - | - | - | -                    | - | - | - | SM         | Good                     | Fair<br>Natural regeneration<br>Group of semi-mature trees growing on bank<br>Ground levels change within group<br>Trunk and crown shapes distorted due to group pressure<br>Several dead and failed trees in group | No works required at time of survey                            | 20+                      | C1   |

| Tree No | Species                                                         | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |   |   |   | H't of Crown AGL (m) |   |   |   | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                                                                                                                                                                         | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------------------------------------------------------|---------|---------------------------------|----------------|-------------------|---|---|---|----------------------|---|---|---|------------|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                                                                 |         |                                 |                | N                 | E | S | W | N                    | E | S | W |            |                          |                                                                                                                                                                                                                                                                                                                                                                                       |                                        |                          |      |
| Grp 9   | Pedunculate Oak<br>Scots Pine<br>Sweet Chestnut<br>Silver Birch | 18      | MS                              | 450            | -                 | - | - | - | -                    | - | - | - | EM         | Fair                     | Fair<br>Major deadwood in crowns<br>Overhead cables running through the group on east side<br>Provides screening from the adjacent residential estate<br>Previously crown lifted to poor standard with branch stubs left<br>Some trees previously crown reduced on west side of group<br>Trunk and crown shapes distorted due to group pressure<br>Epicormics on trunks and in crowns | Remove deadwood                        | 20+                      | C1+2 |
| Grp 10  | Sweet Chestnut<br>Goat Willow<br>Silver Birch                   | 8       | S                               | 140            | -                 | - | - | - | -                    | - | - | - | SM         | Good                     | Fair<br>Natural regeneration<br>Trunk and crown shapes distorted due to group pressure<br>Minor deadwood in crowns                                                                                                                                                                                                                                                                    | No works required at time of survey    | 10+                      | C1   |
| Grp 11  | Pedunculate Oak                                                 | 18      | S                               | 300            | -                 | - | - | - | -                    | - | - | - | SM         | Good                     | Fair<br>Growing on bank<br>Trunk and crown shapes distorted due to group pressure<br>Ivy on trunks<br>Minor deadwood in crowns<br>Low hanging branches                                                                                                                                                                                                                                | No works required at time of survey    | 20+                      | C1+2 |

| Tree No | Species         | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |   |   |   | H't of Crown AGL (m) |   |   |   | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                      | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------|---------|---------------------------------|----------------|-------------------|---|---|---|----------------------|---|---|---|------------|--------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                 |         |                                 |                | N                 | E | S | W | N                    | E | S | W |            |                          |                                                                                                                                                                                                                                    |                                        |                          |      |
| Grp 12  | Cherry Laurel   | 7       | MS                              | 250            | -                 | - | - | - | -                    | - | - | - | M          | Fair                     | Fair<br>Trunk and crown shapes distorted due to group pressure<br>Multi-stemmed at ground level<br>Some stems in decline<br>Low hanging branches<br>Regeneration of Oak within                                                     | No works required at time of survey    | 10+                      | C2   |
| Grp 13  | Norway Spruce   | 21      | MS                              | 470            | -                 | - | - | - | -                    | - | - | - | EM         | Fair                     | Fair<br>Growing on bank<br>Two dead trees within group<br>Ivy on trunks and in crowns on some trees<br>Minor deadwood in crowns                                                                                                    | Remove 2x dead trees                   | 20+                      | C1+2 |
| Grp 14  | Cherry Laurel   | 6       | S                               | 120            | -                 | - | - | - | -                    | - | - | - | SM         | Good                     | Fair<br>Natural regeneration<br>Low hanging branches<br>Trunk and crown shapes distorted due to group pressure<br>Understorey                                                                                                      | No works required at time of survey    | 10+                      | C1+2 |
| H1      | Lawson Cypress  | 10      | S                               | 250            | -                 | - | - | - | -                    | - | - | - | SM         | Fair                     | Fair<br>Offsite<br>Laurel understorey<br>One dead Ash tree within                                                                                                                                                                  | No works required at time of survey    | 40+                      | C1   |
| H2      | Leyland Cypress | 15      | MS                              | 460            | -                 | - | - | - | -                    | - | - | - | M          | Fair                     | Fair<br>Growing on top of bank<br>Ivy on trunks<br>Linear group planted for screening<br>Crown shapes distorted due to group pressure<br>Low hanging branches<br>Minor deadwood in crowns<br>Some multi-stemmed at various heights | No works required at time of survey    | 20+                      | C1   |

| Tree No | Species                                                                         | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |   |   |   | H't of Crown<br>AGL<br>(m) |   |   |   | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat |
|---------|---------------------------------------------------------------------------------|------------|-------------------------------------------|----------------------|-------------------------|---|---|---|----------------------------|---|---|---|---------------|---------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|-----|
|         |                                                                                 |            |                                           |                      | N                       | E | S | W | N                          | E | S | W |               |                                 |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |                                              |                                   |     |
| W1      | Scots Pine<br>Silver Birch<br>Pedunculate Oak<br>Common Beech<br>Sweet Chestnut | 20         | S                                         | 400                  | -                       | - | - | - | -                          | - | - | - | -             | Good                            | Good<br>Growing on historic quarry pit<br>banking<br>Tall and etiolated due to group<br>pressure<br>Crown shapes distorted due to<br>group pressure<br>Bark wounds on some trunks<br>Deadwood and stubs<br>Goat Willow and Buddleia grow<br>on northern edge of woodland<br>adjacent to existing site works<br>Ground levels undulate<br>throughout<br>Beech, Cypress, Sweet<br>Chestnut, Oak and Birch<br>beginning to develop in north<br>west wing of woodland<br>Sporadic broadleaf trees<br>throughout but predominantly<br>coniferous trees<br>Understorey of Rhododendron<br>developing and limiting survey | No works required at time<br>of survey       | 40+                               | B2  |
| W1.1    | Pine                                                                            | -          | S                                         | 480                  | -                       | - | - | - | -                          | - | - | - | M             | -                               | -                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | No works required at time<br>of survey       | 40+                               | C1  |
| W1.2    | Pine                                                                            | -          | S                                         | 450                  | -                       | - | - | - | -                          | - | - | - | M             | -                               | -                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | No works required at time<br>of survey       | 40+                               | C1  |
| W1.3    | Pine                                                                            | -          | S                                         | 380                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | No works required at time<br>of survey       | 40+                               | C1  |
| W1.4    | Pine                                                                            | -          | S                                         | 270                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | No works required at time<br>of survey       | 10+                               | C1  |
| W1.5    | Pine                                                                            | -          | S                                         | 510                  | -                       | - | - | - | -                          | - | - | - | M             | -                               | -                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | No works required at time<br>of survey       | 40+                               | C1  |
| W1.6    | Pine                                                                            | -          | S                                         | 380                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | No works required at time<br>of survey       | 40+                               | C1  |

| Tree No | Species    | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |   |   |   | H't of Crown AGL (m) |   |   |   | Life Stage | Physio-logical Condition | Structural Condition and General Observations | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat |
|---------|------------|---------|---------------------------------|----------------|-------------------|---|---|---|----------------------|---|---|---|------------|--------------------------|-----------------------------------------------|----------------------------------------|--------------------------|-----|
|         |            |         |                                 |                | N                 | E | S | W | N                    | E | S | W |            |                          |                                               |                                        |                          |     |
| W1.7    | Pine       | -       | S                               | 330            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.8    | Pine       | -       | MS<5                            | 460            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.9    | Pine       | -       | S                               | 370            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.10   | Pine       | -       | S                               | 490            | -                 | - | - | - | -                    | - | - | - | M          | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.11   | Pine       | -       | S                               | 260            | -                 | - | - | - | -                    | - | - | - | SM         | -                        | -                                             | No works required at time of survey    | <10                      | U   |
| W1.12   | Pine       | -       | S                               | 350            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.13   | Pine       | -       | S                               | 390            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.14   | Pine       | -       | S                               | 370            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.15   | Pine       | -       | MS<5                            | 630            | -                 | - | - | - | -                    | - | - | - | M          | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.16   | Pine       | -       | S                               | 390            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.17   | Pine       | -       | S                               | 510            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.18   | Pine       | -       | S                               | 520            | -                 | - | - | - | -                    | - | - | - | M          | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.19   | Pine       | -       | S                               | 500            | -                 | - | - | - | -                    | - | - | - | M          | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.20   | Scots Pine | -       | S                               | 390            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.21   | Scots Pine | -       | MS<5                            | 370            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.22   | Pine       | -       | S                               | 390            | -                 | - | - | - | -                    | - | - | - | M          | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.23   | Pine       | -       | S                               | 360            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.24   | Pine       | -       | S                               | 290            | -                 | - | - | - | -                    | - | - | - | SM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.25   | Pine       | -       | S                               | 290            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |
| W1.26   | Pine       | -       | S                               | 320            | -                 | - | - | - | -                    | - | - | - | EM         | -                        | -                                             | No works required at time of survey    | 40+                      | C1  |

| Tree No | Species     | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |   |   |   | H't of Crown<br>AGL<br>(m) |   |   |   | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat |
|---------|-------------|------------|-------------------------------------------|----------------------|-------------------------|---|---|---|----------------------------|---|---|---|---------------|---------------------------------|--------------------------------------------------------|----------------------------------------------|-----------------------------------|-----|
|         |             |            |                                           |                      | N                       | E | S | W | N                          | E | S | W |               |                                 |                                                        |                                              |                                   |     |
| W1.27   | Pine        | -          | S                                         | 300                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.28   | Pine        | -          | S                                         | 340                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.29   | Pine        | -          | S                                         | 450                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.30   | Pine        | -          | S                                         | 260                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.31   | Pine        | -          | S                                         | 360                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.32   | Pine        | -          | S                                         | 310                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.33   | Pine        | -          | MS<5                                      | 350                  | -                       | - | - | - | -                          | - | - | - | SM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.34   | Pine        | -          | S                                         | 350                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.35   | Pine        | -          | S                                         | 350                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.36   | Pine        | -          | S                                         | 290                  | -                       | - | - | - | -                          | - | - | - | SM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.37   | Goat Willow | -          | S                                         | 300                  | -                       | - | - | - | -                          | - | - | - | SM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.38   | Pine        | -          | S                                         | 340                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.39   | Pine        | -          | S                                         | 410                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.40   | Willow      | -          | S                                         | 420                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.41   | Pine        | -          | S                                         | 450                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.42   | Pine        | -          | S                                         | 460                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.43   | Pine        | -          | S                                         | 360                  | -                       | - | - | - | -                          | - | - | - | EM            | -                               | -                                                      | No works required at time of survey          | 40+                               | C1  |
| W1.44   | Pine        | -          | S                                         | 510                  | -                       | - | - | - | -                          | - | - | - | M             | -                               | -                                                      | No works required at time of survey          | 40+                               | B1  |

| Tree No     | Species                                                | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |     |     |     | H't of Crown<br>AGL<br>(m) |      |      |      | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                                                                                                                             | Preliminary<br>Management<br>Recommendations  | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|-------------|--------------------------------------------------------|------------|-------------------------------------------|----------------------|-------------------------|-----|-----|-----|----------------------------|------|------|------|---------------|---------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------|-----------------------------------|------|
|             |                                                        |            |                                           |                      | N                       | E   | S   | W   | N                          | E    | S    | W    |               |                                 |                                                                                                                                                                                                                                                    |                                               |                                   |      |
| W2A<br>TPO  | Silver Birch<br>Willow<br>Cherry Laurel<br>Goat Willow | 12         | S                                         | 200                  | -                       | -   | -   | -   | -                          | -    | -    | -    | SM            | Good                            | Fair<br>Understorey to more dominant trees<br>Trunk and crown shape distorted due to woodland environment<br>Silver Birch dominant<br>Small clusters of Cherry Laurel<br>Several open spaces within group<br>Forms part of overall woodland        | No works required at time of survey           | 20+                               | C1+2 |
| W2.1<br>TPO | Lawson Cypress                                         | 14         | S                                         | Est 330              | 3.0                     | 3.0 | 3.0 | 3.0 | 3.0                        | 2.5  | 2.0  | 3.0  | EM            | Good                            | Fair<br>Offsite<br>Unable to verify health and safety due to no access<br>Growing beneath T20                                                                                                                                                      | No works required at time of survey           | 20+                               | C1+2 |
| W2.2<br>TPO | Pedunculate Oak                                        | 21         | S                                         | 640                  | 6.0                     | 6.0 | 7.0 | 4.0 | 7.0                        | 6.0  | 8.0  | 7.0  | M             | Good                            | Good<br>Epicormics on trunk and in crown<br>Major deadwood in crown but no significant target<br>One dead limb rubbing on W2.3<br>Exudation present from minor wound on stem<br>Crown shape distorted due to woodland environment<br>Weighted east | Reduce rubbing limb back 3.5m to growth point | 40+                               | B1+2 |
| W2.3<br>TPO | Scots Pine                                             | 21         | S                                         | 650                  | 5.0                     | 4.0 | 6.0 | 5.0 | 13.0                       | 13.0 | 13.0 | 13.0 | M             | Good                            | Fair<br>Bifurcated at 5m above ground level<br>Tight forks with included bark<br>Stem fused 0.5m above union<br>Rubbing wound on north side of western trunk                                                                                       | No works required at time of survey           | 20+                               | C1+2 |

| Tree No     | Species         | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |     |     |     | H't of Crown<br>AGL<br>(m) |      |      |      | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                                                                                                     | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|-------------|-----------------|------------|-------------------------------------------|----------------------|-------------------------|-----|-----|-----|----------------------------|------|------|------|---------------|---------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|------|
|             |                 |            |                                           |                      | N                       | E   | S   | W   | N                          | E    | S    | W    |               |                                 |                                                                                                                                                                                                                            |                                              |                                   |      |
| W2.4<br>TPO | Scots Pine      | 17         | S                                         | 560                  | 2.5                     | 4.0 | 5.0 | 3.0 | 14.0                       | 9.0  | 8.0  | 8.0  | M             | Good                            | Good<br>Trunk shape distorted due to<br>woodland environment<br>Deadwood and stubs                                                                                                                                         | No works required at time<br>of survey       | 40+                               | B1+2 |
| W2.5<br>TPO | Aspen           | 20         | S                                         | 530                  | 6.0                     | 5.0 | 5.0 | 6.0 | 9.0                        | 10.0 | 9.0  | 7.0  | EM            | Good                            | Good<br>Bifurcated at 10m above<br>ground level<br>Minor deadwood in crown                                                                                                                                                 | No works required at time<br>of survey       | 40+                               | B1+2 |
| W2.6<br>TPO | Pedunculate Oak | 20         | S                                         | 510                  | 6.0                     | 6.0 | 6.0 | 5.0 | 4.0                        | 6.0  | 4.0  | 6.0  | M             | Good                            | Fair<br>Crown shape distorted due to<br>woodland environment<br>Small bark wound present at<br>base<br>Major deadwood in crown but<br>no significant target<br>Epicormics in crown                                         | No works required at time<br>of survey       | 40+                               | B1+2 |
| W2.7<br>TPO | Pedunculate Oak | 22         | S                                         | 640                  | 6.0                     | 7.0 | 6.0 | 8.0 | 4.0                        | 6.0  | 4.0  | 6.0  | M             | Good                            | Fair<br>Crown shape distorted due to<br>woodland environment<br>Major deadwood in crown but<br>no significant target<br>Epicormics in crown                                                                                | No works required at time<br>of survey       | 40+                               | B1+2 |
| W2.8<br>TPO | Pedunculate Oak | 24         | S                                         | 650                  | 8.0                     | 8.0 | 7.0 | 8.0 | 6.0                        | 6.0  | 6.0  | 6.0  | M             | Good                            | Fair<br>Crown shape distorted due to<br>woodland environment<br>Understorey limits survey of<br>crown<br>Epicormics in crown                                                                                               | No works required at time<br>of survey       | 40+                               | B1+2 |
| W2.9<br>TPO | Pedunculate Oak | 25         | S                                         | 620                  | 6.0                     | 4.0 | 6.0 | 8.5 | 7.0                        | 10.0 | 12.0 | 10.0 | M             | Good                            | Fair<br>Crown shape distorted due to<br>woodland environment<br>Major deadwood in crown but<br>no significant target<br>Epicormics in crown<br>Weighted west<br>Minor cavity with decay present<br>on the side of buttress | No works required at time<br>of survey       | 40+                               | B1+2 |

| Tree No   | Species                                                                                                                            | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |      |     | H't of Crown AGL (m) |      |      |      | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                                                   | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|-----------|------------------------------------------------------------------------------------------------------------------------------------|---------|---------------------------------|----------------|-------------------|-----|------|-----|----------------------|------|------|------|------------|--------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
| W2.10 TPO | Pedunculate Oak                                                                                                                    | 23      | S                               | 590            | 5.0               | 4.0 | 5.0  | 8.0 | 10.0                 | 10.0 | 12.0 | 10.0 | M          | Good                     | Fair<br>Trunk and crown shape distorted due to woodland environment<br>Major deadwood in crown but no significant target<br>Epicormics on trunk<br>Weighted west                                                                                                | No works required at time of survey    | 40+                      | B1+2 |
| W2.11 TPO | Pedunculate Oak                                                                                                                    | 23      | S                               | 580            | 6.0               | 6.0 | 5.0  | 5.0 | 7.0                  | 7.0  | 7.0  | 7.0  | M          | Good                     | Good<br>Understorey limits survey of crown<br>Major deadwood in crown but no significant target<br>Epicormics in crown                                                                                                                                          | No works required at time of survey    | 40+                      | B1+2 |
| W2B TPO   | Goat Willow<br>Cherry Laurel<br>Silver Birch<br>Norway Spruce<br>Western Red Cedar<br>Hazel<br>Holly<br>Beech<br>Yew<br>Scots Pine | 14      | S                               | 250            | -                 | -   | -    | -   | -                    | -    | -    | -    | SM         | Good                     | Fair<br>Understorey to more dominant trees<br>Trunk and crown shape distorted due to group pressure due to woodland environment<br>Dominated at low level by Laurel<br>Forms part of overall woodland<br>Several windblown trees or dead standing stumps within | No works required at time of survey    | 20+                      | C1+2 |
| W2.12 TPO | Pedunculate Oak                                                                                                                    | 26      | S                               | 650            | 7.0               | 8.0 | 10.0 | 7.0 | 8.0                  | 8.0  | 8.0  | 8.0  | M          | Good                     | Fair<br>Two trees growing as one<br>Trunk shape distorted due to woodland environment<br>Major deadwood in crown but no significant target<br>Understorey limits survey of crown                                                                                | No works required at time of survey    | 40+                      | B1+2 |

| Tree No      | Species         | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |     |     |     | H't of Crown<br>AGL<br>(m) |      |      |      | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                                                                                                                                   | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|--------------|-----------------|------------|-------------------------------------------|----------------------|-------------------------|-----|-----|-----|----------------------------|------|------|------|---------------|---------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|------|
|              |                 |            |                                           |                      | N                       | E   | S   | W   | N                          | E    | S    | W    |               |                                 |                                                                                                                                                                                                                                                          |                                              |                                   |      |
| W2.13<br>TPO | Pedunculate Oak | 26         | S                                         | 830                  | 4.0                     | 6.0 | 7.0 | 6.0 | 10.0                       | 10.0 | 10.0 | 10.0 | M             | Good                            | Fair<br>Trunk and crown shape distorted due to woodland environment<br>Leans and weighted east<br>Trifurcated at 7m above ground level<br>Major deadwood in crown but no significant target<br>Epicormics in crown<br>Understorey limits survey of crown | No works required at time of survey          | 40+                               | A1+2 |
| W2.14<br>TPO | Scots Pine      | 26         | S                                         | 720                  | 5.0                     | 8.0 | 8.0 | 5.0 | 6.0                        | 6.0  | 6.0  | 6.0  | M             | Good                            | Fair<br>Bifurcated at 2.5m above ground level<br>Leans and weighted south east<br>Deadwood and stubs but no significant target<br>Understorey limits survey of crown                                                                                     | No works required at time of survey          | 20+                               | B1+2 |
| W2.15<br>TPO | Pedunculate Oak | 26         | S                                         | 870                  | 8.0                     | 8.0 | 8.0 | 8.0 | 6.0                        | 6.0  | 6.0  | 6.0  | M             | Good                            | Fair<br>Trifurcated at 6m above ground level<br>Ivy on trunk and in crown<br>Major deadwood in crown but no significant target<br>Epicormics in crown<br>Understorey limits survey of crown                                                              | No works required at time of survey          | 40+                               | A1+2 |

| Tree No      | Species         | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |     |      |     | H't of Crown<br>AGL<br>(m) |     |     |     | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                                                                                                                                                        | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|--------------|-----------------|------------|-------------------------------------------|----------------------|-------------------------|-----|------|-----|----------------------------|-----|-----|-----|---------------|---------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|------|
|              |                 |            |                                           |                      | N                       | E   | S    | W   | N                          | E   | S   | W   |               |                                 |                                                                                                                                                                                                                                                                               |                                              |                                   |      |
| W2.16<br>TPO | Pedunculate Oak | 26         | S                                         | 960                  | 10.0                    | 7.0 | 9.0  | 7.0 | 6.0                        | 6.0 | 6.0 | 6.0 | M             | Good                            | Fair<br>Woodland edge tree<br>Crown shape distorted due to woodland environment<br>Roadside tree<br>Bifurcated at 4m above ground level<br>Tight forks with included bark<br>Storm damage and branch tear wound in crown<br>Major deadwood in crown but no significant target | No works required at time of survey          | 40+                               | A1+2 |
| W2.17<br>TPO | Pedunculate Oak | 22         | S                                         | 720                  | 1.0                     | 3.0 | 10.0 | 1.0 | 10.0                       | 9.0 | 7.0 | 7.0 | M             | Good                            | Fair<br>Woodland edge tree<br>Crown shape distorted due to woodland environment<br>Roadside tree<br>Heavily weighted south<br>Major deadwood in crown but no significant target<br>Epicormics in crown                                                                        | No works required at time of survey          | 10+                               | C1+2 |
| W2.18<br>TPO | Pedunculate Oak | 17         | S                                         | 350                  | 1.0                     | 1.0 | 1.0  | 1.0 | 6.0                        | 6.0 | 6.0 | 6.0 | SM            | Poor                            | Poor<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to woodland environment<br>Apical dieback<br>Major deadwood in crown<br>Epicormics on trunk                                                                                                          | Advise removal                               | <10                               | U    |

| Tree No      | Species         | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |      |      |     | H't of Crown AGL (m) |     |      |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                                                                                                   | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|--------------|-----------------|---------|---------------------------------|----------------|-------------------|------|------|-----|----------------------|-----|------|-----|------------|--------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
| N            | E               | S       | W                               | N              | E                 | S    | W    | N   | E                    | S   | W    |     |            |                          |                                                                                                                                                                                                                                                                                                                 |                                        |                          |      |
| W2.19<br>TPO | Pedunculate Oak | 25      | S                               | 980            | 12.0              | 11.0 | 12.0 | 7.0 | 6.0                  | 7.0 | 8.0  | 8.0 | M          | Good                     | Fair<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to woodland environment<br>Trifurcated at 4m above ground level<br>Bark wound on upper sides of main branches with possible stress/ loading cracks<br>Major deadwood in crown but no significant target<br>Old pruning wounds in crown | Crown reduce by 4-5m                   | 10+                      | C1+2 |
| W2.20<br>TPO | Pedunculate Oak | 24      | S                               | 650            | 12.0              | 5.0  | 4.0  | 6.0 | 8.0                  | 8.0 | 12.0 | 8.0 | M          | Good                     | Fair<br>Woodland edge tree<br>Roadside tree<br>Trunk and crown shape distorted due to woodland environment<br>Major deadwood in crown<br>Leans and weighted north<br>Growing with W2.21                                                                                                                         | Remove deadwood over road              | 20+                      | B1+2 |
| W2.21<br>TPO | Pedunculate Oak | 23      | S                               | 600            | 4.0               | 5.0  | 8.0  | 6.0 | 10.0                 | 3.0 | 8.0  | 8.0 | M          | Good                     | Fair<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to woodland environment<br>Growing with W2.20<br>Small stem to north decayed<br>Crown weighted south                                                                                                                                   | Remove small stem to north             | 20+                      | B1+2 |

| Tree No      | Species         | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |      |     |     | H't of Crown AGL (m) |     |     |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                        | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|--------------|-----------------|---------|---------------------------------|----------------|-------------------|------|-----|-----|----------------------|-----|-----|-----|------------|--------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|              |                 |         |                                 |                | N                 | E    | S   | W   | N                    | E   | S   | W   |            |                          |                                                                                                                                                                                                                                      |                                        |                          |      |
| W2.22<br>TPO | Pedunculate Oak | 14      | S                               | 420            | 5.0               | 2.0  | 4.0 | 3.0 | 3.0                  | 3.0 | 3.0 | 4.0 | SM         | Good                     | Fair<br>Woodland edge tree<br>Trunk and crown shape distorted due to woodland environment<br>Roadside tree<br>Epicormics on trunk and in crown<br>Historically snapped crown at 12m                                                  | No works required at time of survey    | 10+                      | C1+2 |
| W2.23<br>TPO | Pedunculate Oak | 25      | S                               | 980            | 9.0               | 10.0 | 9.0 | 7.0 | 7.0                  | 8.0 | 7.0 | 7.0 | M          | Good                     | Fair<br>Woodland edge tree<br>Crown shape distorted due to woodland environment<br>Roadside tree<br>Old pruning wounds on trunk<br>Major deadwood in crown<br>Storm damage and branch tear wound in crown                            | Remove deadwood over road              | 40+                      | A1+2 |
| W2.24<br>TPO | Pedunculate Oak | 20      | S                               | 510            | 3.0               | 2.0  | 7.0 | 4.0 | 8.0                  | 8.0 | 8.0 | 8.0 | M          | Good                     | Fair<br>Woodland edge tree<br>Crown shape distorted due to woodland environment<br>Roadside tree<br>Epicormics on trunk and in crown<br>Major deadwood in crown but no significant target                                            | No works required at time of survey    | 20+                      | B1+2 |
| W2.25<br>TPO | Pedunculate Oak | 22      | S                               | 560            | 6.0               | 4.0  | 7.0 | 4.0 | 5.0                  | 5.0 | 5.0 | 5.0 | M          | Good                     | Fair<br>Woodland edge tree<br>Crown shape distorted due to woodland environment<br>Roadside tree<br>Bifurcated at 6m above ground level<br>Growing on bank<br>Branch tear wound and storm damage in crown<br>Major deadwood in crown | Remove deadwood over road              | 20+                      | B1+2 |

| Tree No      | Species         | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |     |     |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                                                                                        | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|--------------|-----------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|-----|-----|-----|------------|--------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|              |                 |         |                                 |                | N                 | E   | S   | W   | N                    | E   | S   | W   |            |                          |                                                                                                                                                                                                                                                                                      |                                        |                          |      |
| W2.26<br>TPO | Pedunculate Oak | 24      | S                               | 710            | 3.0               | 5.0 | 7.0 | 5.0 | 8.0                  | 8.0 | 8.0 | 8.0 | M          | Good                     | Fair<br>Woodland edge tree<br>Crown shape distorted due to woodland environment<br>Roadside tree<br>Understorey limits survey of crown<br>Growing on bank<br>Weighted south                                                                                                          | No works required at time of survey    | 20+                      | B1+2 |
| W2.27<br>TPO | Pedunculate Oak | 21      | S                               | 720            | 6.0               | 4.0 | 7.0 | 7.0 | 6.0                  | 6.0 | 6.0 | 6.0 | M          | Good                     | Fair<br>Woodland edge tree<br>Crown shape distorted due to woodland environment<br>Roadside tree<br>Bifurcated at 6m above ground level<br>Ivy on trunk and in crown<br>Growing on bank<br>Major deadwood in crown but no significant target                                         | No works required at time of survey    | 20+                      | B1+2 |
| W2.28<br>TPO | Pedunculate Oak | 18      | S                               | 660            | 7.0               | 5.0 | 7.0 | 7.0 | 4.0                  | 5.0 | 6.0 | 5.0 | M          | Fair                     | Fair<br>Woodland edge tree<br>Crown shape distorted due to woodland environment<br>Roadside tree<br>Ivy on trunk and in crown<br>Growing on bank<br>Storm damage and branch tear wound in upper crown<br>Major deadwood in crown but no significant target<br>Apical dieback forming | No works required at time of survey    | 20+                      | C1+2 |
| W2.29<br>TPO | Douglas Fir     | 22      | S                               | 420            | 4.0               | 4.0 | 4.0 | 4.0 | 4.0                  | 4.0 | 4.0 | 4.0 | EM         | Good                     | Good<br>Woodland edge tree<br>Deadwood and stubs                                                                                                                                                                                                                                     | No works required at time of survey    | 20+                      | B1+2 |

| Tree No      | Species    | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |     |     |     | H't of Crown<br>AGL<br>(m) |      |     |     | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                      | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|--------------|------------|------------|-------------------------------------------|----------------------|-------------------------|-----|-----|-----|----------------------------|------|-----|-----|---------------|---------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|------|
|              |            |            |                                           |                      | N                       | E   | S   | W   | N                          | E    | S   | W   |               |                                 |                                                                                                                                             |                                              |                                   |      |
| W2.30<br>TPO | Scots Pine | 16         | S                                         | 280                  | 1.0                     | 2.0 | 4.0 | 3.0 | 8.0                        | 8.0  | 8.0 | 8.0 | SM            | Fair                            | Good<br>Woodland edge tree<br>Ivy on trunk and in crown<br>Deadwood and stubs<br>Understorey limits survey of crown                         | No works required at time of survey          | 20+                               | C1+2 |
| W2.31<br>TPO | Scots Pine | 20         | S                                         | 360                  | 3.0                     | 3.0 | 2.0 | 2.0 | 8.0                        | 8.0  | 8.0 | 8.0 | EM            | Good                            | Good<br>Woodland edge tree<br>Understorey limits survey of crown<br>Ivy on trunk and in crown<br>Deadwood and stubs                         | No works required at time of survey          | 20+                               | B1+2 |
| W2.32<br>TPO | Scots Pine | 22         | S                                         | 510                  | 5.0                     | 3.0 | 3.0 | 5.0 | 6.0                        | 5.0  | 5.0 | 5.0 | M             | Good                            | Good<br>Woodland edge tree<br>Crown shape distorted due to woodland environment<br>Deadwood and stubs<br>Understorey limits survey of crown | No works required at time of survey          | 40+                               | B1+2 |
| W2.33<br>TPO | Scots Pine | 18         | S                                         | 530                  | 3.0                     | 3.0 | 4.0 | 4.0 | 10.0                       | 10.0 | 5.0 | 5.0 | M             | Good                            | Good<br>Woodland edge tree<br>Understorey limits survey of crown<br>Deadwood and stubs<br>Crown shape distorted due to woodland environment | No works required at time of survey          | 20+                               | B1+2 |
| W2.34<br>TPO | Scots Pine | 18         | S                                         | 530                  | 3.0                     | 3.0 | 5.0 | 4.0 | 8.0                        | 8.0  | 8.0 | 8.0 | M             | Good                            | Good<br>Woodland edge tree<br>Understorey limits survey of crown<br>Deadwood and stubs<br>Crown shape distorted due to woodland environment | No works required at time of survey          | 20+                               | B1+2 |

| Tree No      | Species         | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |     |     |     | H't of Crown<br>AGL<br>(m) |     |     |     | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                                                                   | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|--------------|-----------------|------------|-------------------------------------------|----------------------|-------------------------|-----|-----|-----|----------------------------|-----|-----|-----|---------------|---------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|------|
|              |                 |            |                                           |                      | N                       | E   | S   | W   | N                          | E   | S   | W   |               |                                 |                                                                                                                                                                                          |                                              |                                   |      |
| W2.35<br>TPO | Pedunculate Oak | 23         | S                                         | 520                  | 6.0                     | 4.0 | 6.0 | 6.0 | 6.0                        | 6.0 | 6.0 | 6.0 | EM            | Good                            | Fair<br>Bark wound at 1.3m to 1.5m<br>above ground level on north<br>west side of trunk<br>Understorey limits survey of<br>crown<br>Major deadwood in crown but<br>no significant target | No works required at time<br>of survey       | 20+                               | B1+2 |
| W2.36<br>TPO | Silver Birch    | 16         | MS<5                                      | 420                  | 5.0                     | 3.0 | 4.0 | 5.0 | 3.0                        | 3.0 | 3.0 | 3.0 | EM            | Good                            | Fair<br>Woodland edge tree<br>Bifurcated at 0.5m above<br>ground level<br>Minor deadwood in crown                                                                                        | No works required at time<br>of survey       | 40+                               | C1+2 |
| W2.37<br>TPO | Scots Pine      | 18         | S                                         | 460                  | 4.0                     | 2.0 | 2.0 | 4.0 | 8.0                        | 8.0 | 8.0 | 8.0 | M             | Good                            | Good<br>Crown shape distorted due to<br>group pressure<br>Growing with W2.38                                                                                                             | No works required at time<br>of survey       | 20+                               | B1+2 |
| W2.38<br>TPO | Scots Pine      | 18         | S                                         | 440                  | 4.0                     | 2.0 | 3.0 | 4.0 | 9.0                        | 9.0 | 9.0 | 9.0 | M             | Good                            | Good<br>Crown shape distorted due to<br>group pressure<br>Growing with W2.37                                                                                                             | No works required at time<br>of survey       | 20+                               | B1+2 |
| W2.39<br>TPO | European Larch  | 15         | S                                         | 180                  | 2.0                     | 2.0 | 3.0 | 5.0 | 6.0                        | 6.0 | 6.0 | 6.0 | SM            | Good                            | Good<br>Trunk and crown shape<br>distorted due to woodland<br>environment                                                                                                                | No works required at time<br>of survey       | 10+                               | C1+2 |
| W2.40<br>TPO | Scots Pine      | 18         | S                                         | 410                  | 3.0                     | 2.0 | 6.0 | 3.0 | 8.0                        | 8.0 | 8.0 | 8.0 | M             | Good                            | Good<br>Trunk and crown shape<br>distorted due to woodland<br>environment<br>Understorey limits survey of<br>crown<br>Deadwood and stubs                                                 | No works required at time<br>of survey       | 20+                               | B1+2 |

| Tree No | Species                                                                                                                                                                | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |      |     |     | H't of Crown<br>AGL<br>(m) |     |     |   | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                                                                                                                                                                                                                    | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|---------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|-------------------------------------------|----------------------|-------------------------|------|-----|-----|----------------------------|-----|-----|---|---------------|---------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|------|
|         |                                                                                                                                                                        |            |                                           |                      | N                       | E    | S   | W   | N                          | E   | S   | W |               |                                 |                                                                                                                                                                                                                                                                                                                                           |                                              |                                   |      |
| W3      | Crack Willow<br>Silver Birch<br>Sweet Chestnut<br>Hawthorn<br>Field Maple<br>Norway Spruce<br>Yew<br>Alder<br>Cherry Laurel<br>Ash<br>Sycamore<br>Holly<br>Goat Willow | 16         | S                                         | 350                  | -                       | -    | -   | -   | -                          | -   | -   | - | SM            | Fair                            | Fair<br>Tall and etiolated due to<br>woodland environment<br>Wetland area<br>Birch and Chestnut natural<br>regeneration of similar age with<br>drawn up growth habits<br>Numerous multi-stemmed trees<br>Multiple failed and windblown<br>fallen trees within group<br>Trunk and crown shapes<br>distorted due to woodland<br>environment | No works required at time<br>of survey       | 20+                               | C1+2 |
| W3A     | Goat Willow<br>Cherry Laurel<br>Silver Birch<br>Hawthorn                                                                                                               | 12         | S                                         | 350                  | -                       | -    | -   | -   | -                          | -   | -   | - | SM            | Fair                            | Fair<br>Willow and Cherry Laurel<br>dominant<br>Wetland area<br>Several Willows partially failed<br>and fallen at base over low risk<br>target area<br>Trunk and crown shape<br>distorted due to woodland<br>environment<br>Major deadwood in crowns but<br>no significant target                                                         | No works required at time<br>of survey       | 10+                               | C1+2 |
| W3.1    | Crack Willow                                                                                                                                                           | 12         | MS<5                                      | 480                  | 0.0                     | 10.0 | 5.0 | 0.0 | -                          | 6.0 | 5.0 | - | M             | Fair                            | Poor<br>Woodland tree<br>Trunk and crown shape<br>distorted due to woodland<br>environment<br>Heavily leans and weighted<br>east<br>Multi-stemmed by 1m above<br>ground level<br>Root plate lifted                                                                                                                                        | Fell to ground level                         | <10                               | U    |

| Tree No | Species         | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |     |     |     | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                       | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|-----|-----|-----|------------|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                 |         |                                 |                | N                 | E   | S   | W   | N                    | E   | S   | W   |            |                          |                                                                                                                                                                                                                     |                                        |                          |      |
| W3.2    | Ash             | 16      | S                               | 290            | 3.0               | 3.0 | 3.0 | 3.0 | 8.0                  | 8.0 | 8.0 | 8.0 | EM         | Good                     | Fair<br>Woodland edge tree<br>Tall and etiolated due to woodland pressure<br>East stem previously reduced<br>Old pruning wounds on trunk and in crown<br>Minor deadwood in crown                                    | No works required at time of survey    | 10+                      | C1+2 |
| W3.3    | Silver Birch    | 14      | S                               | 370            | 1.0               | 2.0 | 3.0 | 4.0 | 4.0                  | 4.0 | 4.0 | 4.0 | EM         | Dead                     | Dead<br>Ivy on trunk and in crown<br>Crown shape distorted due to woodland environment                                                                                                                              | Advise removal                         | <10                      | U    |
| W3.4    | Goat Willow     | 12      | MS<5                            | 330            | 2.0               | 4.0 | 2.0 | 3.0 | 5.0                  | 5.0 | 5.0 | 5.0 | EM         | Fair                     | Fair<br>Bifurcated at 1m above ground level<br>Ivy on trunk and in crown<br>Crown shape distorted due to woodland environment<br>Minor deadwood in crown                                                            | No works required at time of survey    | 10+                      | C1+2 |
| W3.5    | Pedunculate Oak | 20      | S                               | 710            | 5.0               | 7.0 | 7.0 | 4.0 | 8.0                  | 8.0 | 8.0 | 8.0 | M          | Good                     | Good<br>Major deadwood in crown but no significant target<br>Large buttress roots                                                                                                                                   | No works required at time of survey    | 40+                      | A1+2 |
| W3.6    | Pedunculate Oak | 21      | S                               | 570            | 4.0               | 7.0 | 3.0 | 4.0 | 9.0                  | 9.0 | 9.0 | 9.0 | M          | Fair                     | Fair<br>Major deadwood in crown but no significant target<br>East leaning stem with historic root plate lift to the west<br>Bifurcated at 6.5m above ground level<br>Bark wound at base on north west side of trunk | No works required at time of survey    | 10+                      | C1+2 |

| Tree No | Species         | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm)  | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |      |      |      | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                           | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------|---------|---------------------------------|-----------------|-------------------|-----|-----|-----|----------------------|------|------|------|------------|--------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |                 |         |                                 |                 | N                 | E   | S   | W   | N                    | E    | S    | W    |            |                          |                                                                                                                                                                                                         |                                        |                          |      |
| W3.7    | Pedunculate Oak | 19      | S                               | 570             | 8.0               | 3.0 | 6.0 | 6.0 | 6.0                  | 6.0  | 6.0  | 6.0  | M          | Good                     | Fair<br>Trunk and crown shape distorted due to woodland environment<br>Epicormics on trunk<br>Major deadwood in crown but no significant target                                                         | No works required at time of survey    | 20+                      | B1+2 |
| W3.8    | Pedunculate Oak | 24      | S                               | 750             | 8.0               | 6.0 | 6.0 | 7.0 | 10.0                 | 10.0 | 10.0 | 10.0 | M          | Good                     | Good<br>Large buttress roots<br>Tall and etiolated due to woodland environment<br>Major deadwood in crown but no significant target<br>Epicormics in crown                                              | No works required at time of survey    | 40+                      | B1+2 |
| W3.9    | Sweet Chestnut  | 18      | MS<5                            | 590             | 3.0               | 4.0 | 6.0 | 4.0 | 6.0                  | 2.0  | 3.0  | 4.0  | EM         | Fair                     | Poor<br>Bifurcated at ground level<br>Apical dieback with large deadwood over third party garden<br>Lateral limbs extend heavily over third party garden                                                | Advise removal                         | <10                      | U    |
| W3.10   | Pedunculate Oak | 18      | S                               | 490<br>over ivy | 6.0               | 7.0 | 7.0 | 5.0 | 8.0                  | 6.0  | 6.0  | 6.0  | M          | Good                     | Fair<br>Bifurcated at 5m above ground level<br>Ivy on trunk - previously cut/dead<br>Major deadwood in crown but no significant target                                                                  | No works required at time of survey    | 20+                      | B1+2 |
| W3B     | Crack Willow    | 15      | S                               | 430             | -                 | -   | -   | -   | -                    | -    | -    | -    | EM         | Fair                     | Fair<br>Group of tall Willows, previously topped by garden<br>Trunk and crown shape distorted due to woodland environment<br>Deadwood and multiple snapped limbs within crown but no significant target | No works required at time of survey    | 10+                      | C1+2 |

| Tree No | Species         | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm) | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |      |      |      | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                        | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|-----------------|---------|---------------------------------|----------------|-------------------|-----|-----|-----|----------------------|------|------|------|------------|--------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
| W3.11   | Pedunculate Oak | 25      | S                               | 830            | 7.0               | 7.0 | 8.0 | 8.0 | 4.0                  | 4.0  | 4.0  | 4.0  | M          | Good                     | Good<br>1.5m-3.0m bark wound on east side of trunk occluding<br>Major deadwood in crown<br>Epicormics on trunk and in crown<br>Wet ground at base and drainage ditch | Remove deadwood                        | 20+                      | B1+2 |
| W3.12   | Scots Pine      | 15      | S                               | 710            | 7.0               | 4.0 | 2.0 | 6.0 | 6.0                  | 8.0  | 10.0 | 8.0  | M          | Good                     | Good<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to woodland environment<br>Weighted north west<br>Deadwood and stubs                        | No works required at time of survey    | 20+                      | B1+2 |
| W3.13   | Scots Pine      | 19      | S                               | 560            | 4.0               | 4.0 | 4.0 | 5.0 | 15.0                 | 15.0 | 15.0 | 15.0 | M          | Good                     | Good<br>Woodland edge tree<br>Roadside tree<br>Deadwood and stubs                                                                                                    | No works required at time of survey    | 40+                      | A1+2 |
| W3.14   | Scots Pine      | 16      | S                               | 520            | 5.0               | 4.0 | 1.0 | 3.0 | 15.0                 | 15.0 | 15.0 | 15.0 | M          | Good                     | Good<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to woodland environment<br>Weighted north                                                   | No works required at time of survey    | 20+                      | B1+2 |
| W3.15   | Scots Pine      | 20      | S                               | 600            | 5.0               | 4.0 | 4.0 | 4.0 | 15.0                 | 15.0 | 15.0 | 15.0 | M          | Good                     | Good<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to woodland environment<br>Deadwood and stubs                                               | No works required at time of survey    | 40+                      | A1+2 |
| W3.16   | Scots Pine      | 20      | S                               | 530            | 4.0               | 3.0 | 2.0 | 3.0 | 8.0                  | 8.0  | 12.0 | 14.0 | M          | Good                     | Good<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to woodland environment<br>Deadwood and stubs                                               | No works required at time of survey    | 20+                      | B1+2 |

| Tree No | Species        | H't<br>(m) | Single/<br>Multi-<br>Stemmed<br>(S or MS) | Stem<br>Diam<br>(mm) | Branch<br>Spread<br>(m) |     |     |     | H't of Crown<br>AGL<br>(m) |      |      |      | Life<br>Stage | Physio-<br>logical<br>Condition | Structural<br>Condition<br>and<br>General Observations                                                                                                                                          | Preliminary<br>Management<br>Recommendations | Est.<br>Rem.<br>Contrib.<br>(Yrs) | Cat  |
|---------|----------------|------------|-------------------------------------------|----------------------|-------------------------|-----|-----|-----|----------------------------|------|------|------|---------------|---------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------|-----------------------------------|------|
|         |                |            |                                           |                      | N                       | E   | S   | W   | N                          | E    | S    | W    |               |                                 |                                                                                                                                                                                                 |                                              |                                   |      |
| W3.17   | Scots Pine     | 20         | S                                         | 760                  | 4.0                     | 6.0 | 5.0 | 4.0 | 10.0                       | 16.0 | 10.0 | 10.0 | M             | Good                            | Good<br>Woodland edge tree<br>Roadside tree<br>Leans east<br>Deadwood and stubs                                                                                                                 | No works required at time<br>of survey       | 40+                               | A1+2 |
| W3.18   | European Larch | 16         | S                                         | 410                  | 8.0                     | 5.0 | 1.0 | 3.0 | 5.0                        | 8.0  | 12.0 | 10.0 | EM            | Fair                            | Fair<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to<br>woodland environment<br>Weighted north<br>Deadwood and stubs<br>Prominent roadside tree<br>forming part of group | No works required at time<br>of survey       | 20+                               | C1+2 |
| W3.19   | Scots Pine     | 18         | S                                         | 620                  | 4.0                     | 4.0 | 2.0 | 3.0 | 7.0                        | 9.0  | 12.0 | 12.0 | M             | Good                            | Good<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to<br>woodland environment<br>Weighted north<br>Deadwood and stubs<br>Prominent roadside tree<br>forming part of group | No works required at time<br>of survey       | 20+                               | B1+2 |
| W3.20   | Sweet Chestnut | 15         | S                                         | 330                  | 8.0                     | 4.0 | 1.0 | 3.0 | 6.0                        | 6.0  | 6.0  | 6.0  | M             | Fair                            | Poor<br>North leaning stem towards<br>W3.19 and road<br>Bark wound present at base<br>Poor quality tree                                                                                         | Advise removal                               | 10+                               | U    |
| W3.21   | Scots Pine     | 21         | S                                         | 610                  | 8.0                     | 5.0 | 3.0 | 5.0 | 14.0                       | 14.0 | 14.0 | 14.0 | M             | Good                            | Fair<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to<br>woodland environment<br>Weighted north<br>Deadwood and stubs                                                     | No works required at time<br>of survey       | 20+                               | B1+2 |


| Tree No | Species    | H't (m) | Single/ Multi-Stemmed (S or MS) | Stem Diam (mm)  | Branch Spread (m) |     |     |     | H't of Crown AGL (m) |      |      |      | Life Stage | Physio-logical Condition | Structural Condition and General Observations                                                                                                                                                                    | Preliminary Management Recommendations | Est. Rem. Contrib. (Yrs) | Cat  |
|---------|------------|---------|---------------------------------|-----------------|-------------------|-----|-----|-----|----------------------|------|------|------|------------|--------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------|--------------------------|------|
|         |            |         |                                 |                 | N                 | E   | S   | W   | N                    | E    | S    | W    |            |                          |                                                                                                                                                                                                                  |                                        |                          |      |
| W3.22   | Scots Pine | 20      | S                               | 560             | 4.0               | 3.0 | 2.0 | 2.0 | 15.0                 | 15.0 | 15.0 | 15.0 | M          | Good                     | Fair<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to woodland environment<br>Deadwood and stubs<br>Bark wound on west side of trunk at 1.5m above ground level<br>Leans and weighted east | No works required at time of survey    | 20+                      | B1+2 |
| W3.23   | Scots Pine | 21      | S                               | 560<br>over ivy | 5.0               | 5.0 | 2.0 | 3.0 | 14.0                 | 14.0 | 14.0 | 14.0 | M          | Good                     | Good<br>Woodland edge tree<br>Roadside tree<br>Crown shape distorted due to woodland environment<br>Leans and weighted north east<br>Ivy on trunk and in crown limits survey<br>Understorey limits survey        | Sever ivy<br>Remove deadwood           | 20+                      | B1+2 |
| W3.24   | Common Ash | 18      | S                               | 350             | 5.0               | 3.0 | 3.0 | 5.0 | 5.0                  | 6.0  | 9.0  | 5.0  | EM         | Fair                     | Fair<br>Woodland edge tree<br>Ivy on trunk<br>Crown shape distorted due to woodland environment<br>Crown appears sparse - possible Ash Dieback<br>Ditch line tree                                                | Review August 2025                     | 10+                      | C1+2 |



**CBA Trees**  
Chesil House, Arrow Close  
Boyatt Wood, Hampshire, SO50 4SY  
Tel: 02380 986229 Email: info@cbatrees.co.uk  
Website: www.cbatrees.co.uk



**10637**  
**Rock Road, Storrington, West Sussex**  
**Tree Survey Plan**

|                                           |                                     |
|-------------------------------------------|-------------------------------------|
| <b>SCALE :</b><br>1 : 500 @ A0            | <b>DATE :</b><br>27/03/2025         |
| <b>MAP FILENAME :</b><br>CBA10637.01A TSP | <b>BASE PLAN:</b><br>22664<br>32301 |

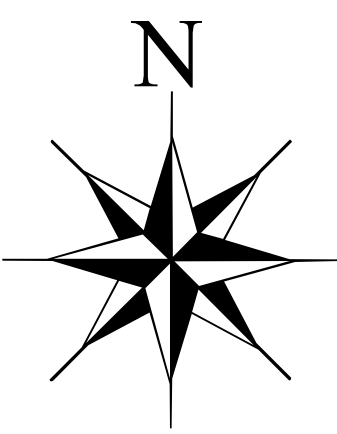


Pear Technology Services Ltd; Email info@peartechnology.co.uk  
Maps based on Ordnance Survey MasterMap or 1:25000 Mid-scale data with  
the permission of the Controller of HMSO. © Crown Copyright

1. Shading Arcs not shown on this plan.
2. Root Protection Areas are shown as a theoretical polygon and at this stage do not take into account site features and constraints.
3. Trees marked with \* and hedge, groups and woodland outlines are indicatively plotted.

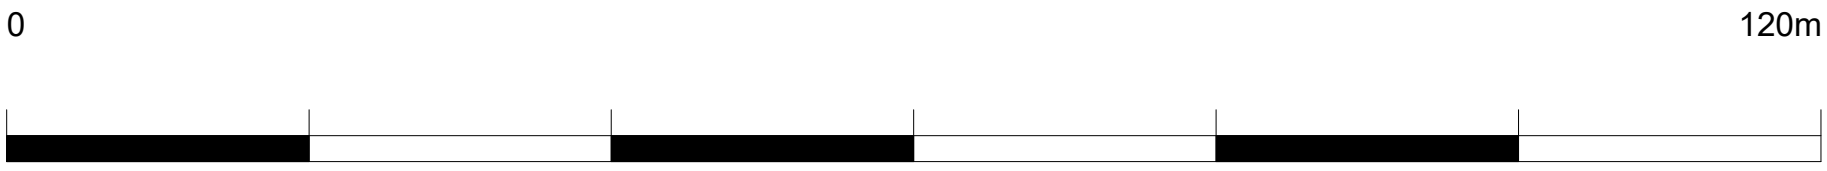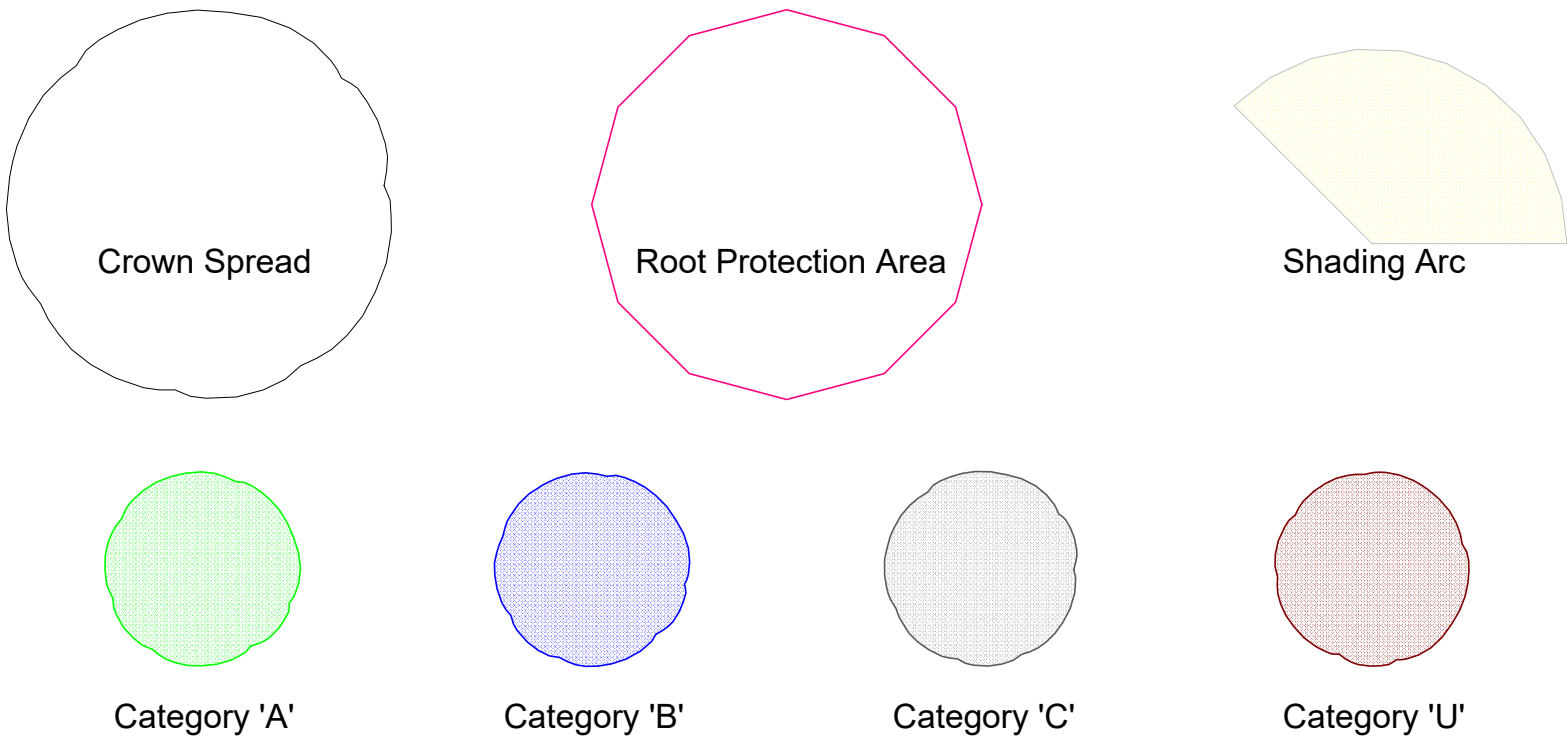

**TREE PRESERVATION ORDER:**  
Some of the trees are protected by a Tree Preservation Order with reference 'Land Between Patuca & Thakeham Tile Works, Rock Road, Thakeham (TPO 1995)', served and administered by Horsham District Council: Trees 1 to 20, W2A containing W2.1 to W2.11 and W2B containing W2.12 to W2.40.

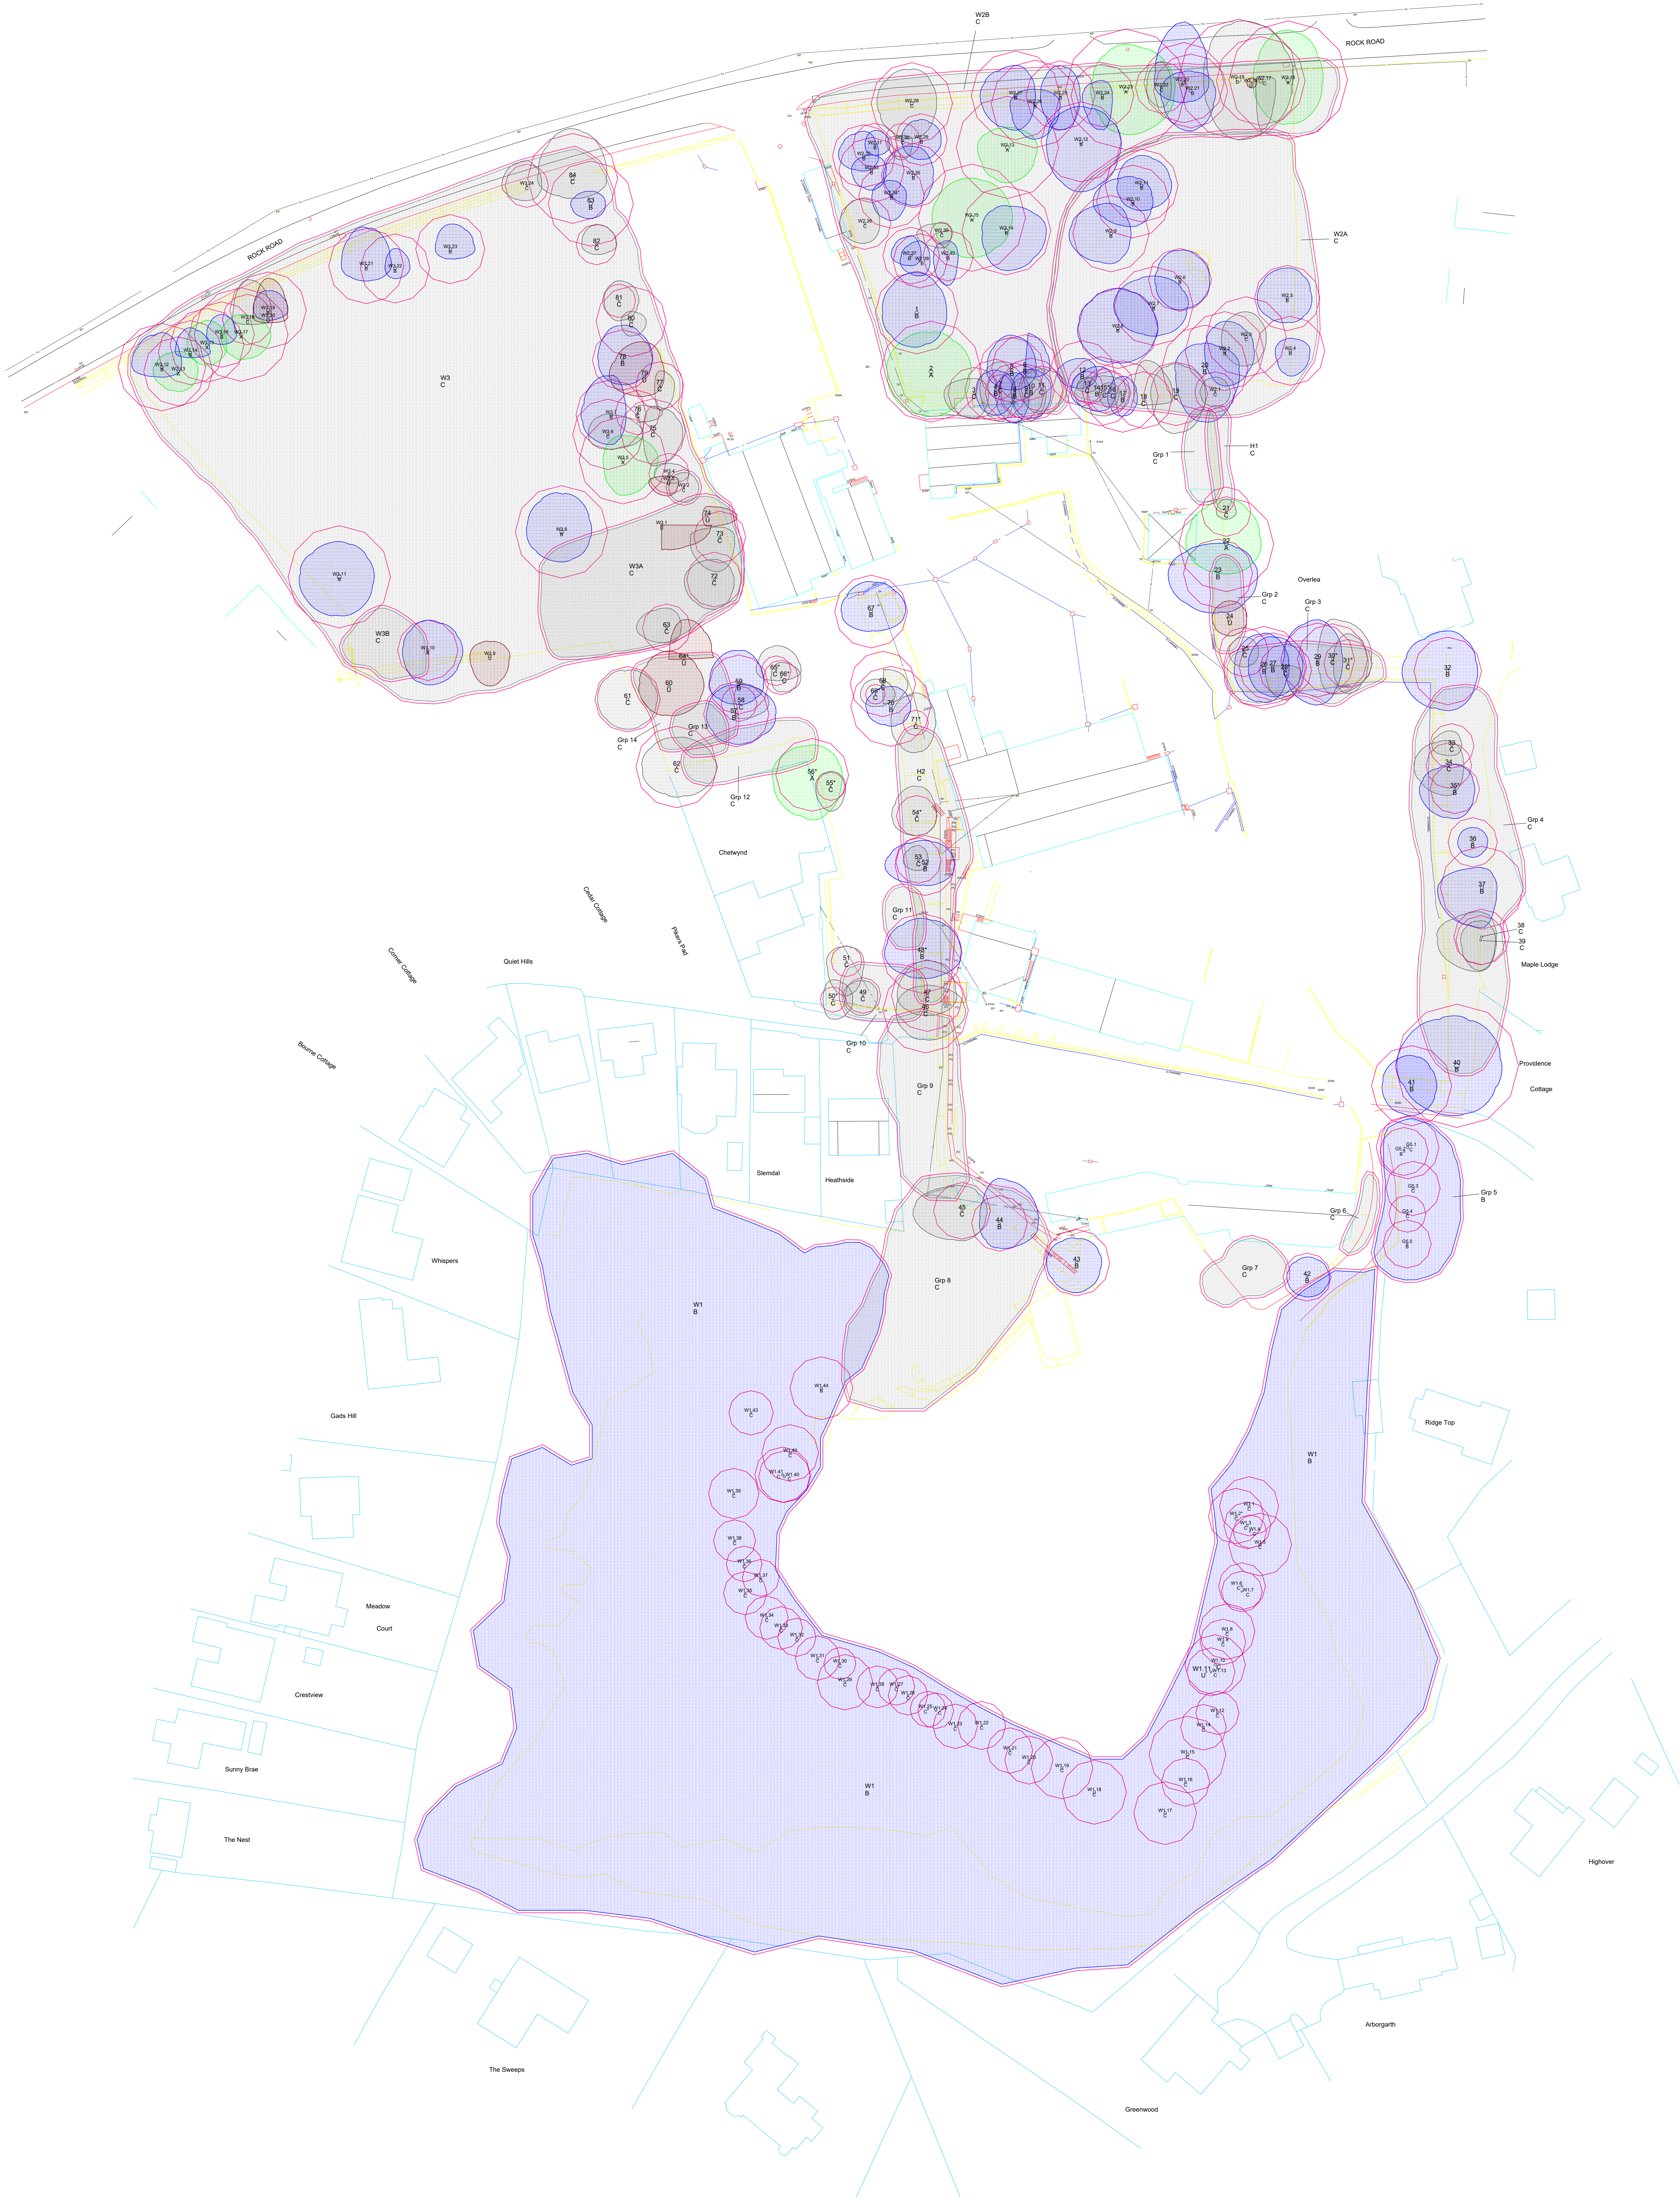



|                                                                                                                                                                                                                                                                                                                                  | BS5837:2012 TREE ROOT PROTECTION AREA SCHEDULE |                                                                |                                       |                          |                                                          |                              |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------|----------------------------------------------------------------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
|                                                                                                                                                                                                                                                                                                                                                                                                                   | Site:                                          | Rock Road, Storrington, West Sussex, RH20 3AD                  |                                       |                          |                                                          |                              |
|                                                                                                                                                                                                                                                                                                                                                                                                                   | Date:                                          | 4th, 6th and 17th March 2025                                   |                                       |                          |                                                          |                              |
|                                                                                                                                                                                                                                                                                                                                                                                                                   | Consultant:                                    | Stefan Rose <i>BSc (Hons), TechCert (Arbor.A), TechArbor.A</i> |                                       |                          |                                                          |                              |
| <p>Notes:</p> <p>1. This is an assessment of the Root Protection Area (RPA) required, based on the individual tree data collected and Section 4.6.1 of BS5837:2012.</p> <p>2. For all single stem trees with a stem diameter greater than 1250mm, and multi-stem trees with a stem diameter greater than 1500mm, the calculated RPA has been capped at 707m2 in accordance with Section 4.6.1 of BS5837.2012.</p> |                                                |                                                                |                                       |                          |                                                          |                              |
| <p>TREE PRESERVATION ORDER:</p> <p>Some of the trees are protected by a Tree Preservation Order with reference 'Land Between Patuca &amp; Thakeham Tile Works, Rock Road, Thakeham (TPO 1995), served and adminstered by Horsham District Council: Includes trees 1 to 20, W2A containing W2.1 to W2.11 and W2B containing W2.12 to W2.40 (see trees annotated in red below).</p>                                 |                                                |                                                                |                                       |                          |                                                          |                              |
| Tree No                                                                                                                                                                                                                                                                                                                                                                                                           | Species                                        | Category                                                       | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
| 1<br>TPO                                                                                                                                                                                                                                                                                                                                                                                                          | Scots Pine<br>Pinus sylvestris                 | B1                                                             | S                                     | 670                      | 8.0                                                      | 203                          |
| 2<br>TPO                                                                                                                                                                                                                                                                                                                                                                                                          | Pedunculate Oak<br>Quercus robur               | A1+2                                                           | S                                     | 820                      | 9.8                                                      | 304                          |
| 3<br>TPO                                                                                                                                                                                                                                                                                                                                                                                                          | Common Ash<br>Fraxinus excelsior               | C1+2                                                           | S                                     | 420                      | 5.0                                                      | 80                           |
| 4<br>TPO                                                                                                                                                                                                                                                                                                                                                                                                          | Scots Pine<br>Pinus sylvestris                 | B1+2                                                           | S                                     | 500                      | 6.0                                                      | 113                          |
| 5<br>TPO                                                                                                                                                                                                                                                                                                                                                                                                          | Scots Pine<br>Pinus sylvestris                 | B1+2                                                           | S                                     | 530                      | 6.4                                                      | 127                          |
| 6<br>TPO                                                                                                                                                                                                                                                                                                                                                                                                          | Scots Pine<br>Pinus sylvestris                 | B1+2                                                           | S                                     | 540                      | 6.5                                                      | 132                          |
| 7<br>TPO                                                                                                                                                                                                                                                                                                                                                                                                          | Pedunculate Oak<br>Quercus robur               | C1                                                             | S                                     | 200                      | 2.4                                                      | 18                           |
| 8<br>TPO                                                                                                                                                                                                                                                                                                                                                                                                          | Scots Pine<br>Pinus sylvestris                 | B1+2                                                           | S                                     | 480                      | 5.8                                                      | 104                          |
| 9<br>TPO                                                                                                                                                                                                                                                                                                                                                                                                          | Pedunculate Oak<br>Quercus robur               | C1+2                                                           | S                                     | 450                      | 5.4                                                      | 92                           |
| 10<br>TPO                                                                                                                                                                                                                                                                                                                                                                                                         | Scots Pine<br>Pinus sylvestris                 | B1+2                                                           | S                                     | 510                      | 6.1                                                      | 118                          |

| Tree No   | Species                                    | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|-----------|--------------------------------------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| 11<br>TPO | Pedunculate Oak<br>Quercus robur           | C1+2     | S                                     | 370                      | 4.4                                                      | 62                           |
| 12<br>TPO | Scots Pine<br>Pinus sylvestris             | B1+2     | S                                     | 530                      | 6.4                                                      | 127                          |
| 13<br>TPO | Scots Pine<br>Pinus sylvestris             | C1       | S                                     | 260                      | 3.1                                                      | 31                           |
| 14<br>TPO | Scots Pine<br>Pinus sylvestris             | B1+2     | S                                     | 560                      | 6.7                                                      | 142                          |
| 15<br>TPO | False Acacia<br>Robinia pseudoacacia       | C1       | S                                     | 360                      | 4.3                                                      | 59                           |
| 16<br>TPO | Scots Pine<br>Pinus sylvestris             | C1       | S                                     | 350                      | 4.2                                                      | 55                           |
| 17<br>TPO | Scots Pine<br>Pinus sylvestris             | B1+2     | S                                     | 580                      | 7.0                                                      | 152                          |
| 18<br>TPO | Scots Pine<br>Pinus sylvestris             | C1+2     | S                                     | 460                      | 5.5                                                      | 96                           |
| 19<br>1PO | Common Ash<br>Fraxinus excelsior           | C1       | MS<5                                  | 520                      | 6.2                                                      | 122                          |
| 20<br>TPO | Pedunculate Oak<br>Quercus robur           | B1+2     | S                                     | 700                      | 8.4                                                      | 222                          |
| 21        | Lawson Cypress<br>Chamaecyparis lawsoniana | C1+2     | S                                     | 400                      | 4.8                                                      | 72                           |
| 22        | Pedunculate Oak<br>Quercus robur           | A1+2     | S                                     | 770                      | 9.2                                                      | 268                          |
| 23        | Pedunculate Oak<br>Quercus robur           | B1+2     | S                                     | 560                      | 6.7                                                      | 142                          |
| 24        | Sweet Chestnut<br>Castanea sativa          | U        | S                                     | 650                      | -                                                        | -                            |
| 25        | Lawson Cypress<br>Chamaecyparis lawsoniana | C1       | S                                     | 400                      | 4.8                                                      | 72                           |
| 26        | Common Beech<br>Fagus sylvatica            | B1+2     | S                                     | 670                      | 8.0                                                      | 203                          |
| 27        | Common Beech<br>Fagus sylvatica            | B1+2     | S                                     | 550                      | 6.6                                                      | 137                          |
| 28        | Pedunculate Oak<br>Quercus robur           | C1+2     | MS<5                                  | 430                      | 5.2                                                      | 84                           |
| 29        | Common Beech<br>Fagus sylvatica            | B1+2     | S                                     | 600                      | 7.2                                                      | 163                          |
| 30        | Common Beech<br>Fagus sylvatica            | C1+2     | S                                     | 570                      | 6.8                                                      | 147                          |

| Tree No | Species                           | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|---------|-----------------------------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| 31      | Pedunculate Oak<br>Quercus robur  | C1+2     | MS<5                                  | 400                      | 4.8                                                      | 72                           |
| 32      | Pedunculate Oak<br>Quercus robur  | B1+2     | S                                     | 550                      | 6.6                                                      | 137                          |
| 33      | Pedunculate Oak<br>Quercus robur  | C1+2     | MS<5                                  | 370                      | 4.4                                                      | 62                           |
| 34      | Sweet Chestnut<br>Castanea sativa | C1+2     | S                                     | 370                      | 4.4                                                      | 62                           |
| 35      | Pedunculate Oak<br>Quercus robur  | B1+2     | S                                     | 400                      | 4.8                                                      | 72                           |
| 36      | Scots Pine<br>Pinus sylvestris    | B1+2     | S                                     | 400                      | 4.8                                                      | 72                           |
| 37      | Pedunculate Oak<br>Quercus robur  | B1+2     | MS<5                                  | 680                      | 8.2                                                      | 209                          |
| 38      | Common Beech<br>Fagus sylvatica   | C1       | S                                     | 450                      | 5.4                                                      | 92                           |
| 39      | Sweet Chestnut<br>Castanea sativa | C1+2     | S                                     | 400                      | 4.8                                                      | 72                           |
| 40      | Pedunculate Oak<br>Quercus robur  | B1+2     | S                                     | 1000                     | 12.0                                                     | 452                          |
| 41      | Pedunculate Oak<br>Quercus robur  | B1+2     | S                                     | 650                      | 7.8                                                      | 191                          |
| 42      | Scots Pine<br>Pinus sylvestris    | B1+2     | S                                     | 390                      | 4.7                                                      | 69                           |
| 43      | Pedunculate Oak<br>Quercus robur  | B1+2     | MS<5                                  | 540                      | 6.5                                                      | 132                          |
| 44      | Pedunculate Oak<br>Quercus robur  | B1+2     | S                                     | 450                      | 5.4                                                      | 92                           |
| 45      | Pedunculate Oak<br>Quercus robur  | C1+2     | S                                     | 460                      | 5.5                                                      | 96                           |
| 46      | Sweet Chestnut<br>Castanea sativa | C1+2     | MS<5                                  | 700                      | 8.4                                                      | 222                          |
| 47      | Sweet Chestnut<br>Castanea sativa | C1+2     | MS<5                                  | 590                      | 7.1                                                      | 157                          |
| 48      | Pedunculate Oak<br>Quercus robur  | B1+2     | S                                     | 650                      | 7.8                                                      | 191                          |
| 49      | Silver Birch<br>Betula pendula    | C1       | S                                     | 290                      | 3.5                                                      | 38                           |
| 50      | Sweet Chestnut<br>Castanea sativa | C1       | MS<5                                  | 210                      | 2.5                                                      | 20                           |

| Tree No | Species                                     | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|---------|---------------------------------------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| 51      | Pedunculate Oak<br>Quercus robur            | C1+2     | S                                     | 250                      | 3.0                                                      | 28                           |
| 52      | Pedunculate Oak<br>Quercus robur            | B1       | MS<5                                  | 490                      | 5.9                                                      | 109                          |
| 53      | Leyland Cypress<br>X Cuprocyparis leylandii | C1       | S                                     | 370                      | 4.4                                                      | 62                           |
| 54      | Pedunculate Oak<br>Quercus robur            | C1       | S                                     | 330                      | 4.0                                                      | 49                           |
| 55      | Pedunculate Oak<br>Quercus robur            | C1       | S                                     | 230                      | 2.8                                                      | 24                           |
| 56      | Pedunculate Oak<br>Quercus robur            | A1+2     | S                                     | 590                      | 7.1                                                      | 157                          |
| 57      | Pedunculate Oak<br>Quercus robur            | B1+2     | S                                     | 530                      | 6.4                                                      | 127                          |
| 58      | Pedunculate Oak<br>Quercus robur            | C1+2     | S                                     | 290                      | 3.5                                                      | 38                           |
| 59      | Pedunculate Oak<br>Quercus robur            | B1+2     | S                                     | 480                      | 5.8                                                      | 104                          |
| 60      | Silver Birch<br>Betula pendula              | U        | MS<5                                  | 470                      | -                                                        | -                            |
| 61      | Pedunculate Oak<br>Quercus robur            | C1+2     | S                                     | 530                      | 6.4                                                      | 127                          |
| 62      | Common Hazel<br>Corylus avellana            | C1+2     | MS>6                                  | 60                       | 0.7                                                      | 2                            |
| 63      | Pedunculate Oak<br>Quercus robur            | C1+2     | S                                     | 390                      | 4.7                                                      | 69                           |
| 64      | Goat Willow<br>Salix caprea                 | U        | MS<5                                  | 320                      | -                                                        | -                            |
| 65      | Pedunculate Oak<br>Quercus robur            | C1+2     | S                                     | 240                      | 2.9                                                      | 26                           |
| 66      | Pedunculate Oak<br>Quercus robur            | C1+2     | S                                     | 280                      | 3.4                                                      | 35                           |
| 67      | Pedunculate Oak<br>Quercus robur            | B1       | S                                     | 590                      | 7.1                                                      | 157                          |
| 68      | Scots Pine<br>Pinus sylvestris              | C1+2     | S                                     | 530                      | 6.4                                                      | 127                          |
| 69      | Pedunculate Oak<br>Quercus robur            | C1+2     | S                                     | 160                      | 1.9                                                      | 12                           |
| 70      | Scots Pine<br>Pinus sylvestris              | B1+2     | S                                     | 650                      | 7.8                                                      | 191                          |

| Tree No | Species                                                                    | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|---------|----------------------------------------------------------------------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| 71      | Hazel<br>Corylus spp                                                       | C1+2     | MS<5                                  | 210                      | 2.5                                                      | 20                           |
| 72      | Pedunculate Oak<br>Quercus robur                                           | C1+2     | MS<5                                  | 500                      | 6.0                                                      | 113                          |
| 73      | Pedunculate Oak<br>Quercus robur                                           | C1+2     | S                                     | 420                      | 5.0                                                      | 80                           |
| 74      | Silver Birch<br>Betula pendula                                             | U        | MS<5                                  | 290                      | -                                                        | -                            |
| 75      | Common Ash<br>Fraxinus excelsior                                           | C1+2     | S                                     | 530                      | 6.4                                                      | 127                          |
| 76      | Pedunculate Oak<br>Quercus robur                                           | C1+2     | S                                     | 360                      | 4.3                                                      | 59                           |
| 77      | Pedunculate Oak<br>Quercus robur                                           | C1+2     | S                                     | 390                      | 4.7                                                      | 69                           |
| 78      | Pedunculate Oak<br>Quercus robur                                           | B1+2     | S                                     | 490                      | 5.9                                                      | 109                          |
| 79      | Pedunculate Oak<br>Quercus robur                                           | U        | S                                     | 550                      | -                                                        | -                            |
| 80      | Sweet Chestnut<br>Castanea sativa                                          | C1+2     | S                                     | 570                      | 6.8                                                      | 147                          |
| 81      | Common Ash<br>Fraxinus excelsior                                           | C1+2     | S                                     | 270                      | 3.2                                                      | 33                           |
| 82      | Common Ash<br>Fraxinus excelsior                                           | C1       | S                                     | 330                      | 4.0                                                      | 49                           |
| 83      | Scots Pine<br>Pinus sylvestris                                             | B1+2     | S                                     | 690                      | 8.3                                                      | 215                          |
| 84      | Pedunculate Oak<br>Quercus robur                                           | C1       | S                                     | 730                      | 8.8                                                      | 241                          |
| Grp 1   | Scots Pine<br>Hazel<br>Sweet Chestnut<br>Japanese Cedar<br>Pedunculate Oak | C1+2     | S                                     | 200                      | 2.4                                                      | 18                           |
| Grp 2   | Sweet Chestnut<br>Holly<br>Pedunculate Oak                                 | C1       | MS                                    | 250                      | 3.0                                                      | 28                           |
| Grp 3   | Birch Oak<br>Beech<br>Rhododendron<br>Yew<br>Holly                         | C1+2     | MS                                    | 250                      | 3.0                                                      | 28                           |

| Tree No | Species                                                                          | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|---------|----------------------------------------------------------------------------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| Grp 4   | Birch<br>Holly<br>Goat Willow<br>Hawthorn<br>Scots Pine<br>Hazel<br>Rhododendron | C1+2     | S                                     | 250                      | 3.0                                                      | 28                           |
| Grp 5   | Silver Birch<br>Pedunculate Oak<br>Scots Pine                                    | B1+2     | See below                             | See below                | -                                                        | -                            |
| G5.1    | Silver Birch                                                                     | C1       | S                                     | 510                      | 6.1                                                      | 118                          |
| G5.2    | Pedunculate Oak                                                                  | B1+2     | S                                     | 390                      | 4.7                                                      | 69                           |
| G5.3    | Scots Pine                                                                       | C1       | S                                     | 440                      | 5.3                                                      | 88                           |
| G5.4    | Pedunculate Oak                                                                  | C1       | S                                     | 300                      | 3.6                                                      | 41                           |
| G5.5    | Pedunculate Oak                                                                  | B1       | S                                     | 390                      | 4.7                                                      | 69                           |
| Grp 6   | Oak<br>Birch<br>Cherry<br>Field Maple                                            | C1       | MS                                    | 200                      | 2.4                                                      | 18                           |
| Grp 7   | Birch<br>Oak<br>Pine<br>Ash                                                      | C1+2     | S                                     | 250                      | 3.0                                                      | 28                           |
| Grp 8   | Pedunculate Oak<br>Goat Willow<br>Silver Birch                                   | C1       | S                                     | 300                      | 3.6                                                      | 41                           |
| Grp 9   | Pedunculate Oak<br>Scots Pine<br>Sweet Chestnut<br>Silver Birch                  | C1+2     | MS                                    | 450                      | 5.4                                                      | 92                           |
| Grp 10  | Sweet Chestnut<br>Goat Willow<br>Silver Birch                                    | C1       | S                                     | 140                      | 1.7                                                      | 9                            |
| Grp 11  | Pedunculate Oak                                                                  | C1+2     | S                                     | 300                      | 3.6                                                      | 41                           |

| Tree No | Species                                                                         | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|---------|---------------------------------------------------------------------------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| Grp 12  | Cherry Laurel                                                                   | C2       | MS                                    | 250                      | 3.0                                                      | 28                           |
| Grp 13  | Norway Spruce                                                                   | C1+2     | MS                                    | 470                      | 5.6                                                      | 100                          |
| Grp 14  | Cherry Laurel                                                                   | C1+2     | S                                     | 120                      | 1.4                                                      | 7                            |
| H1      | Lawson Cypress                                                                  | C1       | S                                     | 250                      | 3.0                                                      | 28                           |
| H2      | Leyland Cypress                                                                 | C1       | MS                                    | 460                      | 5.5                                                      | 96                           |
| W1      | Scots Pine<br>Silver Birch<br>Pedunculate Oak<br>Common Beech<br>Sweet Chestnut | B2       | S                                     | 400                      | 4.8                                                      | 72                           |
| W1.1    | Pine                                                                            | C1       | S                                     | 480                      | 5.8                                                      | 104                          |
| W1.2    | Pine                                                                            | C1       | S                                     | 450                      | 5.4                                                      | 92                           |
| W1.3    | Pine                                                                            | C1       | S                                     | 380                      | 4.6                                                      | 65                           |
| W1.4    | Pine                                                                            | C1       | S                                     | 270                      | 3.2                                                      | 33                           |
| W1.5    | Pine                                                                            | C1       | S                                     | 510                      | 6.1                                                      | 118                          |
| W1.6    | Pine                                                                            | C1       | S                                     | 380                      | 4.6                                                      | 65                           |
| W1.7    | Pine                                                                            | C1       | S                                     | 330                      | 4.0                                                      | 49                           |
| W1.8    | Pine                                                                            | C1       | MS<5                                  | 460                      | 5.5                                                      | 96                           |
| W1.9    | Pine                                                                            | C1       | S                                     | 370                      | 4.4                                                      | 62                           |
| W1.10   | Pine                                                                            | C1       | S                                     | 490                      | 5.9                                                      | 109                          |
| W1.11   | Pine                                                                            | U        | S                                     | 260                      | -                                                        | -                            |
| W1.12   | Pine                                                                            | C1       | S                                     | 350                      | 4.2                                                      | 55                           |
| W1.13   | Pine                                                                            | C1       | S                                     | 390                      | 4.7                                                      | 69                           |
| W1.14   | Pine                                                                            | C1       | S                                     | 370                      | 4.4                                                      | 62                           |
| W1.15   | Pine                                                                            | C1       | MS<5                                  | 630                      | 7.6                                                      | 180                          |
| W1.16   | Pine                                                                            | C1       | S                                     | 390                      | 4.7                                                      | 69                           |
| W1.17   | Pine                                                                            | C1       | S                                     | 510                      | 6.1                                                      | 118                          |
| W1.18   | Pine                                                                            | C1       | S                                     | 520                      | 6.2                                                      | 122                          |
| W1.19   | Pine                                                                            | C1       | S                                     | 500                      | 6.0                                                      | 113                          |

| Tree No     | Species                                                | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|-------------|--------------------------------------------------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| W1.20       | Scots Pine                                             | C1       | S                                     | 390                      | 4.7                                                      | 69                           |
| W1.21       | Scots Pine                                             | C1       | MS<5                                  | 370                      | 4.4                                                      | 62                           |
| W1.22       | Pine                                                   | C1       | S                                     | 390                      | 4.7                                                      | 69                           |
| W1.23       | Pine                                                   | C1       | S                                     | 360                      | 4.3                                                      | 59                           |
| W1.24       | Pine                                                   | C1       | S                                     | 290                      | 3.5                                                      | 38                           |
| W1.25       | Pine                                                   | C1       | S                                     | 290                      | 3.5                                                      | 38                           |
| W1.26       | Pine                                                   | C1       | S                                     | 320                      | 3.8                                                      | 46                           |
| W1.27       | Pine                                                   | C1       | S                                     | 300                      | 3.6                                                      | 41                           |
| W1.28       | Pine                                                   | C1       | S                                     | 340                      | 4.1                                                      | 52                           |
| W1.29       | Pine                                                   | C1       | S                                     | 450                      | 5.4                                                      | 92                           |
| W1.30       | Pine                                                   | C1       | S                                     | 260                      | 3.1                                                      | 31                           |
| W1.31       | Pine                                                   | C1       | S                                     | 360                      | 4.3                                                      | 59                           |
| W1.32       | Pine                                                   | C1       | S                                     | 310                      | 3.7                                                      | 43                           |
| W1.33       | Pine                                                   | C1       | MS<5                                  | 350                      | 4.2                                                      | 55                           |
| W1.34       | Pine                                                   | C1       | S                                     | 350                      | 4.2                                                      | 55                           |
| W1.35       | Pine                                                   | C1       | S                                     | 350                      | 4.2                                                      | 55                           |
| W1.36       | Pine                                                   | C1       | S                                     | 290                      | 3.5                                                      | 38                           |
| W1.37       | Goat Willow                                            | C1       | S                                     | 300                      | 3.6                                                      | 41                           |
| W1.38       | Pine                                                   | C1       | S                                     | 340                      | 4.1                                                      | 52                           |
| W1.39       | Pine                                                   | C1       | S                                     | 410                      | 4.9                                                      | 76                           |
| W1.40       | Willow                                                 | C1       | S                                     | 420                      | 5.0                                                      | 80                           |
| W1.41       | Pine                                                   | C1       | S                                     | 450                      | 5.4                                                      | 92                           |
| W1.42       | Pine                                                   | C1       | S                                     | 460                      | 5.5                                                      | 96                           |
| W1.43       | Pine                                                   | C1       | S                                     | 360                      | 4.3                                                      | 59                           |
| W1.44       | Pine                                                   | B1       | S                                     | 510                      | 6.1                                                      | 118                          |
| W2A<br>TPO  | Silver Birch<br>Willow<br>Cherry Laurel<br>Goat Willow | C1+2     | S                                     | 200                      | 2.4                                                      | 18                           |
| W2.1<br>TPO | Lawson Cypress                                         | C1+2     | S                                     | 330                      | 4.0                                                      | 49                           |

| Tree No      | Species                                                                                                                            | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|--------------|------------------------------------------------------------------------------------------------------------------------------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| W2.2<br>TPO  | Pedunculate Oak                                                                                                                    | B1+2     | S                                     | 640                      | 7.7                                                      | 185                          |
| W2.3<br>TPO  | Scots Pine                                                                                                                         | C1+2     | S                                     | 650                      | 7.8                                                      | 191                          |
| W2.4<br>TPO  | Scots Pine                                                                                                                         | B1+2     | S                                     | 560                      | 6.7                                                      | 142                          |
| W2.5<br>TPO  | Aspen                                                                                                                              | B1+2     | S                                     | 530                      | 6.4                                                      | 127                          |
| W2.6<br>TPO  | Pedunculate Oak                                                                                                                    | B1+2     | S                                     | 510                      | 6.1                                                      | 118                          |
| W2.7<br>TPO  | Pedunculate Oak                                                                                                                    | B1+2     | S                                     | 640                      | 7.7                                                      | 185                          |
| W2.8<br>TPO  | Pedunculate Oak                                                                                                                    | B1+2     | S                                     | 650                      | 7.8                                                      | 191                          |
| W2.9<br>TPO  | Pedunculate Oak                                                                                                                    | B1+2     | S                                     | 620                      | 7.4                                                      | 174                          |
| W2.10<br>TPO | Pedunculate Oak                                                                                                                    | B1+2     | S                                     | 590                      | 7.1                                                      | 157                          |
| W2.11<br>TPO | Pedunculate Oak                                                                                                                    | B1+2     | S                                     | 580                      | 7.0                                                      | 152                          |
| W2B<br>TPO   | Goat Willow<br>Cherry Laurel<br>Silver Birch<br>Norway Spruce<br>Western Red Cedar<br>Hazel<br>Holly<br>Beech<br>Yew<br>Scots Pine | C1+2     | S                                     | 250                      | 3.0                                                      | 28                           |
| W2.12<br>TPO | Pedunculate Oak                                                                                                                    | B1+2     | S                                     | 650                      | 7.8                                                      | 191                          |
| W2.13<br>TPO | Pedunculate Oak                                                                                                                    | A1+2     | S                                     | 830                      | 10.0                                                     | 312                          |
| W2.14<br>TPO | Scots Pine                                                                                                                         | B1+2     | S                                     | 720                      | 8.6                                                      | 235                          |
| W2.15<br>TPO | Pedunculate Oak                                                                                                                    | A1+2     | S                                     | 870                      | 10.4                                                     | 342                          |

| Tree No      | Species         | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|--------------|-----------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| W2.16<br>TPO | Pedunculate Oak | A1+2     | S                                     | 960                      | 11.5                                                     | 417                          |
| W2.17<br>TPO | Pedunculate Oak | C1+2     | S                                     | 720                      | 8.6                                                      | 235                          |
| W2.18<br>TPO | Pedunculate Oak | U        | S                                     | 350                      | -                                                        | -                            |
| W2.19<br>TPO | Pedunculate Oak | C1+2     | S                                     | 980                      | 11.8                                                     | 435                          |
| W2.20<br>TPO | Pedunculate Oak | B1+2     | S                                     | 650                      | 7.8                                                      | 191                          |
| W2.21<br>TPO | Pedunculate Oak | B1+2     | S                                     | 600                      | 7.2                                                      | 163                          |
| W2.22<br>TPO | Pedunculate Oak | C1+2     | S                                     | 420                      | 5.0                                                      | 80                           |
| W2.23<br>TPO | Pedunculate Oak | A1+2     | S                                     | 980                      | 11.8                                                     | 435                          |
| W2.24<br>TPO | Pedunculate Oak | B1+2     | S                                     | 510                      | 6.1                                                      | 118                          |
| W2.25<br>TPO | Pedunculate Oak | B1+2     | S                                     | 560                      | 6.7                                                      | 142                          |
| W2.26<br>TPO | Pedunculate Oak | B1+2     | S                                     | 710                      | 8.5                                                      | 228                          |
| W2.27<br>TPO | Pedunculate Oak | B1+2     | S                                     | 720                      | 8.6                                                      | 235                          |
| W2.28<br>TPO | Pedunculate Oak | C1+2     | S                                     | 660                      | 7.9                                                      | 197                          |
| W2.29<br>TPO | Douglas Fir     | B1+2     | S                                     | 420                      | 5.0                                                      | 80                           |
| W2.30<br>TPO | Scots Pine      | C1+2     | S                                     | 280                      | 3.4                                                      | 35                           |
| W2.31<br>TPO | Scots Pine      | B1+2     | S                                     | 360                      | 4.3                                                      | 59                           |
| W2.32<br>TPO | Scots Pine      | B1+2     | S                                     | 510                      | 6.1                                                      | 118                          |
| W2.33<br>TPO | Scots Pine      | B1+2     | S                                     | 530                      | 6.4                                                      | 127                          |
| W2.34<br>TPO | Scots Pine      | B1+2     | S                                     | 530                      | 6.4                                                      | 127                          |

| Tree No      | Species                                                                                                                                                                | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|--------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| W2.35<br>TPO | Pedunculate Oak                                                                                                                                                        | B1+2     | S                                     | 520                      | 6.2                                                      | 122                          |
| W2.36<br>TPO | Silver Birch                                                                                                                                                           | C1+2     | MS<5                                  | 420                      | 5.0                                                      | 80                           |
| W2.37<br>TPO | Scots Pine                                                                                                                                                             | B1+2     | S                                     | 460                      | 5.5                                                      | 96                           |
| W2.38<br>TPO | Scots Pine                                                                                                                                                             | B1+2     | S                                     | 440                      | 5.3                                                      | 88                           |
| W2.39<br>TPO | European Larch                                                                                                                                                         | C1+2     | S                                     | 180                      | 2.2                                                      | 15                           |
| W2.40<br>TPO | Scots Pine                                                                                                                                                             | B1+2     | S                                     | 410                      | 4.9                                                      | 76                           |
| W3           | Crack Willow<br>Silver Birch<br>Sweet Chestnut<br>Hawthorn<br>Field Maple<br>Norway Spruce<br>Yew<br>Alder<br>Cherry Laurel<br>Ash<br>Sycamore<br>Holly<br>Goat Willow | C1+2     | S                                     | 350                      | 4.2                                                      | 55                           |
| W3A          | Goat Willow<br>Cherry Laurel<br>Silver Birch<br>Hawthorn                                                                                                               | C1+2     | S                                     | 350                      | 4.2                                                      | 55                           |
| W3.1         | Crack Willow                                                                                                                                                           | U        | MS<5                                  | 480                      | -                                                        | -                            |
| W3.2         | Ash                                                                                                                                                                    | C1+2     | S                                     | 290                      | 3.5                                                      | 38                           |
| W3.3         | Silver Birch                                                                                                                                                           | U        | S                                     | 370                      | -                                                        | -                            |
| W3.4         | Goat Willow                                                                                                                                                            | C1+2     | MS<5                                  | 330                      | 4.0                                                      | 49                           |
| W3.5         | Pedunculate Oak                                                                                                                                                        | A1+2     | S                                     | 710                      | 8.5                                                      | 228                          |
| W3.6         | Pedunculate Oak                                                                                                                                                        | C1+2     | S                                     | 570                      | 6.8                                                      | 147                          |
| W3.7         | Pedunculate Oak                                                                                                                                                        | B1+2     | S                                     | 570                      | 6.8                                                      | 147                          |
| W3.8         | Pedunculate Oak                                                                                                                                                        | B1+2     | S                                     | 750                      | 9.0                                                      | 255                          |

| Tree No | Species         | Category | Single/<br>Multi-Stemmed<br>(S or MS) | Stem<br>Diameter<br>(mm) | Initial Linear<br>Root Protection Distance<br>(Radius m) | Root Protection Area<br>(m2) |
|---------|-----------------|----------|---------------------------------------|--------------------------|----------------------------------------------------------|------------------------------|
| W3.9    | Sweet Chestnut  | U        | MS<5                                  | 590                      | -                                                        | -                            |
| W3.10   | Pedunculate Oak | B1+2     | S                                     | 490                      | 5.9                                                      | 109                          |
| W3B     | Crack Willow    | C1+2     | S                                     | 430                      | 5.2                                                      | 84                           |
| W3.11   | Pedunculate Oak | B1+2     | S                                     | 830                      | 10.0                                                     | 312                          |
| W3.12   | Scots Pine      | B1+2     | S                                     | 710                      | 8.5                                                      | 228                          |
| W3.13   | Scots Pine      | A1+2     | S                                     | 560                      | 6.7                                                      | 142                          |
| W3.14   | Scots Pine      | B1+2     | S                                     | 520                      | 6.2                                                      | 122                          |
| W3.15   | Scots Pine      | A1+2     | S                                     | 600                      | 7.2                                                      | 163                          |
| W3.16   | Scots Pine      | B1+2     | S                                     | 530                      | 6.4                                                      | 127                          |
| W3.17   | Scots Pine      | A1+2     | S                                     | 760                      | 9.1                                                      | 261                          |
| W3.18   | European Larch  | C1+2     | S                                     | 410                      | 4.9                                                      | 76                           |
| W3.19   | Scots Pine      | B1+2     | S                                     | 620                      | 7.4                                                      | 174                          |
| W3.20   | Sweet Chestnut  | U        | S                                     | 330                      | -                                                        | -                            |
| W3.21   | Scots Pine      | B1+2     | S                                     | 610                      | 7.3                                                      | 168                          |
| W3.22   | Scots Pine      | B1+2     | S                                     | 560                      | 6.7                                                      | 142                          |
| W3.23   | Scots Pine      | B1+2     | S                                     | 560                      | 6.7                                                      | 142                          |
| W3.24   | Common Ash      | C1+2     | S                                     | 350                      | 4.2                                                      | 55                           |



|  | TREE WORKS SCHEDULE |                                                   |
|-----------------------------------------------------------------------------------|---------------------|---------------------------------------------------|
|                                                                                   | <b>Site:</b>        | Rock Road, Storrington, West Sussex, RH20 3AD     |
|                                                                                   | <b>Date:</b>        | May 2026                                          |
|                                                                                   | <b>Consultant:</b>  | Stefan Rose <i>BSc (Hons), TechCert (Arbor.A)</i> |

| Tree No   | Species                                           | Recommended Works                                                 |
|-----------|---------------------------------------------------|-------------------------------------------------------------------|
| 1<br>TPO  | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                        |
| 2<br>TPO  | Pedunculate Oak<br><i>Quercus robur</i>           | Remove major deadwood with a branch attachment >50mm              |
| 3<br>TPO  | Common Ash<br><i>Fraxinus excelsior</i>           | No works required for planning application                        |
| 4<br>TPO  | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                        |
| 5<br>TPO  | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                        |
| 6<br>TPO  | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                        |
| 7<br>TPO  | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                        |
| 8<br>TPO  | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                        |
| 9<br>TPO  | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                        |
| 10<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>             | Sever ivy<br>Remove major deadwood with a branch attachment >50mm |
| 11<br>TPO | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                        |
| 12<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                        |
| 13<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                        |
| 14<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>             | Sever ivy<br>Remove major deadwood with a branch attachment >50mm |
| 15<br>TPO | False Acacia<br><i>Robinia pseudoacacia</i>       | Remove major deadwood with a branch attachment >50mm              |
| 16<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                        |
| 17<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                        |
| 18<br>TPO | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                        |
| 19<br>1PO | Common Ash<br><i>Fraxinus excelsior</i>           | No works required for planning application                        |
| 20<br>TPO | Pedunculate Oak<br><i>Quercus robur</i>           | Remove major deadwood with a branch attachment >50mm              |
| 21        | Lawson Cypress<br><i>Chamaecyparis lawsoniana</i> | No works required for planning application                        |
| 22        | Pedunculate Oak<br><i>Quercus robur</i>           | Sever ivy<br>Remove major deadwood with a branch attachment >50mm |
| 23        | Pedunculate Oak<br><i>Quercus robur</i>           | Remove damaged limb in south side of crown                        |

| Tree No | Species                                           | Recommended Works                                                |
|---------|---------------------------------------------------|------------------------------------------------------------------|
| 24      | Sweet Chestnut<br><i>Castanea sativa</i>          | Fell to ground level and remove stump                            |
| 25      | Lawson Cypress<br><i>Chamaecyparis lawsoniana</i> | No works required for planning application                       |
| 26      | Common Beech<br><i>Fagus sylvatica</i>            | No works required for planning application                       |
| 27      | Common Beech<br><i>Fagus sylvatica</i>            | No works required for planning application                       |
| 28      | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                       |
| 29      | Common Beech<br><i>Fagus sylvatica</i>            | No works required for planning application                       |
| 30      | Common Beech<br><i>Fagus sylvatica</i>            | No works required for planning application                       |
| 31      | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                       |
| 32      | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                       |
| 33      | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                       |
| 34      | Sweet Chestnut<br><i>Castanea sativa</i>          | No works required for planning application                       |
| 35      | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                       |
| 36      | Scots Pine<br><i>Pinus sylvestris</i>             | No works required for planning application                       |
| 37      | Pedunculate Oak<br><i>Quercus robur</i>           | Remove major deadwood with a branch attachment >50mm             |
| 38      | Common Beech<br><i>Fagus sylvatica</i>            | No works required for planning application                       |
| 39      | Sweet Chestnut<br><i>Castanea sativa</i>          | Remove storm damage limbs                                        |
| 40      | Pedunculate Oak<br><i>Quercus robur</i>           | Remove major deadwood with a branch attachment >50mm             |
| 41      | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                       |
| 42      | Scots Pine<br><i>Pinus sylvestris</i>             | Fell to ground level and remove stump                            |
| 43      | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                       |
| 44      | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                       |
| 45      | Pedunculate Oak<br><i>Quercus robur</i>           | No works required for planning application                       |
| 46      | Sweet Chestnut<br><i>Castanea sativa</i>          | Fell to ground level and remove stump                            |
| 47      | Sweet Chestnut<br><i>Castanea sativa</i>          | Fell to ground level and remove stump                            |
| 48      | Pedunculate Oak<br><i>Quercus robur</i>           | Fell to ground level and remove stump                            |
| 49      | Silver Birch<br><i>Betula pendula</i>             | No works required for planning application                       |
| 50      | Sweet Chestnut<br><i>Castanea sativa</i>          | Reduce back to previous reduction points and manage as a pollard |
| 51      | Pedunculate Oak<br><i>Quercus robur</i>           | Fell to ground level and remove stump                            |

| Tree No | Species                                            | Recommended Works                                                             |
|---------|----------------------------------------------------|-------------------------------------------------------------------------------|
| 52      | Pedunculate Oak<br><i>Quercus robur</i>            | Fell to ground level and remove stump                                         |
| 53      | Leyland Cypress<br><i>X Cuprocyparis leylandii</i> | Fell to ground level and remove stump                                         |
| 54      | Pedunculate Oak<br><i>Quercus robur</i>            | Fell to ground level and remove stump                                         |
| 55      | Pedunculate Oak<br><i>Quercus robur</i>            | No works required for planning application                                    |
| 56      | Pedunculate Oak<br><i>Quercus robur</i>            | No works required for planning application                                    |
| 57      | Pedunculate Oak<br><i>Quercus robur</i>            | Fell to ground level and remove stump                                         |
| 58      | Pedunculate Oak<br><i>Quercus robur</i>            | Fell to ground level and remove stump                                         |
| 59      | Pedunculate Oak<br><i>Quercus robur</i>            | Fell to ground level and remove stump                                         |
| 60      | Silver Birch<br><i>Betula pendula</i>              | Fell to ground level and remove stump                                         |
| 61      | Pedunculate Oak<br><i>Quercus robur</i>            | No works required for planning application                                    |
| 62      | Common Hazel<br><i>Corylus avellana</i>            | No works required for planning application                                    |
| 63      | Pedunculate Oak<br><i>Quercus robur</i>            | No works required for planning application                                    |
| 64      | Goat Willow<br><i>Salix caprea</i>                 | Fell to ground level and remove stump                                         |
| 65      | Pedunculate Oak<br><i>Quercus robur</i>            | Fell to ground level and remove stump                                         |
| 66      | Pedunculate Oak<br><i>Quercus robur</i>            | Fell to ground level and remove stump                                         |
| 67      | Pedunculate Oak<br><i>Quercus robur</i>            | No works required for planning application                                    |
| 68      | Scots Pine<br><i>Pinus sylvestris</i>              | No works required for planning application                                    |
| 69      | Pedunculate Oak<br><i>Quercus robur</i>            | No works required for planning application                                    |
| 70      | Scots Pine<br><i>Pinus sylvestris</i>              | No works required for planning application                                    |
| 71      | Hazel<br><i>Corylus spp</i>                        | No works required for planning application                                    |
| 72      | Pedunculate Oak<br><i>Quercus robur</i>            | No works required for planning application                                    |
| 73      | Pedunculate Oak<br><i>Quercus robur</i>            | No works required for planning application                                    |
| 74      | Silver Birch<br><i>Betula pendula</i>              | Fell to ground level                                                          |
| 75      | Common Ash<br><i>Fraxinus excelsior</i>            | No works required for planning application                                    |
| 76      | Pedunculate Oak<br><i>Quercus robur</i>            | No works required for planning application                                    |
| 77      | Pedunculate Oak<br><i>Quercus robur</i>            | No works required for planning application                                    |
| 78      | Pedunculate Oak<br><i>Quercus robur</i>            | Fell to ground level and remove stump                                         |
| 79      | Pedunculate Oak<br><i>Quercus robur</i>            | Make safe and retain as eco pole of approximately 5m height for habitat value |

| Tree No | Species                                                                          | Recommended Works                                                                                                      |
|---------|----------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------|
| 80      | Sweet Chestnut<br><i>Castanea sativa</i>                                         | Fell to ground level and remove stump                                                                                  |
| 81      | Common Ash<br><i>Fraxinus excelsior</i>                                          | Fell to ground level and remove stump                                                                                  |
| 82      | Common Ash<br><i>Fraxinus excelsior</i>                                          | Fell to ground level and remove stump                                                                                  |
| 83      | Scots Pine<br><i>Pinus sylvestris</i>                                            | No works required for planning application                                                                             |
| 84      | Pedunculate Oak<br><i>Quercus robur</i>                                          | Remove major deadwood with a branch attachment >50mm                                                                   |
| Grp 1   | Scots Pine<br>Hazel<br>Sweet Chestnut<br>Japanese Cedar<br>Pedunculate Oak       | No works required for planning application                                                                             |
| Grp 2   | Sweet Chestnut<br>Holly<br>Pedunculate Oak                                       | No works required for planning application                                                                             |
| Grp 3   | Birch Oak<br>Beech<br>Rhododendron<br>Yew<br>Holly                               | No works required for planning application                                                                             |
| Grp 4   | Birch<br>Holly<br>Goat Willow<br>Hawthorn<br>Scots Pine<br>Hazel<br>Rhododendron | No works required for planning application                                                                             |
| Grp 5   | Silver Birch<br>Pedunculate Oak<br>Scots Pine                                    | No works required for planning application                                                                             |
| G5.1    | Silver Birch                                                                     | No works required for planning application                                                                             |
| G5.2    | Pedunculate Oak                                                                  | No works required for planning application                                                                             |
| G5.3    | Scots Pine                                                                       | Remove hanging branch                                                                                                  |
| G5.4    | Pedunculate Oak                                                                  | No works required for planning application                                                                             |
| G5.5    | Pedunculate Oak                                                                  | No works required for planning application                                                                             |
| Grp 6   | Oak<br>Birch<br>Cherry<br>Field Maple                                            | Fell to ground level and remove stumps                                                                                 |
| Grp 7   | Birch<br>Oak<br>Pine<br>Ash                                                      | Fell to ground level and remove stumps                                                                                 |
| Grp 8   | Pedunculate Oak<br>Goat Willow<br>Silver Birch                                   | Section removed as indicated on the Indicative Tree Retention, Removal and Tree Protection Plan (CBA10637.02A TRR&TPP) |
| Grp 9   | Pedunculate Oak<br>Scots Pine<br>Sweet Chestnut<br>Silver Birch                  | Remove major deadwood with a branch attachment >50mm                                                                   |
| Grp 10  | Sweet Chestnut<br>Goat Willow<br>Silver Birch                                    | Fell to ground level and remove stumps                                                                                 |
| Grp 11  | Pedunculate Oak                                                                  | Fell to ground level and remove stumps                                                                                 |
| Grp 12  | Cherry Laurel                                                                    | Section removed as indicated on the Indicative Tree Retention, Removal and Tree Protection Plan (CBA10637.02A TRR&TPP) |

| Tree No         | Species                                                                                                                            | Recommended Works                                                                                                                                                  |
|-----------------|------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Grp 13          | Norway Spruce                                                                                                                      | Fell to ground level and remove stumps                                                                                                                             |
| Grp 14          | Cherry Laurel                                                                                                                      | Fell to ground level and remove stumps                                                                                                                             |
| H1              | Lawson Cypress                                                                                                                     | No works required for planning application                                                                                                                         |
| H2              | Leyland Cypress                                                                                                                    | Fell to ground level and remove stump                                                                                                                              |
| W1              | Scots Pine<br>Silver Birch<br>Pedunculate Oak<br>Common Beech<br>Sweet Chestnut                                                    | Section removed as indicated on the Indicative Tree Retention, Removal and Tree Protection Plan (CBA10637.02A TRR&TPP)                                             |
| W1.1-<br>W1.36  | Pine                                                                                                                               | Fell to ground level and remove stumps                                                                                                                             |
| W1.37           | Goat Willow                                                                                                                        | Fell to ground level and remove stump                                                                                                                              |
| W1.38-<br>W1.44 | Pine                                                                                                                               | Fell to ground level and remove stumps                                                                                                                             |
| W2A<br>TPO      | Silver Birch<br>Willow<br>Cherry Laurel<br>Goat Willow                                                                             | No works required for planning application footprint, area enhanced for biodiversity, please refer to Landscape and ecological proposals for details               |
| W2.1<br>TPO     | Lawson Cypress                                                                                                                     | No works required for planning application                                                                                                                         |
| W2.2<br>TPO     | Pedunculate Oak                                                                                                                    | No works required for planning application                                                                                                                         |
| W2.3<br>TPO     | Scots Pine                                                                                                                         | No works required for planning application                                                                                                                         |
| W2.4<br>TPO     | Scots Pine                                                                                                                         | No works required for planning application                                                                                                                         |
| W2.5<br>TPO     | Aspen                                                                                                                              | No works required for planning application                                                                                                                         |
| W2.6<br>TPO     | Pedunculate Oak                                                                                                                    | No works required for planning application                                                                                                                         |
| W2.7<br>TPO     | Pedunculate Oak                                                                                                                    | No works required for planning application                                                                                                                         |
| W2.8<br>TPO     | Pedunculate Oak                                                                                                                    | No works required for planning application                                                                                                                         |
| W2.9<br>TPO     | Pedunculate Oak                                                                                                                    | No works required for planning application                                                                                                                         |
| W2.10<br>TPO    | Pedunculate Oak                                                                                                                    | No works required for planning application                                                                                                                         |
| W2.11<br>TPO    | Pedunculate Oak                                                                                                                    | No works required for planning application                                                                                                                         |
| W2B<br>TPO      | Goat Willow<br>Cherry Laurel<br>Silver Birch<br>Norway Spruce<br>Western Red Cedar<br>Hazel<br>Holly<br>Beech<br>Yew<br>Scots Pine | Area enhanced for biodiversity, please refer to Landscape and ecological proposals for details<br>Northwestern section removed, mostly Laurel but includes 1 Birch |
| W2.12<br>TPO    | Pedunculate Oak                                                                                                                    | No works required for planning application                                                                                                                         |
| W2.13<br>TPO    | Pedunculate Oak                                                                                                                    | No works required for planning application                                                                                                                         |


| Tree No      | Species         | Recommended Works                          |
|--------------|-----------------|--------------------------------------------|
| W2.14<br>TPO | Scots Pine      | No works required for planning application |
| W2.15<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.16<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.17<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.18<br>TPO | Pedunculate Oak | Fell to ground level                       |
| W2.19<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.20<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.21<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.22<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.23<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.24<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.25<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.26<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.27<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.28<br>TPO | Pedunculate Oak | Fell to ground level                       |
| W2.29<br>TPO | Douglas Fir     | No works required for planning application |
| W2.30<br>TPO | Scots Pine      | No works required for planning application |
| W2.31<br>TPO | Scots Pine      | Fell to ground level                       |
| W2.32<br>TPO | Scots Pine      | Fell to ground level                       |
| W2.33<br>TPO | Scots Pine      | Fell to ground level                       |
| W2.34<br>TPO | Scots Pine      | Fell to ground level                       |
| W2.35<br>TPO | Pedunculate Oak | No works required for planning application |
| W2.36<br>TPO | Silver Birch    | Fell to ground level                       |
| W2.37<br>TPO | Scots Pine      | No works required for planning application |
| W2.38<br>TPO | Scots Pine      | No works required for planning application |
| W2.39<br>TPO | European Larch  | No works required for planning application |
| W2.40<br>TPO | Scots Pine      | No works required for planning application |

| Tree No | Species                                                                                                                                                                | Recommended Works                                                                                                                                                                                                                                  |
|---------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| W3      | Crack Willow<br>Silver Birch<br>Sweet Chestnut<br>Hawthorn<br>Field Maple<br>Norway Spruce<br>Yew<br>Alder<br>Cherry Laurel<br>Ash<br>Sycamore<br>Holly<br>Goat Willow | Central section removed as indicated on the Indicative Tree Retention, Removal and Tree Protection Plan (CBA10637.02A TRR&TPP)<br>Retained southern area enhanced for biodiversity, please refer to Landscape and ecological proposals for details |
| W3A     | Goat Willow<br>Cherry Laurel<br>Silver Birch<br>Hawthorn                                                                                                               | No works required for planning application                                                                                                                                                                                                         |
| W3.1    | Crack Willow                                                                                                                                                           | Make safe so it cannot fall across proposed garden fence and retain for habitat value                                                                                                                                                              |
| W3.2    | Ash                                                                                                                                                                    | No works required for planning application                                                                                                                                                                                                         |
| W3.3    | Silver Birch                                                                                                                                                           | Make safe so it cannot fall across proposed garden fence and retain for habitat value                                                                                                                                                              |
| W3.4    | Goat Willow                                                                                                                                                            | No works required for planning application                                                                                                                                                                                                         |
| W3.5    | Pedunculate Oak                                                                                                                                                        | No works required for planning application                                                                                                                                                                                                         |
| W3.6    | Pedunculate Oak                                                                                                                                                        | No works required for planning application                                                                                                                                                                                                         |
| W3.7    | Pedunculate Oak                                                                                                                                                        | No works required for planning application                                                                                                                                                                                                         |
| W3.8    | Pedunculate Oak                                                                                                                                                        | No works required for planning application                                                                                                                                                                                                         |
| W3.9    | Sweet Chestnut                                                                                                                                                         | Make safe so it cannot fall across boundary fence and retain for habitat value                                                                                                                                                                     |
| W3.10   | Pedunculate Oak                                                                                                                                                        | No works required for planning application                                                                                                                                                                                                         |
| W3B     | Crack Willow                                                                                                                                                           | No works required for planning application                                                                                                                                                                                                         |
| W3.11   | Pedunculate Oak                                                                                                                                                        | Remove major deadwood with a branch attachment >50mm on west side of crown                                                                                                                                                                         |
| W3.12   | Scots Pine                                                                                                                                                             | No works required for planning application                                                                                                                                                                                                         |
| W3.13   | Scots Pine                                                                                                                                                             | No works required for planning application                                                                                                                                                                                                         |
| W3.14   | Scots Pine                                                                                                                                                             | No works required for planning application                                                                                                                                                                                                         |
| W3.15   | Scots Pine                                                                                                                                                             | No works required for planning application                                                                                                                                                                                                         |
| W3.16   | Scots Pine                                                                                                                                                             | No works required for planning application                                                                                                                                                                                                         |
| W3.17   | Scots Pine                                                                                                                                                             | No works required for planning application                                                                                                                                                                                                         |
| W3.18   | European Larch                                                                                                                                                         | No works required for planning application                                                                                                                                                                                                         |
| W3.19   | Scots Pine                                                                                                                                                             | No works required for planning application                                                                                                                                                                                                         |
| W3.20   | Sweet Chestnut                                                                                                                                                         | Make safe and retain as eco pole of approximately 5m height for habitat value                                                                                                                                                                      |

| Tree No | Species    | Recommended Works                          |
|---------|------------|--------------------------------------------|
| W3.21   | Scots Pine | No works required for planning application |
| W3.22   | Scots Pine | No works required for planning application |
| W3.23   | Scots Pine | No works required for planning application |
| W3.24   | Common Ash | No works required for planning application |

- All tree works are advised to be carried out between July and September or November and February. Tree works should also avoid the season for nesting birds.
- All tree works should be carried out in accordance with current best practice guidelines and BS3998:2010 – Tree Work Recommendations.
- We recommend the use of an Arboricultural Association Approved Contractor or an ISA Certified Arborist/Tree Worker that is suitably insured and experienced to carry out the tree works.



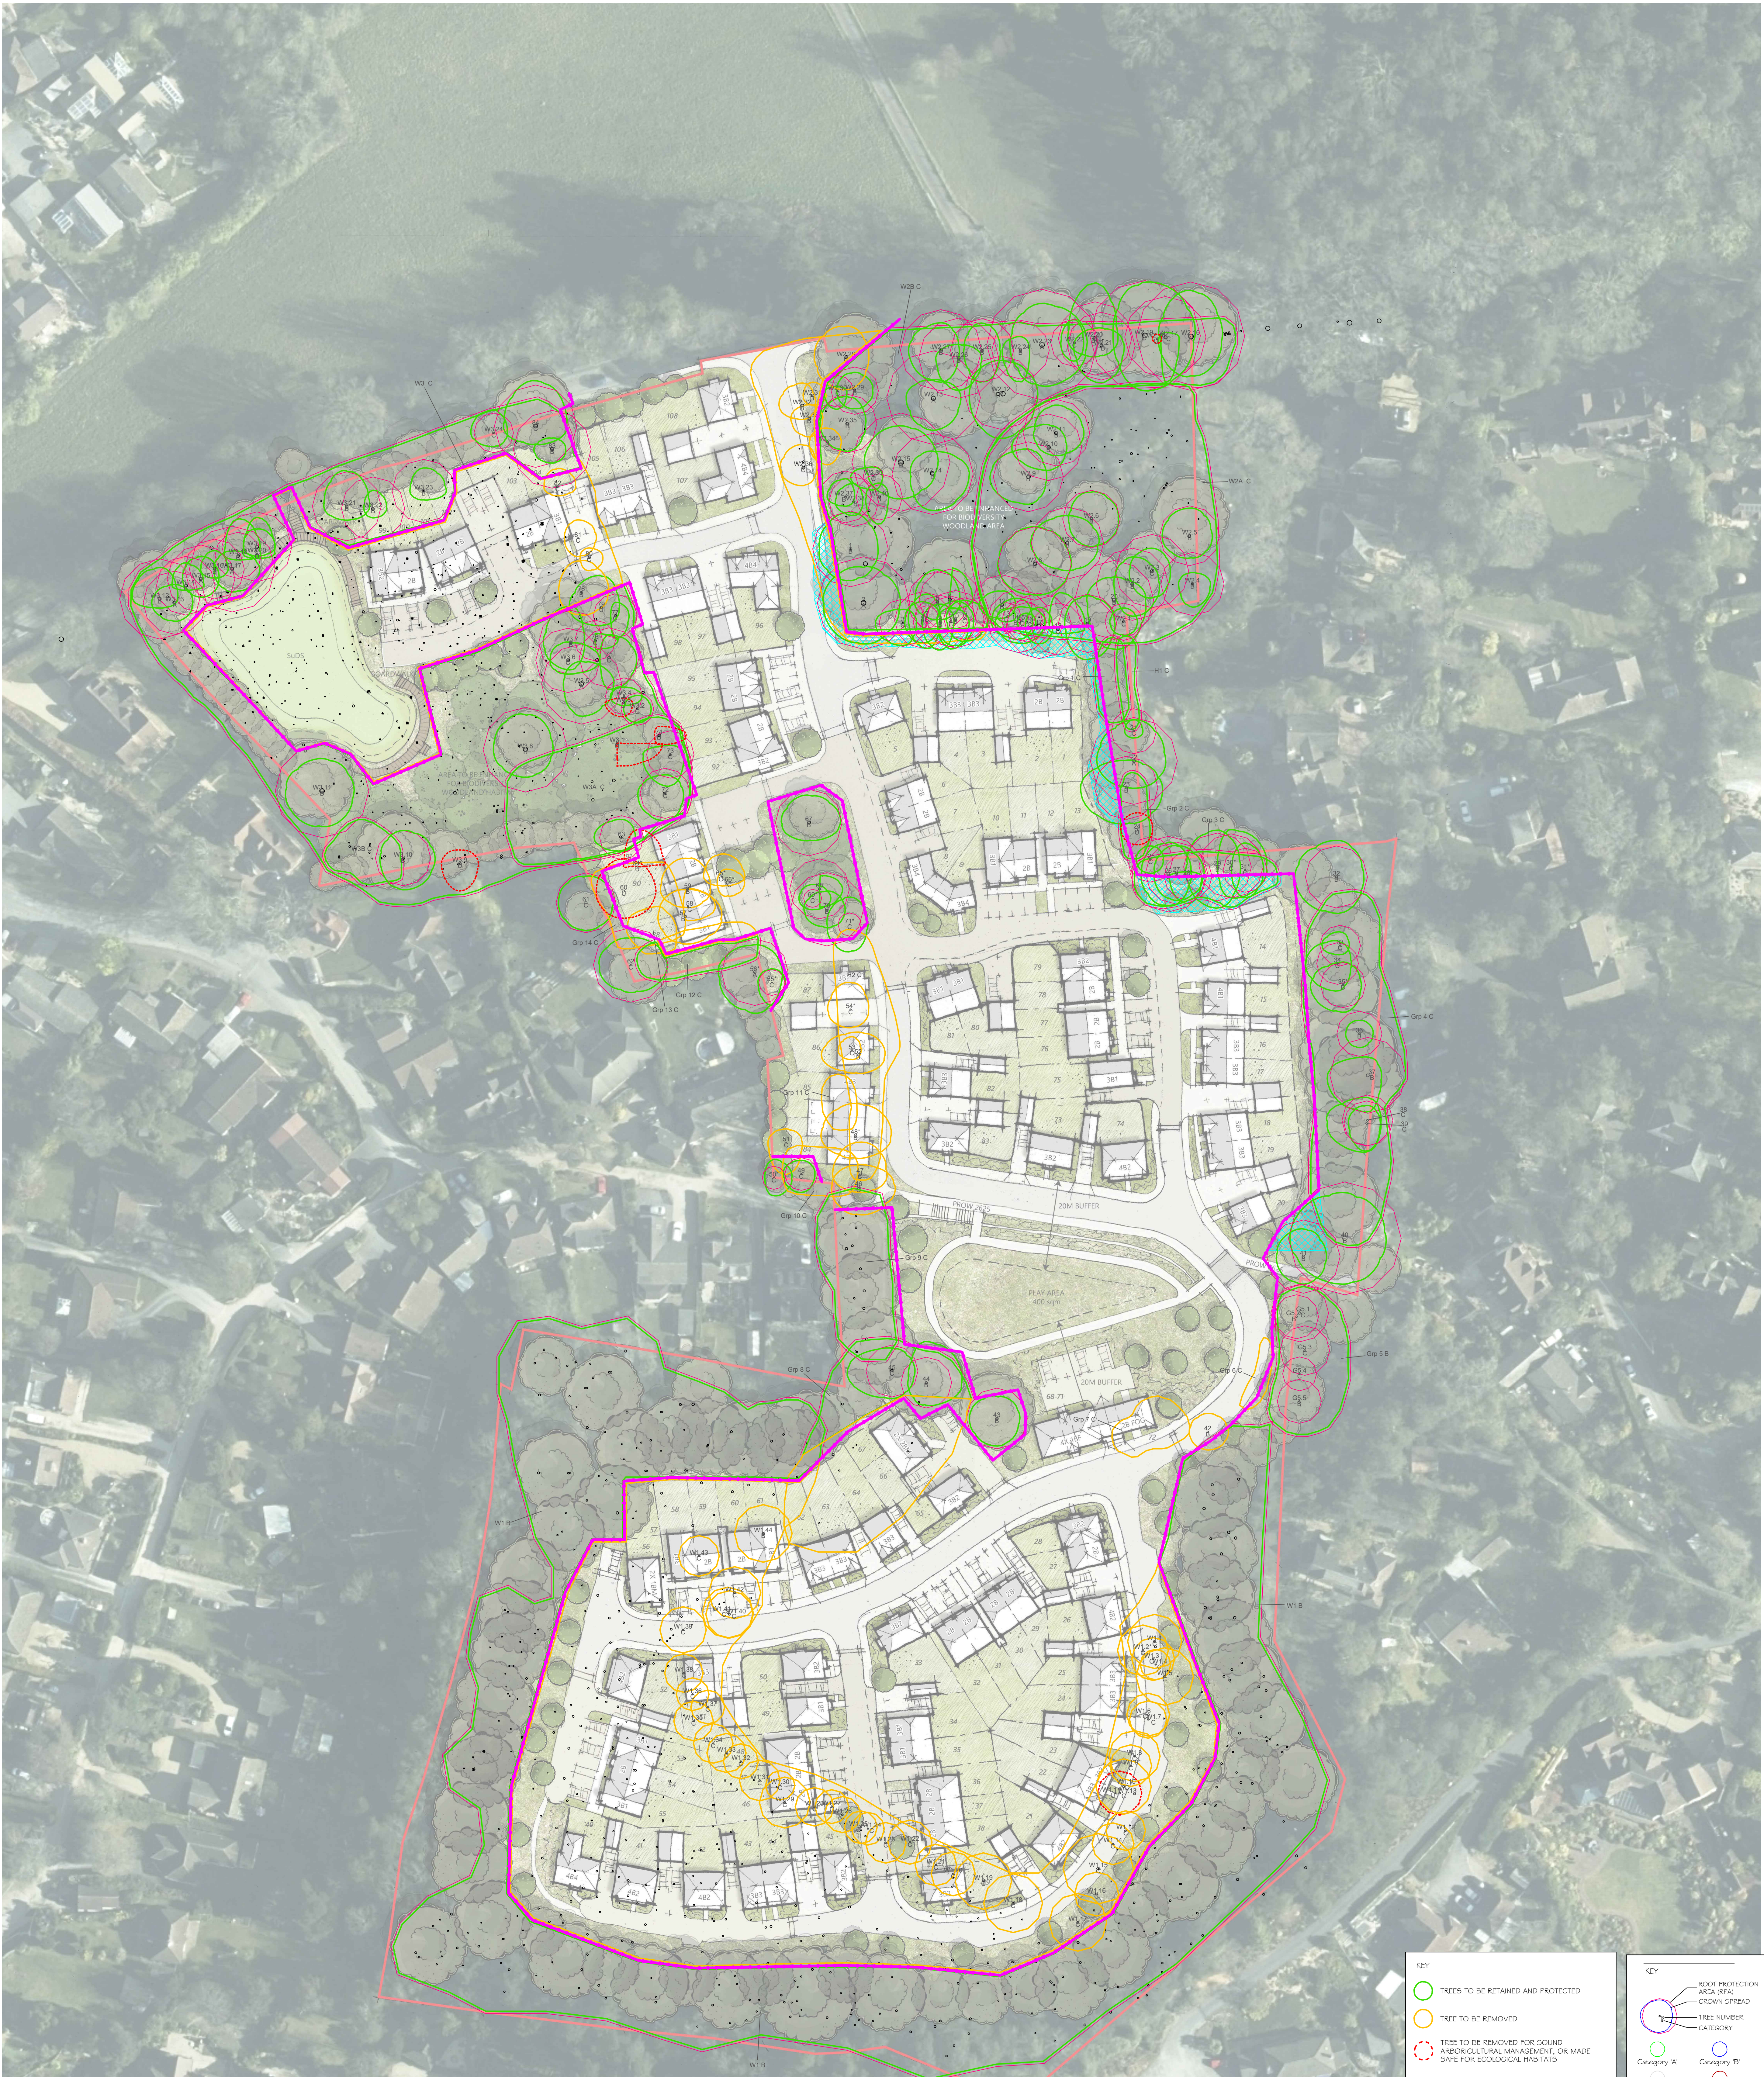

**KEY**

- Trees to be retained and protected
- Tree to be removed
- Tree to be removed for sound arboricultural management, or made safe for ecological habitats
- Indicative location of tree protection barrier
- Indicative precautionary areas of work
- Trunks from topographical survey

**KEY**

- Root Protection Area (RPA) / Crown Spread
- Tree Number
- Category 'A'
- Category 'B'
- Category 'C'
- Category 'U'

NOTE: TREE GROUP NUMBERS MARKED WITH AN \* HAVE APPROXIMATE LOCATIONS

JOB TITLE  
Rock Road,  
Storrington

DRAWING TITLE  
Tree Retention, Removal  
and Indicative Tree  
Protection Plan

CBA DRAWING NO:  
CBA\0637\_02A TRR4TPP

BASE PLAN DRAWING NO:  
THAK230417 IMP-04 D

SCALE  
1:500 at A0

DRAWN  
SD & AM


DATE  
May 2026

THIS DRAWING IS A COMPONENT OF CBA'S TREE AND LANDSCAPE SURVEY REPORT WHICH MUST BE USED IN CONJUNCTION WITH THE REPORT. ALL INFORMATION MUST BE CHECKED ON SITE AND NOT RELIED UPON FROM THIS DRAWING.

**CBA**  
Countryside & Built-up Areas  
100, 101, 102, 103, 104, 105, 106, 107, 108, 109, 110, 111, 112, 113, 114, 115, 116, 117, 118, 119, 120, 121, 122, 123, 124, 125, 126, 127, 128, 129, 130, 131, 132, 133, 134, 135, 136, 137, 138, 139, 140, 141, 142, 143, 144, 145, 146, 147, 148, 149, 150, 151, 152, 153, 154, 155, 156, 157, 158, 159, 160, 161, 162, 163, 164, 165, 166, 167, 168, 169, 170, 171, 172, 173, 174, 175, 176, 177, 178, 179, 180, 181, 182, 183, 184, 185, 186, 187, 188, 189, 190, 191, 192, 193, 194, 195, 196, 197, 198, 199, 200, 201, 202, 203, 204, 205, 206, 207, 208, 209, 210, 211, 212, 213, 214, 215, 216, 217, 218, 219, 220, 221, 222, 223, 224, 225, 226, 227, 228, 229, 230, 231, 232, 233, 234, 235, 236, 237, 238, 239, 240, 241, 242, 243, 244, 245, 246, 247, 248, 249, 250, 251, 252, 253, 254, 255, 256, 257, 258, 259, 260, 261, 262, 263, 264, 265, 266, 267, 268, 269, 270, 271, 272, 273, 274, 275, 276, 277, 278, 279, 280, 281, 282, 283, 284, 285, 286, 287, 288, 289, 290, 291, 292, 293, 294, 295, 296, 297, 298, 299, 300, 301, 302, 303, 304, 305, 306, 307, 308, 309, 310, 311, 312, 313, 314, 315, 316, 317, 318, 319, 320, 321, 322, 323, 324, 325, 326, 327, 328, 329, 330, 331, 332, 333, 334, 335, 336, 337, 338, 339, 340, 341, 342, 343, 344, 345, 346, 347, 348, 349, 350, 351, 352, 353, 354, 355, 356, 357, 358, 359, 360, 361, 362, 363, 364, 365, 366, 367, 368, 369, 370, 371, 372, 373, 374, 375, 376, 377, 378, 379, 380, 381, 382, 383, 384, 385, 386, 387, 388, 389, 390, 391, 392, 393, 394, 395, 396, 397, 398, 399, 400, 401, 402, 403, 404, 405, 406, 407, 408, 409, 410, 411, 412, 413, 414, 415, 416, 417, 418, 419, 420, 421, 422, 423, 424, 425, 426, 427, 428, 429, 430, 431, 432, 433, 434, 435, 436, 437, 438, 439, 440, 441, 442, 443, 444, 445, 446, 447, 448, 449, 450, 451, 452, 453, 454, 455, 456, 457, 458, 459, 460, 461, 462, 463, 464, 465, 466, 467, 468, 469, 470, 471, 472, 473, 474, 475, 476, 477, 478, 479, 480, 481, 482, 483, 484, 485, 486, 487, 488, 489, 490, 491, 492, 493, 494, 495, 496, 497, 498, 499, 500, 501, 502, 503, 504, 505, 506, 507, 508, 509, 510, 511, 512, 513, 514, 515, 516, 517, 518, 519, 520, 521, 522, 523, 524, 525, 526, 527, 528, 529, 530, 531, 532, 533, 534, 535, 536, 537, 538, 539, 540, 541, 542, 543, 544, 545, 546, 547, 548, 549, 550, 551, 552, 553, 554, 555, 556, 557, 558, 559, 560, 561, 562, 563, 564, 565, 566, 567, 568, 569, 570, 571, 572, 573, 574, 575, 576, 577, 578, 579, 580, 581, 582, 583, 584, 585, 586, 587, 588, 589, 590, 591, 592, 593, 594, 595, 596, 597, 598, 599, 600, 601, 602, 603, 604, 605, 606, 607, 608, 609, 610, 611, 612, 613, 614, 615, 616, 617, 618, 619, 620, 621, 622, 623, 624, 625, 626, 627, 628, 629, 630, 631, 632, 633, 634, 635, 636, 637, 638, 639, 640, 641, 642, 643, 644, 645, 646, 647, 648, 649, 650, 651, 652, 653, 654, 655, 656, 657, 658, 659, 660, 661, 662, 663, 664, 665, 666, 667, 668, 669, 670, 671, 672, 673, 674, 675, 676, 677, 678, 679, 680, 681, 682, 683, 684, 685, 686, 687, 688, 689, 690, 691, 692, 693, 694, 695, 696, 697, 698, 699, 700, 701, 702, 703, 704, 705, 706, 707, 708, 709, 710, 711, 712, 713, 714, 715, 716, 717, 718, 719, 720, 721, 722, 723, 724, 725, 726, 727, 728, 729, 730, 731, 732, 733, 734, 735, 736, 737, 738, 739, 740, 741, 742, 743, 744, 745, 746, 747, 748, 749, 750, 751, 752, 753, 754, 755, 756, 757, 758, 759, 760, 761, 762, 763, 764, 765, 766, 767, 768, 769, 770, 771, 772, 773, 774, 775, 776, 777, 778, 779, 780, 781, 782, 783, 784, 785, 786, 787, 788, 789, 790, 791, 792, 793, 794, 795, 796, 797, 798, 799, 800, 801, 802, 803, 804, 805, 806, 807, 808, 809, 810, 811, 812, 813, 814, 815, 816, 817, 818, 819, 820, 821, 822, 823, 824, 825, 826, 827, 828, 829, 830, 831, 832, 833, 834, 835, 836, 837, 838, 839, 840, 841, 842, 843, 844, 845, 846, 847, 848, 849, 850, 851, 852, 853, 854, 855, 856, 857, 858, 859, 860, 861, 862, 863, 864, 865, 866, 867, 868, 869, 870, 871, 872, 873, 874, 875, 876, 877, 878, 879, 880, 881, 882, 883, 884, 885, 886, 887, 888, 889, 890, 891, 892, 893, 894, 895, 896, 897, 898, 899, 900, 901, 902, 903, 904, 905, 906, 907, 908, 909, 910, 911, 912, 913, 914, 915, 916, 917, 918, 919, 920, 921, 922, 923, 924, 925, 926, 927, 928, 929, 930, 931, 932, 933, 934, 935, 936, 937, 938, 939, 940, 941, 942, 943, 944, 945, 946, 947, 948, 949, 950, 951, 952, 953, 954, 955, 956, 957, 958, 959, 960, 961, 962, 963, 964, 965, 966, 967, 968, 969, 970, 971, 972, 973, 974, 975, 976, 977, 978, 979, 980, 981, 982, 983, 984, 985, 986, 987, 988, 989, 990, 991, 992, 993, 994, 995, 996, 997, 998, 999, 1000

Note:  
1. Shading Arcs not shown on this plan.  
2. Root Protection Areas are shown as a theoretical polygon and at this stage do not take into account site features and constraints.  
3. Trees marked with \* and hedge, groups and woodland outlines are indicatively plotted.

TREE PRESERVATION ORDER: Some of the trees are protected by a Tree Preservation Order with reference Land Between Patuca & Thakeham Tile Works, Rock Road, Thakeham (TPO 1995), served and administered by Horsham District Council: Trees 1 to 20, W2A containing W2.1 to W2.11 and W2B containing W2.12 to W2.40.



**KEY**

- Root Protection Area (RPA) / Crown Spread
- Tree Number
- Category 'A'
- Category 'B'
- Category 'C'
- Category 'U'

NOTE: TREE GROUP NUMBERS MARKED WITH AN \* HAVE APPROXIMATE LOCATIONS

JOB TITLE  
Rock Road,  
Storrington

DRAWING TITLE  
Tree Retention, Removal  
and Indicative Tree  
Protection Plan

CBA DRAWING NO:  
CBA\0637\_02A TRR4TPP

BASE PLAN DRAWING NO:  
THAK230417 IMP-04 D

SCALE  
1:500 at A0

DRAWN  
SD & AM

DATE  
May 2026

THIS DRAWING IS A COMPONENT OF CBA'S TREE AND LANDSCAPE SURVEY REPORT WHICH MUST BE USED IN CONJUNCTION WITH THE REPORT. ALL INFORMATION MUST BE CHECKED ON SITE AND NOT RELIED UPON FROM THIS DRAWING.

**CBA**  
Countryside & Built-up Areas  
100, 101, 102, 103, 104, 105, 106, 107, 108, 109, 110, 111, 112, 113, 114, 115, 116, 117, 118, 119, 120, 121, 122, 123, 124, 125, 126, 127, 128, 129, 130, 131, 132, 133, 134, 135, 136, 137, 138, 139, 140, 141, 142, 143, 144, 145, 146, 147, 148, 149, 150, 151, 152, 153, 154, 155, 156, 157, 158, 159, 160, 161, 162, 163, 164, 165, 166, 167, 168, 169, 170, 171, 172, 173, 174, 175, 176, 177, 178, 179, 180, 181, 182, 183, 184, 185, 186, 187, 188, 189, 190, 191, 192, 193, 194, 195, 196, 197, 198, 199, 200, 201, 202, 203, 204, 205, 206, 207, 208, 209, 210, 211, 212, 213, 214, 215, 216, 217, 218, 219, 220, 221, 222, 223, 224, 225, 226, 227, 228, 229, 230, 231, 232, 233, 234, 235, 236, 237, 238, 239, 240, 241, 242, 243, 244, 245, 246, 247, 248, 249, 250, 251, 252, 253, 254, 255, 256, 257, 258, 259, 260, 261, 262, 263, 264, 265, 266, 267, 268, 269, 270, 271, 272, 273, 274, 275, 276, 277, 278, 279, 280, 281, 282, 283, 284, 285, 286, 287, 288, 289, 290, 291, 292, 293, 294, 295, 296, 297, 298, 299, 300, 301, 302, 303, 304, 305, 306, 307, 308, 309, 310, 311, 312, 313, 314, 315, 316, 317, 318, 319, 320, 321, 322, 323, 324, 325, 326, 327, 328, 329, 330, 331, 332, 333, 334, 335, 336, 337, 338, 339, 340, 341, 342, 343, 344, 345, 346, 347, 348, 349, 350, 351, 352, 353, 354, 355, 356, 357, 358, 359, 360, 361, 362, 363, 364, 365, 366, 367, 368, 369, 370, 371, 372, 373, 374, 375, 376, 377, 378, 379, 380, 381, 382, 383, 384, 385, 386, 387, 388, 389, 390, 391, 392, 393, 394, 395, 396, 397, 398, 399, 400, 401, 402, 403, 404, 405, 406, 407, 408, 409, 410, 411, 412, 413, 414, 415, 416, 417, 418, 419, 420, 421, 422, 423, 424, 425, 426, 427, 428, 429, 430, 431, 432, 433, 434, 435, 436, 437, 438, 439, 440, 441, 442, 443, 444, 445, 446, 447, 448, 449, 450, 451, 452, 453, 454, 455, 456, 457, 458, 459, 460, 461, 462, 463, 464, 465, 466, 467, 468, 469, 470, 471, 472, 473, 474, 475, 476, 477, 478, 479, 480, 481, 482, 483, 484, 485, 486, 487, 488, 489, 490, 491, 492, 493, 494, 495, 496, 497, 498, 499, 500, 501, 502, 503, 504, 505, 506, 507, 508, 509, 510, 511, 512, 513, 514, 515, 516, 517, 518, 519, 520, 521, 522, 523, 524, 525, 526, 527, 528, 529, 530, 531, 532, 533, 534, 535, 536, 537, 538, 539, 540, 541, 542, 543, 544, 545, 546, 547, 548, 549, 550, 551, 552, 553, 554, 555, 556, 557, 558, 559, 560, 561, 562, 563, 564, 565, 566, 567, 568, 569, 570, 571, 572, 573, 574, 575, 576, 577, 578, 579, 580, 581, 582, 583, 584, 585, 586, 587, 588, 589, 590, 591, 592, 593, 594, 595, 596, 597, 598, 599, 600, 601, 602, 603, 604, 605, 606, 607, 608, 609, 610, 611, 612, 613, 614, 615, 616, 617, 618, 619, 620, 621, 622, 623, 624, 625, 626, 627, 628, 629, 630, 631, 632, 633, 634, 635, 636, 637, 638, 639, 640, 641, 642, 643, 644, 645, 646, 647, 648, 649, 650, 651, 652, 653, 654, 655, 656, 657, 658, 659, 660, 661, 662, 663, 664, 665, 666, 667, 668, 669, 670, 671, 672, 673, 674, 675, 676, 677, 678, 679, 680, 681, 682, 683, 684, 685, 686, 687, 688, 689, 690, 691, 692, 693, 694, 695, 696, 697, 698, 699, 700, 701, 702, 703, 704, 705, 706, 707, 708, 709, 710, 711, 712, 713, 714, 715, 716, 717, 718, 719, 720, 721, 722, 723, 724, 725, 726, 727, 728, 729, 730, 731, 732, 733, 734, 735, 736, 737, 738, 739, 740, 741, 742, 743, 744, 745, 746, 747, 748, 749, 750, 751, 752, 753, 754, 755, 756, 757, 758, 759, 760, 761, 762, 763, 764, 765, 766, 767, 768, 769, 770, 771, 772, 773, 774, 775, 776, 777, 778, 779, 780, 781, 782, 783, 784, 785, 786, 787, 788, 789, 790, 791, 792, 793, 794, 795, 796, 797, 798, 799, 800, 801, 802, 803, 804, 805, 806, 807, 808, 809, 810, 811, 812, 813, 814, 815, 816, 817, 818, 819, 820, 821, 822, 823, 824, 825, 826, 827, 828, 829, 830, 831, 832, 833, 834, 835, 836, 837, 838, 839, 840, 841, 842, 843, 844, 845, 846, 847, 848, 849, 850, 851, 852, 853, 854, 855, 856, 857, 858, 859, 860, 861, 862, 863, 864, 865, 866, 867, 868, 869, 870, 871, 872, 873, 874, 875, 876, 877, 878, 879, 880, 881, 882, 883, 884, 885, 886, 887, 888, 889, 890, 891, 892, 893, 894, 895, 896, 897, 898, 899, 900, 901, 902, 903, 904, 905, 906, 907, 908, 909, 910, 911, 912, 913, 914, 915, 916, 917, 918, 919, 920, 921, 922, 923, 924, 925, 926, 927, 928, 929, 930, 931, 932, 933, 934, 935, 936, 937, 938, 939, 940, 941, 942, 943, 944, 945, 946, 947, 948, 949, 950, 951, 952, 953, 954, 955, 956, 957, 958, 959, 960, 961, 962, 963, 964, 965, 966, 967, 968, 969, 970, 971, 972, 973, 974, 975, 976, 977, 978, 979, 980, 981, 982, 983, 984, 985, 986, 987, 988, 989, 990, 991, 992, 993, 994, 995, 996, 997, 998, 999, 1000





*The Professional Arboricultural Consultancy*

## Qualifications of Stefan Rose Principal Consultant

**Stefan Rose** *BSc (Hons), TechCert (Arbor.A), TechArbor.A*, joined CBA Trees in 1998 as a junior surveyor and having gained extensive knowledge and a wealth of experience over the years including Professional Tree Inspectors Certification (LANTRA), has progressed to Principal Consultant. He has considerable experience in working as a locum for Local Authorities, assessing new and extant Tree Preservation Orders, and continues to work on a number of major development projects nationwide.

As our Principal Consultant Stefan undertakes a full range of arboricultural services from health and safety audits to BS5837:2012 tree surveys, providing expert advice and guidance on initial feasibility site assessments to full scale planning applications. He is accomplished at producing implication assessments and method statements for the submission of planning applications, working with both individual home owners and within multi-disciplinary teams to achieve successful arboricultural outcomes.