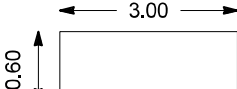


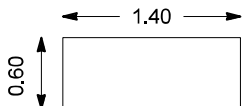
Contract:		Client:		Trial Pit:	
Church Lane, Ashington		Bellway Homes Limited		TP15	
Contract Ref:	Start: 24.11.21	Ground Level (m AOD):	National Grid Co-ordinate:	Sheet:	
52368	End: 24.11.21	27.98	E:512349.3 N:116149.1	1 of 1	

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.00-0.20 0.00	1	ES PID	0.0ppm			Soft dark brown silty CLAY with frequent decayed wood and rootlets. (TOPSOIL)	0.20	
0.40-0.60 0.50	1	D V	$c_u=51$			Firm light brown sandy silty CLAY with frequent roots and rootlets, Sand is fine to coarse. (WEALD CLAY FORMATION) Firm to stiff medium strength orangish brown mottled bluish grey silty CLAY with occasional roots. (WEALD CLAY FORMATION) ... From 0.70m depth: Becoming stiff reddish brown mottled bluish grey silty CLAY.	0.40	
0.90-1.10 1.00	2	D V	$c_u=63$			... From 1.40m depth: Stiff orangish brown mottled bluish grey silty CLAY with frequent pockets of reddish brown to black mudstone gravel. ... From 1.70m depth: weak orange grey siltstone in a matrix of extremely friable orangish brown to grey silty CLAY. ... From 2.60m depth: Gravel of weak reddish brown to grey mudstone. Gravel is fine to coarse, subangular.	(2.60)	
2.90-3.00	3	D				Trial pit terminated at 3.00m depth.	3.00	

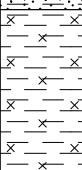
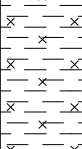
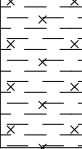
Plan (Not to Scale) 		General Remarks 1. Trial pit remained stable during excavation. 2. Trial pit remained dry during excavation. 3. Trial pit backfilled with arisings.	
		All dimensions in metres	Scale: 1:25
Method Used: Machine dug	Plant Used: 8 Ton Tracked Excavator	Logged By: JCurnow	Checked By: 

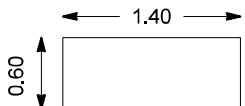
Contract: Church Lane, Ashington		Client: Bellway Homes Limited		Trial Pit: TPS01
Contract Ref: 52368	Start: 23.11.21 End: 23.11.21	Ground Level (m AOD): 28.52	National Grid Co-ordinate: E:512699.5 N:115954.0	Sheet: 1 of 1

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.00-0.30 0.00	1	ES PID	0.0ppm			Brown gravelly silty SAND with frequent glass, porcelain, brick fragments and occasional rootlets. Sand is fine to coarse. Gravel is subangular to subrounded fine flint and chalk. (MADE GROUND)	(0.30) 0.30	
0.50-0.60	1	D				Orangish brown mottled grey firm to stiff silty slightly gravelly CLAY with occasional brick fragments. Gravel is fine to coarse subangular to subrounded flint and chalk. (WEALD CLAY FORMATION)	(0.40) 0.70	
0.90-1.10	2	D				Firm orangish brown mottled grey silty CLAY. (WEALD CLAY FORMATION)	(0.80)	
1.40-1.50	3	D				Trial pit terminated at 1.50m depth.	1.50	

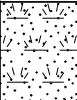
Plan (Not to Scale) 		General Remarks 1. Trial pit remained stable during excavation. 2. Water seepage at 1.50m depth. 3. Trial pit backfilled with arisings.	
All dimensions in metres		Scale: 1:25	
Method Used: Machine dug	Plant Used: 8 Ton Tracked Excavator	Logged By: JCurnow	Checked By: 

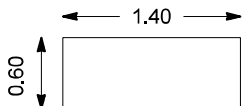
Contract: Church Lane, Ashington		Client: Bellway Homes Limited		Trial Pit: TPS02
Contract Ref: 52368	Start: 23.11.21 End: 23.11.21	Ground Level (m AOD): 26.66	National Grid Co-ordinate: E:512515.0 N:116093.5	Sheet: 1 of 1

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.00-0.20 0.00	1	ES PID	0.0ppm			Soft light brown mottled reddish brown slightly gravelly sandy silty CLAY with fine rootlets. Sand is fine. Gravel is fine subangular flint. (TOPSOIL)	(0.30) 0.30	
0.40-0.60	1	D				Soft to firm grey mottled orangish brown silty CLAY with frequent lignite. (WEALD CLAY FORMATION)		
1.40-1.60	2	D				... From 0.90m depth: Stiff bluish grey mottled orangish brown silty CLAY.	(1.60)	
						... From 1.70m depth: Becoming slightly friable (same description otherwise).	1.90	
						Trial pit terminated at 1.90m depth.		

Plan (Not to Scale) 		General Remarks 1. Trial pit remained stable during excavation. 2. Trial pit remained dry during excavation. 3. Trial pit backfilled with arisings.	
All dimensions in metres		Scale: 1:25	
Method Used: Machine dug	Plant Used: 8 Ton Tracked Excavator	Logged By: JCurnow	Checked By: 

Contract: Church Lane, Ashington		Client: Bellway Homes Limited		Trial Pit: TPS03
Contract Ref: 52368	Start: 23.11.21 End: 23.11.21	Ground Level (m AOD): 27.80	National Grid Co-ordinate: E:512385.2 N:116151.7	Sheet: 1 of 1

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.00-0.20 0.00	1	ES PID	0.0ppm			Firm dark brown silty CLAY with frequent rootlets. (TOPSOIL)	(0.40)	
0.40-0.50	1	D				Firm orangish brown mottled grey silty CLAY with rootlets and roots and rare brick fragments. (MADE GROUND) Firm orangish brown mottled grey silty CLAY. (WEALD CLAY FORMATION)	0.40 0.50	
1.20-1.30	2	D				... From 1.30m depth: Becoming firm friable orangish brown mottled grey silty CLAY with rare roots. ... From 1.50m depth: Becoming extremely friable orangish brown mottled grey silty CLAY.	(1.50)	
1.80-2.00	3	D					2.00	
						Trial pit terminated at 2.00m depth.		

Plan (Not to Scale) 		General Remarks 1. Trial pit remained stable during excavation. 2. Trial pit remained dry during excavation. 3. Trial pit backfilled with arisings.	
All dimensions in metres		Scale: 1:25	
Method Used: Machine dug	Plant Used: 8 Ton Tracked Excavator	Logged By: JCurnow	Checked By: 

WINDOW SAMPLE LOG

Contract: Church Lane, Ashington		Client: Bellway Homes Limited		Window Sample: WS01
Contract Ref: 52368	Start: 24.11.21 End: 24.11.21	Ground Level (m AOD): 33.07	National Grid Co-ordinate: E:512630.6 N:115882.8	Sheet: 1 of 2

Progress	Samples / Tests				Water	Backfill & Instrumentation	Description of Strata	Depth (Thickness)	Material Graphic Legend
Window Run	Depth	No	Type	Results					
	0.10-0.20 0.20	1	ES PID	0.0ppm			MADE GROUND: Grass over soft brown silty sandy gravelly CLAY. Sand is fine to coarse. Gravel is angular to subangular fine to medium flint, brick, wood, glass and clinker. (MADE GROUND)	(0.50)	
	0.60-0.70 0.60	2	ES PID	0.0ppm			MADE GROUND: Soft brown silty sandy very gravelly CLAY. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint, brick, clinker, ceramic and chalk. (MADE GROUND)	(0.60)	
	1.00-1.45 1.10-1.20 1.20	1 3	SPT ES PID	N=4 0.4ppm			MADE GROUND: Soft to firm bluish grey sandy gravelly CLAY. Sand is fine to coarse. Gravel is angular to subrounded fine to medium flint, brick, glass, clinker and wood. (MADE GROUND)	1.10 (1.00)	
	2.00-2.45	2	SPT	N=7				2.10	
	2.20-2.40	1	D				Firm to stiff medium strength orangish brown grey mottled sandy CLAY. Sand is fine to coarse with frequent black organics (decayed roots). (WEALD CLAY FORMATION)	(0.90)	
	2.50		V	c _u =52/50/44				3.00	
	3.00-3.45	3	SPT	N=13			Very stiff orange grey mottled sandy dessicated CLAY. (WEALD CLAY FORMATION)	(1.60)	
	3.30-3.50	2	D						
	4.00-4.45	4	SPT	N=23					

Drilling Progress and Water Observations						General Remarks	
Date	Time	Borehole Depth (m)	Casing Depth (m)	Borehole Diameter (mm)	Water Depth (m)		
						1. Inspection pit hand dug to 1.00m depth. 2. No groundwater encountered. 3. Installed to 4.60m - 1.00m plain pipe, 4.00m slotted pipe (0.4m plain pipe above ground level).	
All dimensions in metres						Scale:	1:25
Method Used:	Tracked window sampling		Plant Used:	Premier 110		Drilled By:	GEH
						Logged By:	JCurnow
						Checked By:	AGS

WINDOW SAMPLE LOG

Contract: Church Lane, Ashington		Client: Bellway Homes Limited		Window Sample: WS01
Contract Ref: 52368	Start: 24.11.21 End: 24.11.21	Ground Level (m AOD): 33.07	National Grid Co-ordinate: E:512630.6 N:115882.8	Sheet: 2 of 2

Progress	Samples / Tests				Water	Backfill & Instrumentation	Description of Strata	Depth (Thickness)	Material Graphic Legend
Window Run	Depth	No	Type	Results					
							Window sample hole terminated at 4.60m depth.	4.60	

Drilling Progress and Water Observations						General Remarks													
Date	Time	Borehole Depth (m)	Casing Depth (m)	Borehole Diameter (mm)	Water Depth (m)														
Method Used:		Tracked window sampling		Plant Used:		Premier 110		Drilled By:		GEH		Logged By:		JCurnow		Checked By:		 AGS	

WINDOW SAMPLE LOG

Contract: Church Lane, Ashington		Client: Bellway Homes Limited		Window Sample: WS02
Contract Ref: 52368	Start: 24.11.21 End: 24.11.21	Ground Level (m AOD): 28.23	National Grid Co-ordinate: E:512609.0 N:116019.6	Sheet: 1 of 1

Progress	Samples / Tests				Water	Backfill & Instrumentation	Description of Strata	Depth (Thickness)	Material Graphic Legend
Window Run	Depth	No	Type	Results					
	0.10-0.20 0.20	1	ES PID	0.0ppm			Grass over soft brown slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is angular to subrounded fine to medium flint and wood. Frequent rootlets. (TOPSOIL)	0.20	
	0.50-0.60	1	D				Soft orangish brown sandy CLAY. Sand is fine to coarse. Frequent rootlets. (WEALD CLAY FORMATION)	0.40 (0.40)	
	1.00-1.45	1	SPT	N=10			Firm orangish brown light grey mottled slightly gravelly angular to subangular fine to coarse flint sandy CLAY. Sand is fine to coarse. Occasional rootlets. (WEALD CLAY FORMATION)	0.80 (0.30)	
	1.50-1.70 1.50	2	D V	c _u =58/55/54			Firm light grey orange mottled sandy CLAY. Sand is fine to coarse. Red weathering at 0.90m. (WEALD CLAY FORMATION)	1.10	
	2.00-2.45	2	SPT	N=18			Firm to stiff medium strength light grey orange mottled sandy CLAY. Sand is fine to coarse. Brown stained. (WEALD CLAY FORMATION)	(1.00)	
	2.50-3.50 2.50	3	D V	c _u =68/67/65			Stiff medium strength dark grey brown mottled sandy CLAY. Sand is fine to coarse. Rare black organics (decayed roots). (WEALD CLAY FORMATION)	2.10 (1.35)	
	3.00-3.45	3	SPT	N=42				3.45	
							Window sample hole terminated at 3.45m depth.		

Drilling Progress and Water Observations						General Remarks
Date	Time	Borehole Depth (m)	Casing Depth (m)	Borehole Diameter (mm)	Water Depth (m)	
						1. Inspection pit hand dug to 1.00m depth. 2. No groundwater encountered. 3. Installed to 3.45m - 1.00m plain pipe, 3.00m slotted (0.45m plain pipe above ground level).
All dimensions in metres						Scale: 1:25
Method Used: Tracked window sampling	Plant Used: Premier 110		Drilled By: GEH	Logged By: JCurnow	Checked By:	

WINDOW SAMPLE LOG

Contract: Church Lane, Ashington			Client: Bellway Homes Limited		Window Sample: WS03
Contract Ref: 52368	Start: 24.11.21 End: 24.11.21	Ground Level (m AOD): 26.88	National Grid Co-ordinate: E:512582.1 N:116095.9		Sheet: 1 of 1

Progress	Samples / Tests				Water	Backfill & Instrumentation	Description of Strata	Depth (Thickness)	Material Graphic Legend
Window Run	Depth	No	Type	Results					
	0.10-0.20 0.20	1	ES PID	0.0ppm			Grass over soft brown silty sandy gravelly CLAY. Sand is fine to coarse. Gravel is angular fine to medium chalk and wood. Frequent rootlets. (TOPSOIL)	0.20	
	0.50-0.70	1	D				Soft orangish brown sandy CLAY. Sand is fine to coarse. Occasional rootlets. (WEALD CLAY FORMATION)	0.40	
	1.00-1.45	1	SPT	N=20			Firm orangish brown grey mottled slightly gravelly sandy CLAY. Sand is fine to coarse. Gravel is angular to subangular fine to medium flint. Frequent black organics (decayed roots). (WEALD CLAY FORMATION)	(0.80)	
	1.50-1.70	2	D				Firm orange light grey mottled very sandy CLAY. Sand is fine to coarse. Frequent black organics. (WEALD CLAY FORMATION)	1.20	
	1.80		V	c _u =76/73/72			Orange light grey mottled clayey fine to coarse SAND. (WEALD CLAY FORMATION)	1.30	
	2.00-2.45	2	SPT	N=34			Stiff medium strength light grey orange mottled sandy CLAY. Sand is fine to coarse. Frequent black organics. (WEALD CLAY FORMATION)	1.50	
	2.50-2.70 2.50	3	D V	c _u =87/85/84			Stiff light grey orange mottled very sandy CLAY. Sand is fine to coarse. (WEALD CLAY FORMATION)	(0.40)	
	2.70-3.15	3	SPT	N=35			Orangish brown clayey fine to coarse SAND. (WEALD CLAY FORMATION)	1.90	
							Very stiff high strength dark grey orange mottled sandy CLAY. Sand is fine to coarse. (WEALD CLAY FORMATION)	2.00	
							Window sample hole terminated at 3.15m depth due to refusal.	(0.30)	
								2.30	
								(0.85)	
								3.15	

Drilling Progress and Water Observations						General Remarks	
Date	Time	Borehole Depth (m)	Casing Depth (m)	Borehole Diameter (mm)	Water Depth (m)		
						1. Inspection pit hand dug to 1.00m depth. 2. No groundwater encountered. 3. Installed to 2.70m - 1.00m plain pipe, 2.00m slotted (0.30m plain pipe above ground level).	
All dimensions in metres						Scale:	1:25
Method Used:	Tracked window sampling		Plant Used:	Premier 110		Drilled By:	GEH
						Logged By:	JCurnow
						Checked By:	AGS

WINDOW SAMPLE LOG

Contract: Church Lane, Ashington			Client: Bellway Homes Limited		Window Sample: WS04
Contract Ref: 52368	Start: 24.11.21 End: 24.11.21	Ground Level (m AOD): 26.88	National Grid Co-ordinate: E:512416.1 N:116189.3		Sheet: 1 of 1

Progress	Samples / Tests				Water Backfill & Instrumentation	Description of Strata	Depth (Thickness)	Material Graphic Legend
Window Run	Depth	No	Type	Results				
	0.10-0.20 0.20	1	ES PID	0.0ppm		Soft brown silty sandy gravelly CLAY. Sand is fine to coarse. Gravel is angular to subangular flint and wood. (TOPSOIL)	0.20	
	0.50-0.70	1	D			Soft orangish brown grey mottled sandy CLAY. Sand is fine to coarse. Occasional rootlets. (WEALD CLAY FORMATION)	(0.50) 0.70	
	1.00-1.45	1	SPT	N=18		Firm light grey orange mottled sandy slightly fissured CLAY. Sand is fine to coarse. Rare rootlets. (WEALD CLAY FORMATION)	(0.30) 1.00	
	1.50-1.70	2	D			Stiff light grey orange mottled sandy CLAY. Sand is fine to coarse. Occasional black organics (decayed roots). (WEALD CLAY FORMATION)	(1.00)	
	2.00-2.45	2	SPT	N=17		... Between 1.80m to 2.00m depth: Heavily weathered.	2.00	
	2.50-2.70	3	D			Very stiff bluish grey orange mottled sandy CLAY. Sand is fine to coarse. Frequent black organics (decayed roots) and occasional weathering. (WEALD CLAY FORMATION)	(1.45)	
	3.00-3.45	3	SPT	N=50		... Between 2.70m to 3.00m depth: Fractures infilled with fine to coarse orange sand.	3.45	
						Window sample hole terminated at 3.45m depth due to refusal.		

Drilling Progress and Water Observations						General Remarks	
Date	Time	Borehole Depth (m)	Casing Depth (m)	Borehole Diameter (mm)	Water Depth (m)		
						1. Inspection pit hand dug to 1.00m depth. 2. No groundwater encountered. 3. Installed to 3.45m - 2.00m plain pipe, 2.00m slotted (0.45m plain pipe above ground level).	
All dimensions in metres						Scale:	1:25
Method Used:	Tracked window sampling		Plant Used:	Premier 110		Drilled By:	GEH
						Logged By:	JCurnow
						Checked By:	AGS

WINDOW SAMPLE LOG

Contract: Church Lane, Ashington		Client: Bellway Homes Limited		Window Sample: WS05	
Contract Ref: 52368	Start: 24.11.21 End: 24.11.21	Ground Level (m AOD): 27.18	National Grid Co-ordinate: E:512294.4 N:116190.4	Sheet: 1 of 1	

Progress	Samples / Tests				Water	Backfill & Instrumentation	Description of Strata	Depth (Thickness)	Material Graphic Legend
Window Run	Depth	No	Type	Results					
	0.10-0.20 0.20	1	ES PID	0.0ppm			Soft brown silty sandy gravelly CLAY. Sand is fine to coarse. Gravel is angular to subangular fine to coarse flint and wood. Frequent rootlets. (TOPSOIL)	0.20	
	0.50-0.60	1	D				Soft brown orange grey mottled sandy CLAY. Sand is fine to coarse. Occasional rootlets. (WEALD CLAY FORMATION)	(0.40) 0.60	
	1.00-1.45	1	SPT	N=10			Firm light grey orange mottled sandy CLAY. Sand is fine to coarse. Weathered red at 0.90m. (WEALD CLAY FORMATION)	(0.60) 1.20	
	1.50-1.75 1.50	2	D V	c _u =48/52/46			Stiff medium strength light grey orange mottled sandy CLAY. Sand is fine to coarse. (WEALD CLAY FORMATION)	(0.50) 1.70	
	2.00-2.45	2	SPT	N=19			Very stiff light grey orange mottled sandy fissured CLAY. Occasional black organics (decayed roots). (WEALD CLAY FORMATION)	(0.50) 2.20	
	2.50-2.75 2.50	3	D V	c _u =64/60/59			Very stiff medium strength bluish grey orange mottled slightly sandy CLAY. Frequent black organics (decayed roots). Frequently orange stained after 2.70m. (WEALD CLAY FORMATION)	(1.25) 3.45	
	3.00-3.45	3	SPT	N=36			Window sample hole terminated at 3.45m depth.		

Drilling Progress and Water Observations						General Remarks
Date	Time	Borehole Depth (m)	Casing Depth (m)	Borehole Diameter (mm)	Water Depth (m)	
						1. Inspection pit hand dug to 1.00m depth. 2. No groundwater encountered. 3. Installed to 3.45m - 1.00m plain pipe, 3.00m slotted (0.45m plain pipe above ground level).
All dimensions in metres						Scale: 1:25
Method Used:	Tracked window sampling		Plant Used:	Premier 110		Drilled By: GEH Logged By: JCurnow Checked By: 

Appendix B Site Specific Exploratory Hole Records

 Unit 7, Danworth Farm Hurstpierpoint BN6 9GL www.gesl.net				Trial Pit Log				TrialPit No TP1 Sheet 1 of 1	
Project Name: Rectory Lane, Ashington				Project No. GE10884		Co-ords: 512463.00 - 116479.00 Level:		Date 18/06/2015	
Location: Rectory Lane, Ashington, West Sussex RH20 3AS						Dimensions (m): 3.00 		Scale 1:25	
Client: Taylor Wimpey						Depth 3.00		Logged CA	
Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description		
	Depth	Type	Results						
	0.20	ES		0.30			Grass over dark brown silty clay with frequent rootlets. TOPSOIL		
	0.50	D		0.60			Stiff dark brown mottled grey slightly sandy silty CLAY. WEALD CLAY		
	0.50	ES							
	0.50	PP	PP=2.5kg/cm2				Stiff dark grey mottled red silty CLAY. WEALD CLAY		
	1.00	D		1.90					
	1.00	PP	PP=1.75kg/cm2						
	1.50	D							
	1.50	PP	PP=2kg/cm2						
	2.00	D							
	2.00	PP	PP=2kg/cm2						
2.50	D		2.90			Stiff to very stiff dark red mottled grey slightly sandy silty CLAY. WEALD CLAY			
2.50	PP	PP=3.5kg/cm2				<i>becoming very stiff from 2.5m</i>			
3.00	D								
3.00	PP	PP=4.5kg/cm2	3.00			Hard dark reddish brown silty CLAY with occasional thin mudstone partings. WEALD CLAY			
							End of Pit at 3.00m		
Remarks									
Stability Stable									





Unit 7, Danworth Farm
Hurstpierpoint
BN6 9GL

Geo-Environmental www.gesl.net

Trial Pit Log

Trial Pit No

TP2

Sheet 1 of 1

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512535.00 - 116464.00
Level:

Date
18/06/2015

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

Dimensions (m): 3.00

Depth
3.00

0.80

Scale
1:25

Logged
CA

Client: Taylor Wimpey

Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
	Depth	Type	Results					
	0.20	ES		0.50			Grass over dark brown silty clay with frequent rootlets and roots up to 20mm. MADE GROUND	
	0.50	ES					plastic drainage pipe with gravel fill observed at 0.3m	
	0.50	D					Stiff to hard dark brown mottled grey slightly sandy silty CLAY. WEALD CLAY	
	1.00	D						1
	1.00	PP	PP=1.5kg/cm2					
	1.50	D					becoming very stiff from 1.5m	
	1.50	PP	PP=2.5kg/cm2					
	2.00	D					becoming hard from 2.0m	2
	2.00	PP	PP=4kg/cm2					
	2.50	D						
	2.50	PP	PP=4.5kg/cm2					
	2.80	PP	PP=4.5kg/cm2					
	3.00	D		3.00			End of Pit at 3.00m	3
								4
								5

Water Strikes

Depth Strike

Rose to (mbsgl)

Remarks

Stability Stable



Trial Pit Log

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512499.00 - 116513.00
Level:

Date
19/06/2015

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

Dimensions (m): 3.00

Scale
1:25

Client: Taylor Wimpey

Depth
3.00

0.80

Logged
CA

Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description
	Depth	Type	Results				
	0.20	ES		0.30			Grass over dark brown silty clay with frequent rootlets. TOPSOIL
	0.50 0.50 0.50	ES D PP	PP=1.5kg/cm2				Firm to stiff dark orange mottled grey silty CLAY. WEALD CLAY
	1.00 1.00	D PP	PP=1.5kg/cm2				
	1.50 1.50	D PP	PP=2.5kg/cm2				becoming stiff from 1.5m
	2.00 2.00	D PP	PP=3kg/cm2	1.90			Very stiff dark red mottled orange sandy silty CLAY. WEALD CLAY
	2.50 2.50	D PP	PP=4.5kg/cm2	2.20			Hard light grey mottled red silty CLAY. WEALD CLAY
	2.90 3.00	PP D	PP=4.5kg/cm2	2.80 3.00			Hard dark reddish brown silty CLAY with occasional thin mudstone partings. WEALD CLAY
							End of Pit at 3.00m
Water Strikes Depth Strike Rose to (m/sig) Remarks Stability Stable							





Unit 7, Danworth Farm
Hurstpierpoint
BN6 9GL

Geo-Environmental www.gesl.net

Trial Pit Log

Trial Pit No

TP5

Sheet 1 of 1

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512556.00 - 116562.00
Level:

Date
19/06/2015

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

Dimensions (m): 3.00

Depth
3.00

0.80

Scale
1:25

Logged
CA

Client: Taylor Wimpey

Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
	Depth	Type	Results					
	0.20	ES					Grass over dark brown silty clay with frequent rootlets. MADE GROUND	
	0.50	ES		0.50			clay drainage pipe observed at 0.3m	
	0.50	D					Stiff dark brown mottled grey slightly sandy silty CLAY. WEALD CLAY	
	1.00	D						1
	1.00	PP	PP=2kg/cm2					
	1.50	D		1.40			Very stiff to hard light grey mottled orange silty CLAY with occasional thin mudstone partings. WEALD CLAY	
	1.50	PP	PP=3.5kg/cm2					
	2.00	D						2
	2.00	PP	PP=3.5kg/cm2					
	2.50	D					becoming hard from 2.5m	
	2.50	PP	PP=4kg/cm2					
	2.80	PP	PP=4.5kg/cm2					
	3.00	D		3.00			End of Pit at 3.00m	3
								4
								5

Water Strikes

Depth Strike

Remarks

Stability Stable





Unit 7, Danworth Farm
Hurstpierpoint
BN6 9GL

Geo-Environmental www.gesl.net

Trial Pit Log

Trial Pit No

TP6

Sheet 1 of 1

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512502.00 - 116587.00
Level:

Date
19/06/2015

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

Dimensions (m): 3.00

Depth
3.00

0.80

Scale
1:25

Logged
CA

Client: Taylor Wimpey

Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
	Depth	Type	Results					
	0.20	ES		0.30			Grass over dark brown silty clay with frequent rootlets and occasional roots up to 20mm. TOPSOIL	
	0.50 0.50 0.50	ES D PP	PP=2kg/cm2				Stiff to very stiff dark red mottled grey slightly sandy silty CLAY. WEALD CLAY	
	1.00 1.00	D PP	PP=4kg/cm2	1.10			becoming very stiff from 1.0m Stiff to hard dark brown mottled red slightly sandy silty fissured CLAY with frequent thin mudstone partings. WEALD CLAY	1
	1.50 1.50	D PP	PP=2.5kg/cm2					
	2.00 2.00	D PP	PP=4kg/cm2				becoming very stiff from 2.0m	2
	2.50 2.50	D PP	PP=4.5kg/cm2				becoming hard from 2.5m	
	2.80	PP	PP=4kg/cm2					
	3.00	D		3.00			End of Pit at 3.00m	3
								4
								5

Water Strikes
Depth Strike

Remarks

Stability Stable



 Unit 7, Danworth Farm Hurstpierpoint BN6 9GL www.gesl.net				Trial Pit Log				TrialPit No TP7 Sheet 1 of 1	
Project Name: Rectory Lane, Ashington				Project No. GE10884		Co-ords: 512605.00 - 116613.00 Level:		Date 19/06/2015	
Location: Rectory Lane, Ashington, West Sussex RH20 3AS						Dimensions (m): 3.00 0.80		Scale 1:25	
Client: Taylor Wimpey						Depth 3.00		Logged CA	
Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description		
	Depth	Type	Results						
	0.20	ES		0.30			Grass over dark brown silty clay with frequent and occasional roots up to 35mm. TOPSOIL		
	0.50	D					Stiff to hard dark brown mottled grey silty CLAY. WEALD CLAY		
	0.50	ES							
	0.50	PP	PP=2kg/cm2						
	1.00	D							
	1.00	PP	PP=3kg/cm2						
	1.50	D							
	1.50	PP	PP=3.5kg/cm2						
							becoming very stiff from 1.5m		
							extremely weak dark reddish brown MUDSTONE band at 1.8m		
	2.00	D					becoming hard from 2.0m		
	2.00	PP	PP=4kg/cm2						
	2.50	D							
	2.50	PP	PP=4kg/cm2						
	2.80	PP	PP=4.5kg/cm2						
	3.00	D		3.00			End of Pit at 3.00m		
Water Strikes Depth Strike Rose to (mbsgl) Remarks Stability Stable									





Unit 7, Danworth Farm
Hurstpierpoint
BN6 9GL

Geo-Environmental www.gesl.net

Trial Pit Log

Trial Pit No

TP8

Sheet 1 of 1

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512612.00 - 116541.00
Level:

Date
19/06/2015

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

Dimensions (m): 3.00

Depth
3.00

0.80

Scale
1:25

Logged
CA

Client: Taylor Wimpey

Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
	Depth	Type	Results					
	0.20	ES		0.30			Grass over dark brown silty clay with frequent rootlets and occasional roots up to 20mm. TOPSOIL	
	0.50 0.50 0.50	ES D PP	PP=2kg/cm2				Firm dark orangish brown silty CLAY with occasional black speckling. WEALD CLAY	
	1.00 1.00	D PP	PP=3.5kg/cm2	0.90			Stiff dark orange mottled grey sandy silty CLAY. WEALD CLAY	1
	1.50 1.50	D PP	PP=3.5kg/cm2				<i>slow water seepage observed at 1.6m</i>	
	2.00 2.00	D PP	PP=3kg/cm2	1.90			Stiff to very stiff dark brown mottled red slightly sandy silty fissured CLAY. WEALD CLAY	2
							<i>decayed vegetation fragments observed at 2.1m</i>	
	2.50 2.50	D PP	PP=4kg/cm2				<i>becoming very stiff from 2.5m</i>	
	2.80	PP	PP=4kg/cm2					
	3.00	D		3.00			End of Pit at 3.00m	3
								4
								5

Water Strikes

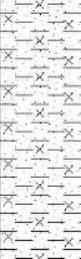
Depth Strike

Rose to (mbsgl)

Remarks Slow water seepage observed at 1.6m

Stability Stable



 Unit 7, Danworth Farm Hurstpierpoint BN6 9GL www.gesl.net				Trial Pit Log				Trial Pit No TP9 Sheet 1 of 1	
Project Name: Rectory Lane, Ashington				Project No. GE10884		Co-ords: 512602.00 - 116479.00 Level:		Date 18/06/2015	
Location: Rectory Lane, Ashington, West Sussex RH20 3AS						Dimensions (m): 0.80 3.00		Scale 1:25	
Client: Taylor Wimpey						Depth 3.00		Logged CA	
Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description		
	Depth	Type	Results						
	0.20	ES		0.30			Grass over dark brown silty clay with frequent rootlets. TOPSOIL		
	0.50	ES					Firm dark brown mottled grey slightly sandy silty CLAY. WEALD CLAY		
	0.50	D		1.20					
	0.50	PP	PP=1kg/cm2						
	1.00	D		1.20			becoming very stiff from 2.0m		
	1.00	PP	PP=1.5kg/cm2						
	1.50	D		2.70			slow water seepage observed at 2.3m		
	1.50	PP	PP=1.25kg/cm2						
	2.00	D		2.70			Very stiff light grey mottled orange sandy silty CLAY. WEALD CLAY		
	2.00	PP	PP=2.5kg/cm2						
2.50	D		3.00			End of Pit at 3.00m			
2.50	PP	PP=2.5kg/cm2							
2.80	PP	PP=3kg/cm2	3.00						
3.00	D								
Remarks Slow water seepage observed at 2.3m									
Stability Stable									





Unit 7, Danworth Farm
Hurstpierpoint
BN6 9GL

Geo-Environmental www.gesl.net

Trial Pit Log

Trial Pit No
TP10
Sheet 1 of 1

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512669.00 - 116476.00
Level:

Date
18/06/2015

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

Dimensions (m): 3.00

Depth
3.00

0.80

Scale
1:25

Logged
CA

Client: Taylor Wimpey

Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
	Depth	Type	Results					
	0.20	ES					Grass over dark brown silty clay with frequent rootlets and occasional roots up to 20mm. MADE GROUND <i>clay drainage pipe observed at 0.3m</i>	
	0.50 0.50	ES D		0.50			Stiff dark brown mottled grey slightly sandy silty CLAY. WEALD CLAY	
	1.00 1.00	D PP	PP=2kg/cm2		1.30		Very stiff dark reddish brown sandy silty CLAY. WEALD CLAY	1
	1.50 1.50	D PP	PP=2.5kg/cm2		1.80		Very stiff light grey mottled orange very sandy silty CLAY. WEALD CLAY	
	2.00 2.00	D PP	PP=2.5kg/cm2		2.30		Hard light grey silty CLAY with occasional thin mudstone partings. WEALD CLAY	2
	2.50 2.50	D PP	PP=4kg/cm2					
	2.80	PP	PP=4kg/cm2					
	3.00	D		3.00				
							End of Pit at 3.00m	3
								4
								5

Water Strikes

Depth Strike

Remarks

Stability Stable





Unit 7, Danworth Farm
Hurstpierpoint
BN6 9GL

Geo-Environmental www.gesl.net

Trial Pit Log

Trial Pit No

TP11

Sheet 1 of 1

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512670.00 - 116527.00
Level:

Date
19/06/2015

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

Dimensions (m):

3.00

Depth
3.00

0.80

Scale
1:25

Logged
CA

Client: Taylor Wimpey

Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
	Depth	Type	Results					
	0.20	ES					Grass over dark brown silty clay with frequent rootlets. MADE GROUND	
							clay drainage pipe observed at 0.3m	
	0.50 0.50	ES D		0.50			Stiff to very stiff dark brown mottled grey sandy silty CLAY. WEALD CLAY	
	1.00 1.00	D PP	PP=3.5kg/cm2				becoming very stiff from 1.0m	1
	1.50 1.50	D PP	PP=3.5kg/cm2					
				1.80			Very stiff to hard light grey mottled orange sandy silty CLAY with occasional thin mudstone partings. WEALD CLAY	2
	2.00 2.00	D PP	PP=3kg/cm2				becoming hard from 2.5m	
	2.50 2.50	D PP	PP=4.5kg/cm2					
	2.80	PP	PP=4.5kg/cm2					
	3.00	D		3.00			End of Pit at 3.00m	3
								4
								5

Water Strikes

Depth Strike

Rose to (mbsgl)

Remarks

Stability Stable





Unit 7, Danworth Farm
Hurstpierpoint
BN6 9GL

Geo-Environmental www.gesl.net

Trial Pit Log

Trial Pit No

TP12

Sheet 1 of 1

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512766.00 - 116525.00
Level:

Date
19/06/2015

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

Dimensions (m):

3.00

Depth
3.00

0.80

Scale
1:25

Logged
CA

Client: Taylor Wimpey

Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
	Depth	Type	Results					
	0.20	ES		0.30			Grass over dark brown silty clay with frequent rootlets. TOPSOIL	
	0.50 0.50 0.50	D ES PP	PP=1.8kg/cm2				Stiff dark brown mottled grey silty CLAY. WEALD CLAY	
	1.00 1.00	D PP	PP=2kg/cm2	0.90			Stiff dark brown mottled red slightly sandy silty fissured CLAY. WEALD CLAY	1
	1.50 1.50	D PP	PP=2kg/cm2					
				1.80			Stiff light grey mottled brown silty CLAY. WEALD CLAY	2
	2.00 2.00	D PP	PP=3.5kg/cm2	2.30			Very stiff light grey mottled orange silty CLAY with occasional thin mudstone partings. WEALD CLAY	
	2.50 2.50	D PP	PP=3.5kg/cm2					
	2.80	PP	PP=4kg/cm2					
	3.00	D		3.00			End of Pit at 3.00m	3
								4
								5

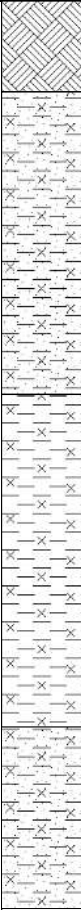
Water Strikes

Depth Strike

Remarks

Stability Stable



 Unit 7, Danworth Farm Hurstpierpoint BN6 9GL www.gesl.net				Trial Pit Log				Trial Pit No TP13 Sheet 1 of 1	
Project Name: Rectory Lane, Ashington				Project No. GE10884		Co-ords: 512730.00 - 116577.00 Level:		Date 19/06/2015	
Location: Rectory Lane, Ashington, West Sussex RH20 3AS						Dimensions (m): 3.00 0.80		Scale 1:25	
Client: Taylor Wimpey						Depth 3.00		Logged CA	
Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description		
	Depth	Type	Results						
	0.20	ES	PP=1.8kg/cm2	0.30			Grass over dark brown silty clay with frequent rootlets and occasional roots up to 20mm. TOPSOIL		
	0.50	D					Stiff dark brown mottled red slightly sandy silty fissured CLAY. WEALD CLAY		
	0.50	ES							
	0.50	PP							
	1.00	D	PP=2kg/cm2	1.30			Very stiff dark brown mottled grey silty CLAY. WEALD CLAY		
	1.00	PP							
	1.50	D	PP=2.8kg/cm2				decayed vegetation fragments observed at 1.8m		
	1.50	PP							
	2.00	D	PP=2.8kg/cm2	2.40			Very stiff dark brown mottled orange sandy silty CLAY with occasional thin mudstone partings. WEALD CLAY		
	2.00	PP							
2.50	D	PP=3kg/cm2			occasional selenite crystals observed at 2.8m				
2.50	PP								
2.80	PP	PP=4kg/cm2	3.00		End of Pit at 3.00m				
3.00	D								

Trial Pit Log

TrialPit No
TP14
Sheet 1 of 1

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512677.00 - 116653.00
Level:

Date
19/06/2015

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

Dimensions (m): 3.00

Scale
1:25

Client: Taylor Wimpey

Depth
3.00

0.80

3.00

Logged
CA

[illegible]



Unit 7, Danworth Farm
Hurstpierpoint
BN6 9GL

Geo-Environmental www.gesl.net

Trial Pit Log

Trial Pit No

TP15

Sheet 1 of 1

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512765.00 - 116635.00
Level:

Date
19/06/2015

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

Dimensions (m):

3.00

Depth
3.00

0.80

Scale
1:25

Logged
CA

Client: Taylor Wimpey

Water Strike	Samples & In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
	Depth	Type	Results					
	0.20	ES					Grass over dark brown silty clay with frequent rootlets. MADE GROUND	
	0.50 0.50	ES D		0.50			Stiff dark orange mottled grey silty CLAY. WEALD CLAY	
	1.00 1.00	D PP	PP=2kg/cm2	1.10			Very stiff dark brown mottled red slightly sandy silty fissured CLAY with frequent thin mudstone partings. WEALD CLAY	1
	1.50 1.50	D PP	PP=3.8kg/cm2					
	2.00 2.00	D PP	PP=4kg/cm2					2
	2.50 2.50	D PP	PP=4kg/cm2					
	2.80	PP	PP=4kg/cm2					
	3.00	D		3.00				3
							End of Pit at 3.00m	
								4
								5

Water Strikes

Depth Strike

Rose to (mbsgl)

Remarks

Stability Stable





www.gesl.net

Borehole Log

Borehole No.

WS1

Sheet 1 of 1

Project Name: Rectory Lane, Ashington

Project No.
GE10884

Co-ords: 512393E - 116487N

Hole Type	WLS
1	0.0000
2	0.0000
3	0.0000
4	0.0000
5	0.0000
6	0.0000
7	0.0000
8	0.0000
9	0.0000
10	0.0000
11	0.0000
12	0.0000
13	0.0000
14	0.0000
15	0.0000
16	0.0000
17	0.0000
18	0.0000
19	0.0000
20	0.0000
21	0.0000
22	0.0000
23	0.0000
24	0.0000
25	0.0000
26	0.0000
27	0.0000
28	0.0000
29	0.0000
30	0.0000
31	0.0000
32	0.0000
33	0.0000
34	0.0000
35	0.0000
36	0.0000
37	0.0000
38	0.0000
39	0.0000
40	0.0000
41	0.0000
42	0.0000
43	0.0000
44	0.0000
45	0.0000
46	0.0000
47	0.0000
48	0.0000
49	0.0000
50	0.0000
51	0.0000
52	0.0000
53	0.0000
54	0.0000
55	0.0000
56	0.0000
57	0.0000
58	0.0000
59	0.0000
60	0.0000
61	0.0000
62	0.0000
63	0.0000
64	0.0000
65	0.0000
66	0.0000
67	0.0000
68	0.0000
69	0.0000
70	0.0000
71	0.0000
72	0.0000
73	0.0000
74	0.0000
75	0.0000
76	0.0000
77	0.0000
78	0.0000
79	0.0000
80	0.0000
81	0.0000
82	0.0000
83	0.0000
84	0.0000
85	0.0000
86	0.0000
87	0.0000
88	0.0000
89	0.0000
90	0.0000
91	0.0000
92	0.0000
93	0.0000
94	0.0000
95	0.0000
96	0.0000
97	0.0000
98	0.0000
99	0.0000
100	0.0000

Location: Rectory Lane, Ashington, West Sussex RH20 3AS

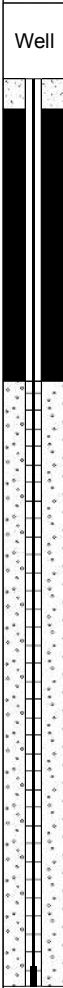
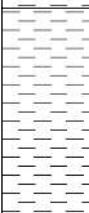
Level:

Scale
1:25

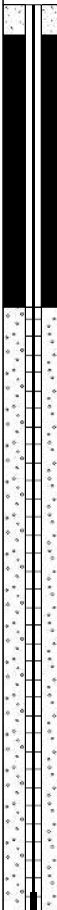
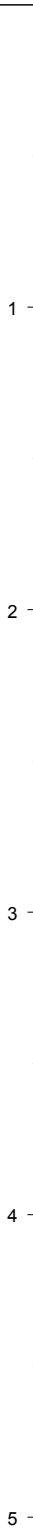
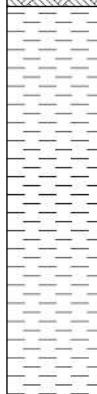
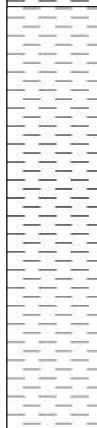
Client: Taylor Wimpey

Dates: 11/06/2015

Logged By
GR

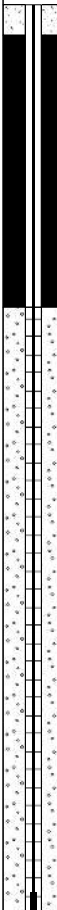
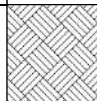
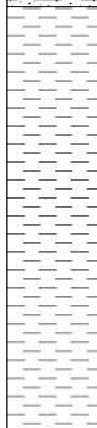
Well	Water Strikes	Sample and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description		
		Depth (m)	Type	Results						
		0.20	ES	1.5kg/cm2	0.30			Dark brown silty CLAY with roots	1	
		0.50	ES					Stiff brown and dark brown silty CLAY		
		1.00	D	3.0kg/cm2	0.55			Firm to stiff orange-brown CLAY	2	
		1.00	PP							Very stiff light grey and brown mottled CLAY
		1.50	D	2.70			Very stiff dark brown and light grey mottled CLAY		3	
		1.50	PP					3.00		D
		2.00	D	2.70						4
		2.50	D							
		3.00	D	3.00	D	3.00	End of Borehole at 3.00m	5		
		Casing		Water Strikes (mbgl)		Chiselling (mbgl)		Remarks		
Diameter	Depth (m)	Depth Strike	Rose to	Depth from	Depth to					
										

 Unit 7, Danworth Farm Hurstpierpoint BN6 9GL www.gesl.net		Borehole Log				Borehole No. WS3	
Project Name: Rectory Lane, Ashington		Project No. GE10884		Co-ords: 512673E - 116714N		Sheet 1 of 1	
Location: Rectory Lane, Ashington, West Sussex RH20 3AS				Level:		Hole Type WLS	
Client: Taylor Wimpey				Dates: 11/06/2015		Scale 1:25	
Logged By GR							

Well	Water Strikes	Sample and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
		0.20	ES		0.30		Dark brown silty CLAY with roots		
		0.50	ES						Firm to stiff brown and light grey CLAY with occasional pockets of ferruginous sand and occasional medium angular gravel of shaley ironstone
		1.00 1.00	D PP	1.5kg/cm2	1.60				
		1.50 1.50	D PP	3.2kg/cm2					
		2.00 2.00	D PP	5.0kg/cm2					
		2.50 2.50	D PP	5.0kg/cm2					
	3.00 3.00	D PP	5.0kg/cm2	3.00		End of Borehole at 3.00m			

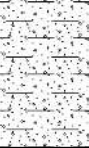
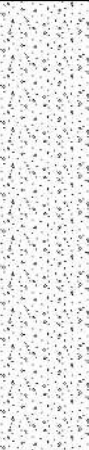
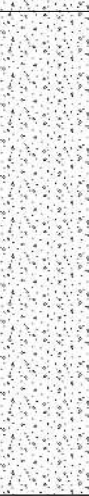
Casing		Water Strikes (mbgl)		Chiselling (mbgl)		Remarks	
Diameter	Depth (m)	Depth Strike	Rose to	Depth from	Depth to		

 Unit 7, Danworth Farm Hurstpierpoint BN6 9GL www.gesl.net		Borehole Log				Borehole No. WS4 Sheet 1 of 1	
Project Name: Rectory Lane, Ashington		Project No. GE10884		Co-ords: 512763E - 116473N		Hole Type WLS	
Location: Rectory Lane, Ashington, West Sussex RH20 3AS				Level:		Scale 1:25	
Client: Taylor Wimpey				Dates: 11/06/2015		Logged By GR	

Well	Water Strikes	Sample and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
		0.20	ES		0.35		Dark brown silty CLAY with roots	1	
		0.50	ES						Firm orange-brown slightly sandy CLAY with some fine and medium subangular flint gravel
		1.00	D		1.20				
		1.00	PP	1.5kg/cm2			Medium dense orange-brown and light grey fine and medium SAND with occasional clay pockets		
		1.50	D		1.60				
							Stiff becoming very stiff brown and light grey mottled CLAY		
		2.00	D					2	
		2.00	PP	2.5kg/cm2					
		2.50	D						
		2.50	PP	4.8kg/cm2					
	3.00	D		3.00			3		
	3.00	PP	4.0kg/cm2			End of Borehole at 3.00m			
								4	
								5	

Casing		Water Strikes (mbgl)		Chiselling (mbgl)		Remarks	
Diameter	Depth (m)	Depth Strike	Rose to	Depth from	Depth to		
		1.50	3.00				

 Unit 7, Danworth Farm Hurstpierpoint BN6 9GL www.gesl.net		Borehole Log				Borehole No. WS5 Sheet 1 of 1	
Project Name: Rectory Lane, Ashington		Project No. GE10884		Co-ords: 512568E - 116459N		Hole Type WLS	
Location: Rectory Lane, Ashington, West Sussex RH20 3AS				Level:		Scale 1:25	
Client: Taylor Wimpey				Dates: 11/06/2015		Logged By GR	

Well	Water Strikes	Sample and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
		0.20	ES	5.0kg/cm2				Dark brown silty CLAY with roots	
		0.50	ES		0.40			Firm orange-brown and dark brown clayey fine SAND	
		0.60					Medium dense orange-brown and light grey mottled slightly gravelly SAND with occasional clay pockets. Gravel is fine to medium angular to subangular flint.		
	1.00	D							
	1.00	PP			1.10			Medium dense becoming dense orange-brown and light grey slightly gravelly SAND. Gravel is fine to coarse subangular flint.	
	1.50	D							
	2.00	D							
	2.50	D			2.60				
	3.00	D			3.10			Dense orange-brown gravelly SAND with dark brown purple and black ferruginous staining and gravel of ironstone and mudstone	
	3.50	D						Dense grey slightly gravelly SAND. Gravel is medium to coarse flint ironstone and mudstone	
	4.00	D							
	4.50	D			4.70			Very stiff grey CLAY	
5.00	D		5.00		End of Borehole at 5.00m				

Casing		Water Strikes (mbgl)		Chiselling (mbgl)		Remarks
Diameter	Depth (m)	Depth Strike	Rose to	Depth from	Depth to	
		2.00	1.70			

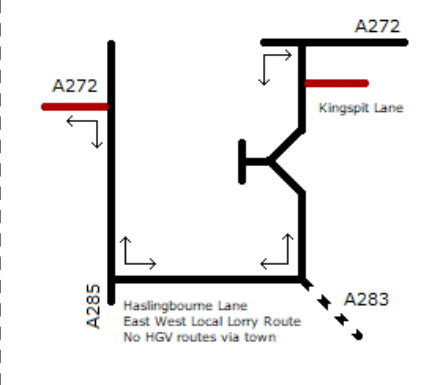


Appendix C WSCC Lorry Route Network

Notes

1. All lorry movements in the County are expected to use these routes except for local access.
2. Local access trips using roads not shown on the map must be made in accordance with traffic signing and these roads should be avoided as far as possible.

Petworth Insert (Detail)



A286 Not suitable further North due to low bridge 13'0" (3.96m)

N.B. Drivers should note a signed lorry diversion route is in operation for A272 and journeys via A285 and A283

HAMPSHIRE

SURREY

KENT

EAST SUSSEX

0 5 10 km

ROADSIDE FACILITIES

- Services
- Overnight Lorry Parking
- Use in preference for A24 to A27 eastbound movements and A27 to A24 northbound movements
- Use in preference for A24 to A27 westbound movements and A27 to A24 northbound movements

LEGEND

- Railway Station
- Lorry Route
- Railway
- County Boundary

Reproduced from or based upon 2021 Ordnance Survey mapping with permission of the Controller of HMSO © Crown Copyright reserved.
 Unauthorised reproduction infringes Crown copyright and may lead to prosecution or civil proceedings West Sussex County Council Licence No. 100023447.
 Contains OS data © Crown copyright and database right 2021.

LORRY ROUTE NETWORK

Routes are free from height and width restrictions within West Sussex.
 Routes not shown may carry restrictions.

